## ENGINE LOGS

## **Service Information**

Consult the Continental Motors web site at continentalmotors.aero for engine related news or announcements. Continental Motors Internet Service contains useful information for Continental Motors engine owners, including electronic versions of the most current engine Instructions for Continued Airworthiness and service documents that may be pertinent to your engine model.

If Internet access is not available, contact our Customer Service Department at:

1-888-826-5465 Toll free in the United States or

1-251-436-8299 International

## **Engine Returns**

Return engines for core credit with this log book to:
Continental Motors, Inc.
2039 Broad Street
Mobile, AL 36615 USA

Return engines for overhaul with this log book to:

Continental Motors, Inc. Factory Service Center 8600 County Road 32 Fairhope, Alabama 36532 USA

USE ONLY FUEL SPECIFIED IN OPERATOR'S MANUAL OR TYPE CERTICATE DATA SHEET USE OF AUTOMOTIVE FUEL IS PROHIBITED



FAA PRODUCTION CERTIFICATE NO. 508

Printed:08/25/2015

Test Date<sub>08/25/2015</sub>

This engine model TSI0550N1B, serial number 1031045 was rebuilt by Continental Motors Inc, in accordance with approved design data and the applicable requirements of 14 CFR, Part 21 and 43 of the Federal Aviation Regulation. The approved design data for this engine incorporates all changes required by applicable Airworthiness Directives and Continental Motors Service Bulletins.

CONTINENTAL MOTORS, INC.

Form 6012-04 (Rev Sept 2014)

Date

Total Time

Time Since Last Overhaul

Engine Service and Maintenance Record

Record maintenance actions including engine part removal and installation and compliance with inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins



Date: 3/14/2016; Aircraft: N8AE; Type: CIRRUS; S/N: 2999; Hobbs: 2001.8; Total Time: 1954.6; Engine - Type: TSIO-550-N (1B), S/N: 1031045, Time:

-Installed Rebuilt engine M/N TSIO-550N(1B) S/N 1031045 on Cirrus SR-22 S/N 2999 IAW STC#SA03962AT-E

-Complied with Cirrus 100hr inspection checklist.

-Serviced oil with 8 quarts of AS 100. Installed new oil filter.

-Verified correct mag timing L&R.

-Inspected electrical wiring for chafing and security.

-Inspected Fluid carrying hoses.

-Removed gascolator cleaned, inspected and reinstalled.

-Compression Check #1 78/80 #2 78/80 #3 78/80 #4 78/80 #5 78/80 #6 78/80 MO 42/80

-Verified AD compliance through bi-weekly issue 2016-04

-Complied with fuel set-up (CMI SID 97-3G).

-Performed post inspection operational check of aircraft systems - all working normal at this time.

The above work was performed in accordance with current regulations of the Federal Aviation Administration and is approved for return to service pertaining to work performed.

Steve Miller A&P 2700197 6530 Takupa Executive Airport Rd. Tampa, FI 33610

EXEC AERO, LI	C 201 NIL	SON WAY, OI	RLANDO, FL	32803 40	7-420-7934	<u> </u>		 
N8AE								
2008 CIRRUS S	SR22 SN: 29	99						
05/03/16 HOB		FLIGHT: 19	73.8					
CONTINENTAL	IO-550IN							
DRAINED ENGI								•
DEFECTS NOTE								
20W50 OIL. INS MM & AC 43.13.	OPS CHECK	K GOOD WITH	H NO LEAKS	NOTED.	IE I/AVVV C	IKKUS	-	
	11		ے			_		
4	14	>					,	
7	PV						-	
JOHN STEVENS AP3066228IA	3						_	 
AP30002201A								
	,							
		1						

1

	Total	Time	1	nce Last rhaul	Engine Service and Maintena	nce Record		
Date	Hours	Min	Hours	Min	Record maintenance actions including engine installation and compliance with inspections, Airwin Special Inspections, Modifications and Service Bull	orthiness Directives,		
Carried forwa	ENGINE LOG Phillipsburg Airport Date:Oct.3,2016 N8AE Make:Cirrus Model:SR22 S/N 2999 Hobbs:2071.8 Flight Meter:2024.2							
	Drained oil, removed oil filter and inspected, no metal noted. Installed new oil filter P/N#AA48108 and serviced engine with 7 quarts Phillips 20W-50XC.  Adjusted idle mixture and idle RPM. All work performed I/A/W Cirrus AMM.  Ground run satisfactory.							
	I certify that to regard to work do Tim Masters 2802		escribed	above. 1/				
	ENGINE LO Date:Oct. Hobbs:207	.6,2016 71.8		Make:Cirr	Flight Meter:2024.4			
	Removed LH and RH Turbochargers and installed O/H'd Turbochargers,P/N# 646677,per Continental Motors Warranty replacement. All work performed I/A/W Cirrus AMM.Ground run satisfactory.							
	I certify that this engine is approved for return to service with regard to work described above.  Tim Masters 2802663IA							



1/27/17	N8AE	Hobbs: 2099.9
W/O 40809	Cirrus SR22 S/N 2999	Flight: 2052.4
Engine TCM	TSIO-550-K (1) S/N 1031045	ETSN: 97.8

- Drained oil, sample taken, inspected filter, no defects noted. Installed new filter CH48108-1.
- Serviced with 7qts Phillips 20w-50 XC.
- Removed Magnetos P/N BL-500556-101 LH S/N: D15GA182R RH S/N: D15GA178R.
- Installed Rebuilt Magnetos P/N BL-500556-101 <u>LH S/N: D16JA150R</u> <u>RH S/N: D16JA152R</u>. Timed to 24° BTC.
- Ground run, Leak and Operational check good.

I certify this aircraft has been inspected / repaired in accordance with the current manufacturers maintenance manuals, an	d current
FAA regulations. With respect to the work / inspections performed the aircraft identified above is found to	
be In airworthy condition and is approved for return to service.	

be In airworthy condition and is approved for return to service.
AUTHORIZED SIGNATURE FOR: Travis Buchanan A&P/IA 3202781
PORT CITY AIR, INC. / NEW HAMPSHIRE HELICOPTERS, 104 GRAFTON DRIVE, PORTSMOUTH, NH 03801



Cirrus SR22 S/N 2999

TSIO-550-K (1) S/N 1031045

1.0 . 1.1 . 11.1

C1: OTT40100 1

Hobbs: 2099.9

Flight: 2052.4

ETSN: 97.8

•	Drained oil, sample taken, inspected filter, no defects noted. Installed new filter CH48108-1.
•	Serviced with 7qts Phillips 20w-50 XC.
	D 134 DAIDY COOKES TO THE ONLY DISCOURAGE DISCOURAGE

Removed Magnetos P/N BL-500556-101 LH S/N: D15GA182R RH S/N: D15GA178R.

• Installed Rebuilt Magnetos P/N BL-500556-101 LH S/N: D16JA150R RH S/N: D16JA152R. Timed to 24° BTC.

Ground run, Leak and Operational check good.

1/27/17

W/O 40809

Engine TCM

I certify this aircraft has been inspected / repaired in accordance with the current manufacturers maintenance manuals, and current FAA regulations. With respect to the work / inspections performed the aircraft identified above is found to be In airworthy condition and is approved for return to service.

AUTHORIZED SIGNATURE FOR: Travis Buchanan A&P/IA 3202781 PORT CITY AIR, INC. / NEW HAMPSHIRE HELICOPTERS, 104 GRAFTON DRIVE, PORTSMOUTH, NH 03801



Date: 4/14/2017; Aircraft: N8AE; Type: SR22; S/N: 2999; Hobbs: 2113.70; Tach: 2066.30; Total Time:

\*Performed a 100 Hour/Annual Inspection of the Engine in accordance with the inspection checklist contained in the SR22 Maintenance Manual. Performed a Differential Compression Check with the following results: Cylinder #1 70/80, Cylinder #2 69/80, Cylinder #3 69/80, Cylinder #4 69/80, Cylinder #5 70/80, Cylinder #6 69/80. Checked the Magneto Timing. Cleaned, gapped, and tested the spark plugs. Lubricated the engine controls and slip joints after cleaning. Drained and screened the oil for particles with none noted. Removed, cut open and inspected the oil filter for particles with none noted. Installed a new oil filter CH48108-1, torqued and safetied. Added 7quarts of 20W50XC oil. Washed the engine with varsol and dried with compressed air. Ground ran the engine and checked for oil leaks with no leaks noted.

\*Performed a boroscope inspection with no dicrepancies found.

\*Clean conections on #6 cylinder EGT sensor and recheck at out going run.

\*Clean connections to the #2 and 4 cylinder CHT recheck on outgoing run.

\*Performed several test flights and adjustments as required. (MAP 36.4 @ 40GPH).

\*Removed the Skytec starter p/n c24st3 s/n 4c3-111511 and installed a new Hartzell Energizer p/n ES646275-1 s/n HQ121519.

\*I certify that this engine has been inspected in accordance with an Annual/100 hour Inspection and was determined to be in airworthy condition and is approved for return to service. Pertinent details of this inspection are on file at Infinity Aviation Services LLC under the work order listed.

work order asted.

Signature: Alan Desrosiers

Date: 04/14/2017, W/O: 116423 Infinity Aviation Services LLC FAA Certified Repair Station

#I6FR992Y

7/14/17 N8AE Hobbs: 2144.5

W/O 40853 Cirrus SR22 S/N 2999 Flight: 2088.9

Engine TCM TSIO-550-K (1) S/N 1031045 ETSN: 134.3

- Drained oil, sample taken, inspected filter, no defects noted. Installed new filter CH48108-1.
- Serviced with 7qts Phillips 20w-50 XC & 1pint Cam Guard.
- Increased oil pressure to 55PSI; 175°@ 2400rpm.
- Checked #6 CHT probe and connection, applied Stabilant 22 to pins. No defects noted.
- Adjusted idle RPM to 700-650 RPM.
- Reset ignition timing to 24° BTDC.
- Inspected engine baffling & seals; no defects noted.
- Ground run, Leak and Operational check good.

I certify this aircraft has been inspected / repaired in accordance with the current manufacturers maintenance manuals, and current FAA regulations. With respect to the work / inspections performed the aircraft identified above is found to

be In airworthy condition and is approved for return to service.

AUTHORIZED SIGNATURE FOR: Richard Ruel A&P 5526834\_

PORT CITY AIR, INC. / NEW HAMPSHIRE HELICOPTERS, 104 GRAFTON DRIVE, PORTSMOUTH, NH 03801



11/2/17	N8AE	Hobbs: 2176.7
W/O 40884	Cirrus SR22 S/N 2999	Flight: 2113.5
Engine TCM	TSIO-550-K (1) S/N 1031045	ETSN: 158.9

- Drained oil, sample taken, inspected filter, no defects noted. Installed new filter CH48108-1.
- Serviced with 7qts Phillips 20w-50 XC & 11.2 ounces Cam Guard.
  Decreased oil pressure 1/2 turn.
  Replaced top cowling anti-chafe seal.

- Ground run, Leak and Operational check good.

I certify this aircraft has been inspected / repaired in accordance with the current manufacturers maintenance manuals, and current
FAA regulations. With respect to the work / inspections performed the aircraft identified above is found to
be In airworthy condition and is approved for return to service

be in all worthly condition and is approved for return to service.	
AUTHORIZED SIGNATURE FOR: Richard Ruel A&P 5526834	
PORT CITY AIR, INC. / NEW HAMPSHIRE HELICOPTERS, 104 GRAFTON DRIVE, PORTSMOUTH,	





APG Aviation - Maintenance & Repair 28000 Airport Rd. A-17 Punta Gorda, FL 33982 Tel: 941-575-8605 • Fax: 941-575-8734 • ga@avionix.com

03-21-2018 N8AE CIRRUS SR22 SN 2999 HM 2192.5 FLT 2127.1

CW THE 100hr INSPECTION IAW CIRUS AMM CHECKLIST. COMPRESSIONS OVER 80: 1)72 2)78 3)70 4)70 5)72 6)79. M.O 42/80. CHANGED OIL AND FILTER. SERVICED WITH 7qts PHILLIPS XC 20W-50 AND FILTER AA48108-2. CUT AND INSPECT FILTER. BLACKSTONE SAMPLE TAKEN. ADD 1pt CAMGUARD. INSPECT FUEL INJECTORS. CLEAN, GAP, AND ROTATE SPARK PLUGS. CW BORESCOPE INSPECTION. SERVICE INDUCTION AIR FILTER. SERVICE GASCOLATOR. REPLACED FAULTY #6 CHT PROBE 16578-001 AND APPLIED STABILANT 22 TO CONNECTORS. OPERATIONAL CHECK SATISFACTORY.

BRIGIT SWANSON 3831139 AP Brigis Transon

I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IAW AN ANNUAL INSPECTION AS PER CIRRUS SR22 INSPECTION CHECKLIST AND WAS FOUND TO BE IN AN AIRWORTY CONDITION. MAINTENANCE PERFORMED IAW CURRENT FAA REGULATIONS AND IS APPROVED FOR RETURN TO SERVICE. ADS THRU REV 2018-04.

HARALD R WOLF

gholf