



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035



Bill To: Altas Aviation, LCC
1447 Souza Dr.
El Dorado Hills, CA 95762

Invoice Number: INV18-01066
Account Code: ALTA002
P.O. Number:
Job Number:

Title: N8140V - Misc Repairs

Payment Type: On Account

Payment Terms: COD Upon
completion/delivery

Invoice Date: 11/15/2018

Exchange Rate: 1.000000 USD

INVOICE SUMMARY FOR WORK ORDER NUMBER: P17247

Registration Number: N8140V

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	3,089.50 USD	3,089.50 USD
Parts:	3,870.61 USD	185.37 USD	4,055.98 USD
Services:	1,798.00 USD	10.00 USD	1,808.00 USD
Freight:	---	---	416.11 USD
Total:	5,668.61 USD	3,284.87 USD	9,369.59 USD
Tax:			350.30 USD
Subtotal:			9,719.89 USD
Previous Billing:			-3,000.00 USD
Total:			6,719.89 USD



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: Atlas Aviation, LCC

WO #: P17247

Invoice Number: INV18-01066

See our website for complete terms and conditions: <http://woodlandaviation.com/WAweb-terms.html>.

Note 1. Additional parts, labor, and/or service may be required to complete this discrepancy (squawk).

Payment Terms

Prices estimated are in US dollars. Sales tax as applicable @ 7.25%.

Shipping and handling (including "Priority shipping and handling" for warranty parts / services), and tax are additional and post upon work order closing to invoice.

Deposit Requirements

a. 100% parts & service estimated and ¼ of labor.

or

b. Annual, Phase, or Letter Inspection Flat rate fee prior to start of inspection (additional deposit may be required dependent on inspection findings and elected repairs).

or

c. As determined for specific maintenance/avionics request.

All labor, parts, services, shipping and handling, tax, and fuel provided (including past open invoices) are due upon completion and/or delivery unless prior approval received by VP Woodland Aviation, Inc..

Governing Law

This agreement is construed as having been made in the State of California. Any lawsuit to interpret or enforce this Agreement shall be brought in the State of California and exclusive jurisdiction shall lie with the courts located in the County of Yolo.

I hereby authorize Woodland Aviation, Inc. to complete the above listed work that has been initialed approved, providing the cost does not exceed the estimate by more than 10%. Woodland Aviation, Inc. will notify the owner or agent for the owner of any repair costs necessary in addition to the above items for approval before proceeding with any additional work.



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: Atlas Aviation, LCC

WO #: P17247

Invoice Number: INV18-01066

Item: 1. MAINTENANCE

Part/Model #:

Item Serial Number:

Registration Number: N8140V

Aircraft Serial Number: 677

Discrepancy: 1.1 NLG UPPER PUCK PAN BUSHING MIGRATED OUT & CONTACTING ENGINE MOUNT WITH WEIGHT ON WHEELS.

REMOVED NLG UPPER AND LOWER PUCK PAN ASSEMBLY. INSPECTED UPPER PAN ATTACH POINTS AND FOUND LEFT HAND BUSHING HOLE DAMAGED AND SPACERS MUSHROOMED.

AFTER DISASSEMBLY AND INSPECTION OF LOWER PAN ASSEMBLY FOUND CENTER SHAFT BUSHING SCORED, BUMPER SPLITTING AND LOWER ATTACH SPACERS MUSHROOMED AND SEIZED.

REQUIRES PUCK PAN, BUSHINGS, AND REBOUND BUMPER REPLACEMENT.

Resolution: REMOVED NLG UPPER AND LOWER PUCK PAN ASSEMBLY. INSPECTED UPPER PAN ATTACH POINTS AND FOUND LEFT HAND BUSHING HOLE DAMAGED AND SPACERS MUSHROOMED.

AFTER DISASSEMBLY AND INSPECTION OF LOWER PAN ASSEMBLY FOUND CENTER SHAFT BUSHING SCORED, BUMPER SPLITTING AND LOWER ATTACH SPACERS MUSHROOMED AND SEIZED. (DC)

INSTALLED NEW NOSE LANDING GEAR UPPER PUCK PAN ASSEMBLY P/N 13549-002 AND NEW BUSHINGS P/N NAS77-10-013 & P/N 13705-003 WITH NEW REBOUND BUMPER P/N 18380-001 AND SPACER WASHERS P/N NAS1149F1032P PER CIRRRUS SR22 AMM. TORQUED AND SAFETIED ALL ATTACHING HARDWARE. OPERATIONAL CHECKED NORMAL. (RDMYAC)

TORQUE WRENCH(ES) USED FOR THIS APPLICATION P/N 24330 CAL# DN5170 DUE DATE 8-25-19

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	290.00 USD	290.00 USD
Parts:	1,082.36 USD	---	1,082.36 USD
Freight:	71.05 USD	---	71.05 USD
Total:	1,153.41 USD	290.00 USD	1,443.41 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
1.1 #1	13549-002	ASSY, PAN, PUCK UPR	1.00	856.08 USD	885.02 USD
			Freight:	28.94 USD	
1.1 #2	13705-003	SPACER, BUSHING,NLG	2.00	11.85 USD	23.70 USD
1.1 #3	NAS77-10-013	BUSHING FLANGED PRESS 5/8"	2.00	14.44 USD	28.88 USD
1.1 #4	13705-004	SPACER,BUSHING,NLG	2.00	11.85 USD	28.70 USD
			Freight:	5.00 USD	
1.1 #5	17481-001	BUSHING, LOWER PUCK PAN	1.00	31.00 USD	31.00 USD
1.1 #6	18380-001	BUMPER, REBOUND, NLG SR22	1.00	119.00 USD	156.11 USD
			Freight:	37.11 USD	
1.1 #7	13705-003	SPACER, BUSHING,NLG	2.00	0.00 USD	0.00 USD
1.1 #8	NAS1149F1032P	WASHER, FLAT	2.00	0.00 USD	0.00 USD



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: Atlas Aviation, LCC

WO #: P17247

Invoice Number: INV18-01066

Discrepancy: 1.2 NLG SPINDLE TENSION OUT OF SPEC (HIGH).

DISASSEMBLED NLG FORK ASSEMBLY AND INSPECTED HARDWARE. FOUND BELLVILLE WASHERS FLAT AND UPPER FRICTION WASHER WORN. INSPECTED TEFLON COATINGS ON SPINDLE AND SPINDLE CUPS AND NOTED TEFLON WORN AWAY AND HAS METAL TRANSFERRING.

REQUIRES CHANGING SPINDLE AND SPINDLE CUPS ALONG WITH ALL ATTACHING HARDWARE.

Resolution: DISASSEMBLED NLG FORK ASSEMBLY AND INSPECTED HARDWARE. FOUND BELLEVILLE WASHERS FLAT AND UPPER FRICTION WASHER WORN. INSPECTED TEFLON COATINGS ON SPINDLE AND SPINDLE CUPS AND NOTED TEFLON WORN AWAY AND HAS METAL TRANSFERRING.

REMOVED SPINDLE CUP AND GLUED ON NEW SPINDLE CUP P/N 18110-001 AND CURED. INSTALLED NOSE FORK ASSEMBLY WITH NEW TEFLON BUSHINGS P/N 50544-001 & P/N 50543-001, THRUST WASHER P/N 50545-001 AND BELLEVILLE WASHERS. SET BRAKE AWAY TENSION AND SAFETIED PER CIRRUS SR22 AMM 32-00. (RDMYAC)

TORQUE WRENCH(ES) USED FOR THIS APPLICATION P/N 24330 CAL# DN5170 DUE DATE 8-25-19

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	507.50 USD	507.50 USD
Parts:	366.81 USD	---	366.81 USD
Freight:	57.94 USD	---	57.94 USD
Total:	424.75 USD	507.50 USD	932.25 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
1.2 #1	18110-001	SUPERCEDING 11637-001 SPINDLE CUP NOSE LANDING GEAR	1.00	150.16 USD	179.24 USD
			Freight:	29.08 USD	
1.2 #2	50544-001	BEARING, Nose Fork, Teflon Coated	1.00	21.90 USD	21.90 USD
1.2 #3	50543-001	FLANGED BEARING, Nose Fork, Teflon Coated	1.00	21.90 USD	21.90 USD
1.2 #4	50545-001	THRUST WASHER, Nose Fork, Teflon Coated	1.00	20.00 USD	20.00 USD
1.2 #5	AN970-8	WASHER FLAT	1.00	1.65 USD	1.65 USD
1.2 #6	50750-101	BELLEVILLE WASHER	4.00	13.16 USD	57.64 USD
			Freight:	5.00 USD	
1.2 #7	NAS1149F0863P	WASHER	1.00	0.08 USD	0.08 USD
1.2 #8	MS17826-8	NUT, HEX, SELF LOCKING, CASTELLATED	1.00	7.56 USD	7.56 USD
1.2 #9	MS24665-355	COTTER PIN, SPLIT	1.00	0.10 USD	0.10 USD
1.2 #10	50195-001U	ADHESIVE,PASTE EC-2615B/A50 grams/TUBE STORE @60-80 DEG F ONLY	1.00	90.82 USD	114.68 USD
			Freight:	23.86 USD	



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: Atlas Aviation, LCC

WO #: P17247

Invoice Number: INV18-01066

Discrepancy: 1.3 NLG WHEEL PANT, RH ATTACH BRACKET CRACKED.

REPLACE BRACKET.

Resolution: INSTALLED NEW NOSE LANDING GEAR RIGHT WHEEL PANT BRACKET AND SAFETIED.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	43.50 USD	43.50 USD
Parts:	65.62 USD	---	65.62 USD
Freight:	7.33 USD	---	7.33 USD
Total:	72.95 USD	43.50 USD	116.45 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
1.3 #1	11799-004	WHEEL FAIRING BRACKET	1.00	65.62 USD	72.95 USD
			Freight:	7.33 USD	

Discrepancy: 1.4 PROPELLER SPINNER CHAFFED BY TKS TUBES BEYOND LIMITATION; BEGINNING TO CRACK.

ADJUST TKS FEED TUBES FOR CLEARANCE.
INSTALL NEW PROP SPINNER.

Resolution: RECEIVED NEW SPINNER, AND FOUND THAT HOLE PATTERN DOES NOT MATCH EXISTING HOLE PATTERN OF AFT SPINNER BULKHEAD. RESEARCHED FURTHER FINDING HARTZELL NO LONGER PRODUCES THE 4-HOLE PATTERN SPINNER, ONLY 5-HOLE PATTERN.

*** NEW SPINNER BULKHEAD REQUIRED. ***
NEW AFT BULKHEAD HAS COST OF OVER \$1,000.00.

REMOVED PROPELLER, AND INSTALLED NEW AFT SPINNER BULKHEAD PN C-2294-20, S/N 1705194. TORQUED HARDWARE TO SPEC PER HARTZELL N115 MANUAL.

RE-INSTALLED PROPELLER WITH NEW O-RING AND TORQUED TO SPEC.

INSTALLED NEW SPINNER P/N C-3532-5P, S/N 1805131C AND SECURED.

TORQUE WRENCH USED QJR284E CAL# 859198 CAL. DUE 01-19-2019.

NEW AFT BULKHEAD SOLD AT \$0.00 PROMOTIONALLY.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	72.50 USD	72.50 USD
Parts:	1,400.00 USD	---	1,400.00 USD
Freight:	80.26 USD	---	80.26 USD
Total:	1,480.26 USD	72.50 USD	1,552.76 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
1.4 #1	C-3532-5P	PROP SPINNER	1.00	1,400.00 USD	1,480.26 USD
			Freight:	80.26 USD	
1.4 #2	C-3317-228	PROP O-RING	1.00	0.00 USD	0.00 USD
1.4 #3	15164-091B	SEAL, RING 3/16 S1201-12	3.00	0.00 USD	0.00 USD
1.4 #4	AN526C1032R8	TRUSS MCH SCREW S/S	15.00	0.00 USD	0.00 USD
1.4 #5	A1638-5	WASHER, FIBRE (PROP)	15.00	0.00 USD	0.00 USD



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: Atlas Aviation, LCC

WO #: P17247

Invoice Number: INV18-01066

Discrepancy: 1.5 PILOTS INTERIOR DOOR HANDLE LOOSE AND ROLL PIN COMING OUT.

REPOSITION ROLL PIN AND SECURE HANDLE WITH BLUE LOCTITE.

Resolution: REPOSITIONED PILOTS DOOR HANDLE ROLL PIN AND SECURED DOOR HANDLE WITH LOCTITE 242.

	Time & Materials	Flat Rate	Total
Labor:	0.00 USD	36.25 USD	36.25 USD
Total:	0.00 USD	36.25 USD	36.25 USD

Discrepancy: 1.6 CO-PILOTS INTERIOR DOOR HANDLE LOOSE AND ROLL PIN COMING OUT.

REPOSITION ROLL PIN AND SECURE HANDLE WITH BLUE LOCTITE.

Resolution: REPOSITIONED CO-PILOTS DOOR HANDLE ROLL PIN AND SECURED DOOR HANDLE WITH LOCTITE 242.

	Time & Materials	Flat Rate	Total
Labor:	0.00 USD	36.25 USD	36.25 USD
Total:	0.00 USD	36.25 USD	36.25 USD

Discrepancy: 1.7 AILERON CHORD OUT OF SPEC.

AILERON TRAVELS WERE NOT CHECKED DURING INSPECTION. NEUTRALIZE AILERON SYSTEM AND VERIFY WHICH AILERON IS OUT OF SPEC. RIG AILERON SYSTEM.

Resolution: PINNED AILERON SYSTEM TO NEUTRAL. CHECKED CHORD OF LEFT AND RIGHT AILERONS WITH WS144 RIG BOARD AND FOUND BOTH TO BE ABOVE CHORD 1.5 DEGREES. ADJUSTED CABLE TURNBUCKLES TO BRING LEFT AND RIGHT AILERONS TO CHORD PER CIRRUS SR22 AMM 27-00. SET CABLE TENSIONS TO 36 LBS AT 80 DEGREES AND SAFETIED TURNBUCKLES. VERIFIED AILERON TRAVEL AND TRIM DEFLECTIONS PER CIRRUS SR22 AMM 6-00. OPERATIONAL CHECK OF AILERON SYSTEM NORMAL.

	Time & Materials	Flat Rate	Total
Labor:	0.00 USD	435.00 USD	435.00 USD
Total:	0.00 USD	435.00 USD	435.00 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.7 #1	MS21256-1	CLIP, LOCKING, TURNBUCKLE	2.00	0.00 USD	0.00 USD
1.7 #2	MS21256-2	CLIP, LOCKING, TURNBUCKLE	4.00	0.00 USD	0.00 USD

Discrepancy: 1.8 LEFT AND RIGHT YOKES CONTACT SECONDARY STOPS WITH UP ELEVATOR TRAVEL.

ELEVATOR TRAVELS WERE NOT CHECKED DURING INSPECTION. VERIFY TRAVELS ARE WITHIN SPEC AND ADJUST SECONDARY STOPS. IF TRAVELS ARE OUT OF SPEC ADDED LABOR WILL BE REQUIRED.

Resolution: VERIFIED ELEVATOR TRAVELS ARE WITHIN SPEC. ADJUSTED PILOTS AND CO PILOTS YOKE PITCH UP SECONDARY STOPS AND SECURED JAM NUTS PER CIRRUS SR22 AMM 27-00. RE-VERIFIED ELEVATOR TRAVELS ARE STILL WITHIN SPEC.

	Time & Materials	Flat Rate	Total
Labor:	0.00 USD	217.50 USD	217.50 USD
Total:	0.00 USD	217.50 USD	217.50 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.8 #1	MS21256-2	CLIP, LOCKING, TURNBUCKLE	4.00	0.00 USD	0.00 USD



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: Atlas Aviation, LCC

WO #: P17247

Invoice Number: INV18-01066

Discrepancy: 1.9 COMPASS FLUID LOW.

RESEAL COMPASS.

Resolution: REMOVED COMPASS FROM AIRCRAFT. INSTALLED NEW SEALS AND SERVICED COMPASS AS PER AIRPATH INSTRUCTIONS.
RE-INSTALLED COMPASS INTO AIRCRAFT. LEAK CHECK GOOD.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	217.50 USD	217.50 USD
Parts:	36.42 USD	---	36.42 USD
Freight:	5.00 USD	---	5.00 USD
Total:	41.42 USD	217.50 USD	258.92 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
1.9 #1	C21-100	DIAPHRAM	1.00	18.10 USD	23.10 USD
			Freight:	5.00 USD	
1.9 #2	CB21-736	GASKET	1.00	4.52 USD	4.52 USD
1.9 #3	CB21-914H	GASKET BEZEL SEAL	1.00	10.80 USD	10.80 USD
1.9 #4	CB21-915G	GASKET BEZEL SPCR	1.00	3.00 USD	3.00 USD

Discrepancy: 1.10 ENGINE BAFFLING NOT SEALED.
LARGEST GAPS / OPENINGS AS FOLLOWS:

- LOWER OIL COOLER.
- LEFT AFT BAFFLE WALL TO CASE.
- INTER-CYLINDER BAFFLES.
- AFT BAFFLE WALLS.

Resolution: SEALED FOLLOWING AREAS WITH HIGH TEMP RED RTV P/N 765-1417.

- LOWER OIL COOLER.
- LEFT AFT BAFFLE WALL TO CASE.
- INTER-CYLINDER BAFFLES.
- AFT BAFFLE WALLS.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	116.00 USD	116.00 USD
Parts:	20.15 USD	---	20.15 USD
Total:	20.15 USD	116.00 USD	136.15 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
1.10 #1	765-1417	HIGH TEMP RTV, RED	1.00	20.15 USD	20.15 USD



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: Atlas Aviation, LCC

WO #: P17247

Invoice Number: INV18-01066

Discrepancy: 1.11 COMPLY WITH AD 93-05-06 EFFECTIVE DATE 4/29/1993 BY DISASSEMBLY, INSPECTION, AND LUBRICATION OF THE GERDES IGNITION SWITCH.

Resolution: COMPLIED WITH AD 93-05-06 EFFECTIVE DATE 4/29/1993 BY DISASSEMBLY, INSPECTION, AND LUBRICATION OF THE GERDES IGNITION SWITCH. INSTALLED NEW ACS IGNITION SWITCH SERVICE KIT P/N 11-03654 PER ACS SB92-01. OPERATIONAL CHECK NORMAL. NEXT DUE 4356 TT.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	217.50 USD	217.50 USD
Parts:	24.25 USD	---	24.25 USD
Freight:	8.45 USD	---	8.45 USD
Total:	32.70 USD	217.50 USD	250.20 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
1.11 #1	11-03654	ACS IGNITION SWITCH SERVICE KIT	1.00	24.25 USD	32.70 USD
			Freight:	8.45 USD	



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: Atlas Aviation, LCC

WO #: P17247

Invoice Number: INV18-01066

Item: 2. AVIONICS

Part/Model #: SR22

Item Serial Number:

Registration Number: N8140V

Aircraft Serial Number: 677

Discrepancy: 2.1 TRANSPONDER POWERS UP BUT IS NOT SEEN BY ATC.

Resolution: CUSTOMER HAS OPTED TO TROUBLESHOOT EXISTING TRANSPONDER AT THIS TIME UNTIL AN AIRCRAFT BUYER IS LINED UP. (CB)

PERFORMED CONTINUITY CHECK OF TRANSPONDER ANTENNA AND COAXIAL CABLE WITH NO DISCREPANCIES NOTED. REMOVED GARMIN GTX 327 MODE C TRANSPONDER P/N 011-00490-00, S/N 83717093 FOR REPAIR AT FACTORY. (CB)

REINSTALLED CUSTOMER'S ORIGINAL GARMIN GTX 327 MODE C TRANSPONDER P/N 011-00490-00, S/N 83717093 AFTER BEING REPAIRED BY GARMIN INTERNATIONAL, CRS# G6XR582Y UNDER RMA# 106142795 DATED 11/9/2018. CONFIRMED UNIT IS CONFIGURED FOR CUSTOMER'S AIRCRAFT AND PERFORMED GROUND FUNCTIONAL TESTS WITH NO DISCREPANCIES NOTED. (CB)

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	150.00 USD	150.00 USD
Services:	598.00 USD	---	598.00 USD
Freight:	81.72 USD	---	81.72 USD
Total:	679.72 USD	150.00 USD	829.72 USD

Services:

<u>Ref. No.</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell Price</u>	<u>Extended</u>
2.1 #1	Outside Service/Labor	1.00	478.40 USD	519.26 USD
Part Ref:	011-00490-00 GTX 327 ATCRBS TRANSPONDER Serial Number(s) 83717093			
		Freight:	40.86 USD	
2.1 #2	Outside Service/Part	1.00	119.60 USD	160.46 USD
Part Ref:	011-00490-00 GTX 327 ATCRBS TRANSPONDER Serial Number(s) 83717093			
		Freight:	40.86 USD	

Discrepancy: 2.2 #2 GNS 430W HAS NON-WAAS DATA CARD.

- CANNOT BE USED FOR NAVIGATION.
- PREVENTS CROSS-TALKING BETWEEN 430W'S.

Resolution: CUSTOMER FOUND GNS 430W NAV DATA CARD AT HOME AND HAS GIVEN IT TO CORY BEAULIEU. DATA CARD AND DATABASE UPDATE EQUIPMENT PROVIDED TO CORY HAS BEEN PLACED INSIDE THE ARMREST. (CB)



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: Atlas Aviation, LCC

WO #: P17247

Invoice Number: INV18-01066

Discrepancy: 2.3 #2 GNS 430W HAS AN AMBER SPOT IN THE MIDDLE OF THE DISPLAY WHEN POWERED UP.

SEND UNIT TO GARMIN FOR REPAIR, UPDATE #1 GNS 430W SOFTWARE TO MATCH #2 GNS 430W, AND UPDATE NAV, TERRAIN, AND OBSTACLES DATABASES ON BOTH GNS 430W UNITS, SEE NOTE 1.

Resolution: REMOVED #2 GARMIN GNS 430W P/N 011-01060-40, S/N 97116220 FOR REPAIR. (CB)

REINSTALLED CUSTOMER'S ORIGINAL #2 GARMIN GNS 430W P/N 011-01060-40, S/N 97116220 AFTER BEING REPAIRED BY GARMIN INTERNATIONAL, CRS# G6XR582Y UNDER RMA# 106070640 DATED 11/8/2018. CONFIGURED UNIT FOR CUSTOMER'S AIRCRAFT (SAME AS IT WAS ON ARRIVAL) AND PERFORMED GROUND FUNCTIONAL TESTS WITH NO DISCREPANCIES NOTED. UPDATED #1 GNS 430W SOFTWARE FROM VERSION 3.00/3.0 TO 5.40/5.0, AND UPDATED #1 AND #2 GNS 430W NAV, TERRAIN, AND OBSTACLES DATABASES WITH NO DISCREPANCIES NOTED. (CB)

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	750.00 USD	750.00 USD
Parts:	875.00 USD	---	875.00 USD
Services:	1,200.00 USD	---	1,200.00 USD
Freight:	104.36 USD	---	104.36 USD
Total:	2,179.36 USD	750.00 USD	2,929.36 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
2.3 #1	DGRW75	WAAS DATABASE, DUAL GNS 400W/500W SERIES	1.00	295.00 USD	295.00 USD
2.3 #2	T500W-WW	TERRAIN DATABASE, WORLDWIDE AND AIRPORT GNS 400W/500W	2.00	215.00 USD	430.00 USD
2.3 #3	B500W-UE	OBSTACLES DATABASE, GNS 400W/500W SERIES ONE-TIME UPDATE	2.00	75.00 USD	150.00 USD

Services:

<u>Ref. No.</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell Price</u>	<u>Extended</u>
2.3 #1	Outside Service/Labor	1.00	960.00 USD	1,012.18 USD
Part Ref:	011-01060-40 GARMIN GNS 430W NAV/COM/GPS Serial Number(s) 97116220			
		Freight:	52.18 USD	
2.3 #2	Outside Service/Part	1.00	240.00 USD	292.18 USD
Part Ref:	011-01060-40 GARMIN GNS 430W NAV/COM/GPS Serial Number(s) 97116220			
		Freight:	52.18 USD	



25170 Aviation Ave.
Davis, CA 95616

November 15, 2018

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: Atlas Aviation, LCC

WO #: P17247

Invoice Number: INV18-01066

Item: 3. ADDITIONAL EXPENSES

Part/Model #: SR22

Item Serial Number:

Registration Number: N8140V

Aircraft Serial Number: 677

Discrepancy: 3.1 ENVIRONMENTAL FEES

Resolution: ENVIRONMENTAL FEES

	Time & Materials	Flat Rate	Total
Services:	0.00 USD	10.00 USD	10.00 USD
Total:	0.00 USD	10.00 USD	10.00 USD

Discrepancy: 3.2 MISC. SHOP SUPPLIES.

6% OF TOTAL LABOR ON WORK ORDER AT CLOSING.

Resolution: 6% OF \$3,089.50 APPLIED LABOR = \$185.37.

	Time & Materials	Flat Rate	Total
Parts:	0.00 USD	185.37 USD	185.37 USD
Total:	0.00 USD	185.37 USD	185.37 USD

Item: 4. ARRIVAL AND DEPARTURE REQUIREMENTS

Part/Model #: SR22

Item Serial Number:

Registration Number: N8140V

Aircraft Serial Number: 677

Discrepancy: 4.1 COMPLETE WOODLAND AVIATION QUALITY ASSURANCE AIRCRAFT INDUCTION GUIDE REQUIREMENTS:

AIRWORTHINESS CERTIFICATE CHECKED 9/16/03.
REGISTRATION DATE: 10/31/16(EXPIRED).

Resolution: COMPLETED WOODLAND AVIATION QUALITY ASSURANCE AIRCRAFT INDUCTION GUIDE REQUIREMENTS.

Discrepancy: 4.2 INITIATE WOODLAND AVIATION QUALITY ASSURANCE AIRCRAFT DEPARTURE GUIDE.

NOTIFY SERVICE MANAGER / LINE SERVICE / DIRECTOR OF MAINTENANCE / AND CUSTOMER SERVICE.

Resolution: COMPLETED WOODLAND AVIATION QUALITY ASSURANCE AIRCRAFT DEPARTURE GUIDE.