



Aircraft Inspection & Repair
Flight Training FBO Services

Erie Municipal Airport
395 Airport Drive
Erie, Colorado 80516

303.664.0633 tel
877.629.8600 fax
fly@vectorair.net

Invoice

Date	Invoice #
12/28/2016	38633

Bill To:

PC & S LLC
PO BOX 3810
ALPINE, WY 83128

N#	Warranty	Make/Model	Serial #	Oil-Qt.	Tach/Hobbs	Labor Rate	Terms
4904		SR22-G3 Tur...	2924			\$95/Hr	Due on receipt
Qty.	Item	Description				Price Each	Amount
1	Annual/100hr - Fixed...	Annual / 100hr Inspection. Service/Inspect airframe/engine/propeller. Oil/Filter Change. Check for AD compliance. Complete log books.				2,950.00	2,950.00
1	CH48108-1	Oil Filter - List \$41.40				37.77	37.77T
8	20W50XC	20W50 Phillips XC				6.52	52.16T
12	M674	Spark Plug Gasket				0.45	5.40T
1	Misc. Shop Supplies	Shop Supplies & Disposal				35.00	35.00
2.1	Labor	B: Install customer supplied battery minder Install new battery				95.00	199.50
1	Labor	D: Check tires - replace right main tire				95.00	95.00
1	156E61-3	15X600X6-6 Flight Special II - List \$231.00 156E61-3				138.26	138.26T
0	Labor	E: Check date on O2 bottle				95.00	0.00
1	Labor	F: #2 batteries due 2 year				95.00	95.00
2	50979-001	#2 Battery, .250 Terminal				54.64	109.28T
1	Freight	- freight				19.04	19.04
0.6	Labor	H: Record p/n and s/n cylinders for AD compliance check				95.00	57.00
0	Labor	J: Door strut service bulletin - already installed				95.00	0.00
4.2	Labor	K: Left elevator center hinge very loose - troubleshoot - remove elevator - Replace left elevator hinge bracket - reinstall elevator				95.00	399.00

Payment due upon completion of work. INVOICES NOT PAID WITHIN 5 DAYS WILL BE SUBJECT TO A 5% PER MONTH LATE FEE. Thank you for your prompt payment.

Parts Installed may be FAA/PMA'd or STC'd parts and not of "Original Equipment Manufacture" (OEM) and as such are not covered by the OEM's warranty.

Subtotal

Sales Tax (6.4%)

Total

Payments

Balance Due



ENSTROM
HELICOPTER CORPORATION
Authorized Service Center

Page 1



CIRRUS
Authorized Service Center



Aircraft Inspection & Repair
Flight Training FBO Services

Erie Municipal Airport
395 Airport Drive
Erie, Colorado 80516

303.664.0633 tel
877.629.8600 fax
fly@vectorair.net

Invoice

Date	Invoice #
12/28/2016	38633

Bill To:

PC & S LLC
PO BOX 3810
ALPINE, WY 83128

N#	Warranty	Make/Model	Serial #	Oil-Qt.	Tach/Hobbs	Labor Rate	Terms
4904		SR22-G3 Tur...	2924			\$95/Hr	Due on receipt
Qty.	Item	Description				Price Each	Amount
1	11606-002	Elevator Hinge, Horizontal, Mid-Span				50.18	50.18
0.8	Labor	L: Most of fwd left exhaust heat shield missing. Rest of left exhaust heat shields loose - tighten loose heat shields				95.00	76.00
1	ETI-G2-20-22	Heatshield, LH Exhaust (2 pcs) -				102.65	102.65
1	Freight	- freight				13.98	13.98
12.6	Labor	M: Exhaust leak left side - remove left exhaust; found slip joint eroded - install new left hand exhaust manifold - re-rig wastegate inner connect				95.00	1,197.00
1	22-6850011	Left Exhaust Manifold				2,558.98	2,558.98
1	22-6100001	Spring Tailpipe 90 Degree				22.84	22.84
1	22-6100002	Spring Tailpipe 180 Degree				22.84	22.84
1	Freight	- freight				26.95	26.95
0.5	Labor	Q: Alternator outlet baffle retainer is coming loose (broken rivets) - replace broken rivets with screws and nuts				95.00	47.50
1.9	Labor	R: On right side of firewall, engine side, cabin heat flapper valve hinge worn - repair heat flapper valve				95.00	180.50
0.5	Labor	T: Plug missing in mag air filter - replaced air filter				95.00	47.50
1	1396-2	Mag Filter, Pressurized				118.59	118.59
1	Freight	- freight				12.51	12.51
0.2	Labor	V: Tywrap chaffing engine mount by the rear right side of the oil pan - adjust tywraps				95.00	19.00

Payment due upon completion of work. INVOICES NOT PAID WITHIN 5 DAYS WILL BE SUBJECT TO A 5% PER MONTH LATE FEE. Thank you for your prompt payment.

Parts Installed may be FAA/PMA'd or STC'd parts and not of "Original Equipment Manufacture" (OEM) and as such are not covered by the OEM's warranty.

Subtotal

Sales Tax (6.4%)

Total

Payments

Balance Due



ENSTROM
HELICOPTER CORPORATION
Authorized Service Center

Page 2



CIRRUS
Authorized Service Center



Aircraft Inspection & Repair
Flight Training FBO Services

Erie Municipal Airport
395 Airport Drive
Erie, Colorado 80516

303.664.0633 tel
877.629.8600 fax
fly@vectorair.net

Invoice

Date	Invoice #
12/28/2016	38633

Bill To:

PC & S LLC
PO BOX 3810
ALPINE, WY 83128

N#	Warranty	Make/Model	Serial #	Oil-Qt.	Tach/Hobbs	Labor Rate	Terms
4904		SR22-G3 Tur...	2924			\$95/Hr	Due on receipt
Qty.	Item	Description				Price Each	Amount
0.5	Labor	X: Right tailpipe and wastegate outlet misaligned				95.00	47.50
1.4	Labor	Z: Baffle bracket at upper right rear of engine broken - install new baffle brackets				95.00	133.00
0	Labor	AA: Tail pipe V-band seems loose. Re-torque. See item 38633X				95.00	0.00
0.2	Labor	BB: Engine drain "T" chaffing wastegate cable - reposition engine drain "T"				95.00	19.00
0.2	Labor	CC: Wire harnesses chaffing wastegate cable - zip tie wire harness to prevent chaffing				95.00	19.00
0.9	Labor	DD: Gascolator leaking - reseal				95.00	85.50
1	MS29513-137	Fuel Resistant O-Ring				0.62	0.62
1	Labor	EE: Intake "Y" missing pad - install pad according to TAT-SB08-02				95.00	95.00
1	Labor	FF: Suggest retiming mags (off 3 to 4 degrees) - retime mags				95.00	95.00
0.3	Labor	GG: Intercooler screws need washers - install washers				95.00	28.50
0.4	Labor	HH: Intake hose clamp on cylinder #2 needs torqued - adjusted				95.00	38.00
1	Labor	JJ: Throttle and mixture control bolts loose. Mixture not touching stop ICO hits stop in panel - tightened bolts and rigged				95.00	95.00

Payment due upon completion of work. INVOICES NOT PAID WITHIN 5 DAYS WILL BE SUBJECT TO A 5% PER MONTH LATE FEE. Thank you for your prompt payment.
Parts Installed may be FAA/PMA'd or STC'd parts and not of "Original Equipment Manufacture" (OEM) and as such are not covered by the OEM's warranty.

Subtotal

Sales Tax (6.4%)

Total

Payments

Balance Due



ENSTROM
HELICOPTER CORPORATION
Authorized Service Center

Page 3



CIRRUS
Authorized Service Center



Aircraft Inspection & Repair
Flight Training FBO Services

Erie Municipal Airport
395 Airport Drive
Erie, Colorado 80516

303.664.0633 tel
877.629.8600 fax
fly@vectorair.net

Invoice

Date	Invoice #
12/28/2016	38633

Bill To:

PC & S LLC
PO BOX 3810
ALPINE, WY 83128

N#	Warranty	Make/Model	Serial #	Oil-Qt.	Tach/Hobbs	Labor Rate	Terms
4904		SR22-G3 Tur...	2924			\$95/Hr	Due on receipt
Qty.	Item	Description				Price Each	Amount
0.4	Labor	KK: Right wheel pant inner panel cracked and missing a couple of screws				0.00	0.00
2.6	Labor	LL: Right turbo support rod needs new heat shrink. - install heat shrink - comply with TAT SI 11-03 Turbo support assembly inspection				95.00	247.00
0.3	Labor	MM: Repair Co-pilot Amsafe wire connector				95.00	28.50
0.4	Labor	NN: (1) rear seat stop missing (clip)				0.00	0.00
0.5	Labor	PP: Clevis pins on slave wastegate worn				95.00	47.50
1	MS20392-1C13	Clevis Pin				6.27	6.27
1.8	Labor	SS: Antichaff strips missing of right gear leg				95.00	171.00
1	18361-001	Grommet				42.19	42.19T
1	18362-001	Grommet, MLG, Lower Fairing				57.63	57.63
1	Freight	- freight				15.55	15.55
2.1	Labor	Seal rear wall of TKS tank - Warranty				0.00	0.00
0.3	Labor	Throttle cable chaffing AC Mount - zip tied to secure				95.00	28.50
2.5	Labor	Set up takeoff fuel flow and manifold pressure				95.00	237.50
3	AN960-8	Flat Washer				0.00	0.00
1	MS27039-08-08	Machine Screw				0.03	0.09
1	WDF13	Adel - MS21919-WDF13				0.13	0.13
2	AN363-632/MS2104...	Stop Nut				2.68	2.68
2	AN525-832R16	Screw, Washer Head Structural				0.54	1.08
Payment due upon completion of work. INVOICES NOT PAID WITHIN 5 DAYS WILL BE SUBJECT TO A 5% PER MONTH LATE FEE. Thank you for your prompt payment. Parts Installed may be FAA/PMA'd or STC'd parts and not of "Original Equipment Manufacture" (OEM) and as such are not covered by the OEM's warranty.						0.25	0.50
						Subtotal	
						Sales Tax (6.4%)	



ENSTROM
HELICOPTER CORPORATION
Authorized Service Center



CIRRUS
Authorized Service Center

Total
Payments
Balance Due



Erie Municipal Airport
395 Airport Drive
Erie, Colorado 80516

Aircraft Inspection & Repair
Flight Training FBO Services

303.664.0633 tel
877.629.8600 fax
fly@vectorair.net

Invoice

Date	Invoice #
12/28/2016	38633

Bill To:

PC & S LLC
PO BOX 3810
ALPINE, WY 83128

N#	Warranty	Make/Model	Serial #	Oil-Qt.	Tach/Hobbs	Labor Rate	Terms
4904		SR22-G3 Tur...	2924			\$95/Hr	Due on receipt
Qty.	Item	Description				Price Each	Amount
1	MS35489-143	Elastic Grommet				0.32	0.32T
3	AN363-832	Stop Nut				0.43	1.29
3	MS27039-0807	Pan Head Screw				0.19	0.57
1	AN960-10L/NAS114...	Flat Washer-Light				1.01	1.01
25	51170-001	Bow-Tie Locking Cotter				0.14	3.50
18	51042-005U	Tape, Adhesive Transfer, Aileron Gap Seal, /Ft (3M-F9469PC)				0.99	17.82T
2	MS24693C273	Machine Screw				0.18	0.36
1	AN526C-832R10	Machine Screw				0.22	0.22
3	AN525-832R7	Screw, Washer Head Structural				0.31	0.93
1	CC Cash/Check Disc...	Cash/Check Discount - NOTE: IF YOU PAY BY CASH OR CHECK, YOU MAY DEDUCT THE CASH/CHECK DISCOUNT FROM THE FROM THE BALANCE DUE.				308.51	308.51

Payment due upon completion of work. INVOICES NOT PAID WITHIN 5 DAYS WILL BE SUBJECT TO A 5% PER MONTH LATE FEE. Thank you for your prompt payment.
Parts Installed may be FAA/PMA'd or STC'd parts and not of "Original Equipment Manufacture" (OEM) and as such are not covered by the OEM's warranty.

Subtotal \$10,566.20

Sales Tax (6.4%) \$25.80

Total \$10,592.00

Payments \$0.00

Balance Due \$10,592.00

