
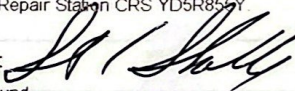


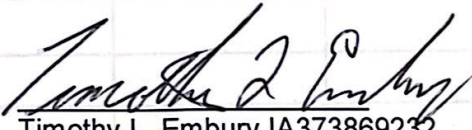
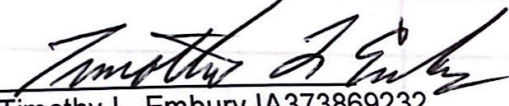
MAINTENANCE RECORD

F.A.R. 43.9

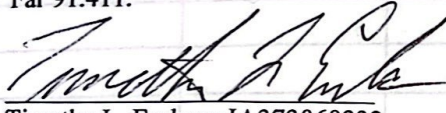


DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
	MAKE: Cirrus MODEL: SR20-G2 S/N: 20-1454 REG NO: 7728A WORK ORDER: 1933-08-2004	 <p>Cirrus Design Factory Service Center Repair Station No. YD5R855Y 4515 Taylor Circle Duluth, MN 55811 Phone: 218- 788-3101</p> <p>Airframe Entries (1) Replaced L/H "G2" stripe that was peeling off IAW Cirrus SR 20 AMM 51-30... (2) Installed oil door placard using standard maint practices... (3) Replaced blue R/H stripe on inspection panel IAW Cirrus SR20 AMM 51-30... (4) Adjusted both right and left upper MLG strut fairings using standard maint practices.</p> <p>I have reviewed the file on this aircraft and the accompanying discrepancy forms. The aircraft, airframe, aircraft engine, propeller, or appliance identified was repaired/inspected in accordance with current requirements of the Federal Aviation Administration and is approved for return to service. Pertinent details of repair are on file at this Certified Repair Station CRS YD5R855Y.</p> <p>DATE: 8/24/2004 SIGNED:  Steve Sholund Certified Repair Station No. YD5R855Y</p>	DATE: 8/24/2004 A/C TSN: HOBBS 12 5 Work Order: 1933-08-2004 Printed by EBis 3 (datcomedia.com)

MAINTENANCE RECORD

F.A.R. 43.9

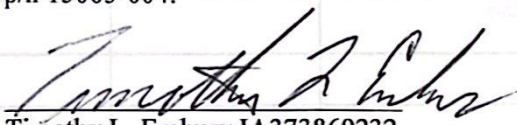

DATE OF COMPLETION	WORK PERFORMED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
	ALBATROSS AVIATION 3540 WEST GRAND RIVER HOWELL, MI 48855	
September 17, 2004 Cirrus N7728A Hobbs: 74.49		
	Replaced cabin heat air box p/n 14116-402 and one nose landing gear puck p/n 11879-001.	
	 Timothy L. Embury IA373869232	ALBATROSS AVIATION 3540 WEST GRAND RIVER HOWELL, MI 48855
	November 20, 2004 Cirrus N7728A Hobbs: 152.7	
	Installed Tanis TAS100-14-76 aircraft preheat system serial number 37537. Installed flush mount plug and pilot light in forward upper left baffle. Complied with SB 2x-28-03 fuel selector shaft sleeve. Replaced pilot control trim switch p/n 50340-001. Function checked satisfactory.	
	 Timothy L. Embury IA373869232	

MAINTENANCE RECORD

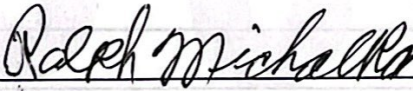
E NO. D TO SERVICE	DATE OF COMPLETION	FAR 91.411 FORMED D	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
	ALBATROSS AVIATION 3540 WEST GRAND RIVER HOWELL, MI 48855		
	February 4, 2005 Cirrus N7728A S/N: 1454 Tach: 176.6 TT: 176.6		
	Replaced #5 cylinder EGT probe p/n 14554-001 and CHT probe p/n 14880-001. Installed seat buckle tabs in accordance with service bulletin 2x-25-05R1. Replaced encoder with exchanged unit p/n 12738-050, s/n 91017. System checked in accordance with Far 91.411.		
	 Timothy L. Embury IA373869232		The ATC transponder was tested and inspected on _____ and bound to comply with 91.413 Part 43. Appendix F. Automatic altitude reporting equipment was tested and calibrated on <u>214105</u> in compliance of 91.411 FAR 43. Appendix E, Paragraph (C) to <u>256FT</u> ft. Work Order Number: <u>15134</u>
		Signature  THE AVIATION DEPOT C.R.S. TFGR831K	
		I certify that the altitude static system tests required by FAR 91.411 have been performed. The static ^{STATIC} was tested on <u>214105</u> by <u>AVIATION DEPOT</u> to <u>20K</u> ft.	
		Signature  THE AVIATION DEPOT C.R.S. TFGR831K	<u>N7728A</u>

MAINTENANCE RECORD

F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT MAKE, MODEL, AND SERIAL NO. (SEE PERFORMANCE DATA LIST)	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
	ALBATROSS AVIATION 3540 WEST GRAND RIVER HOWELL, MI 48855	
N7728A TT: 191.3	Cirrus SR20-G2 S/N: 1454	
Installed new pilots visor p/n 12698-003 and inboard flap fairings p/n 15065-004.		
 Timothy L. Embury IA373869232		ALBATROSS AVIATION 3540 WEST GRAND RIVER HOWELL, MI 48855
	June 17, 2005 N7728A Hobbs: 233.1	Cirrus SR20 S/N: 1454
Installed dual crew seat shoulder harness kit p/n 70076-001 in accordance with SB2X-25-07R1. Installed Aileron hinge bearing kit p/n 70105-001 per SB2X-57-05. Installed new APS brake pads p/n 66-108.		
 Timothy L. Embury IA373869232		

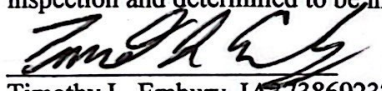
MAINTENANCE RECORD F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
	MAKE: Cirrus MODEL: SR20 S/N: 1454 REG. NO: N7728A WORK ORDER: 4996-07-2007	Kalamazoo Aircraft, Inc. Repair Station No. K9AR289N 2729 E Milham Rd. Kalamazoo, MI 49002 Phone: 269-381-0790	DATE: 7/21/2007 A/C TSN: HOBBS: 544.5
Airframe Entries REPLACED ALL BRAKE PADS AND DISCS, CLEANED AND RE-GREASED MAIN WHEEL BEARINGS, BALANCED MAIN WHEEL ASSEMBLIES, BLED BRAKES, OPS CHECKED GOOD... REPLACED RIGHT AND LEFT UPPER WHEEL PANT BRACKETS... REPLACED NOSE STRUT UPPER REBOUND BUSHINGS... C/W SB 2X-27-14 R2 DATED 07/10/07, RUDDER AILERON INTERCONNECT MODIFICATION.... C/W SB 2X-52-07 R1 DATED 5/3/2007 CABIN DOOR ROD END REPLACEMENT, ADJUSTED CABIN DOOR LATCHES PER CIRRUS SR20 MM 52-10 AND CABIN DOOR STRIKER PINS PER CIRRUS SR20 MM 53-40, OPS CHECKED GOOD.... C/W SB 2X-71-10 R1 DATED 05/24/07, OIL BREATHER LINE INSULATION SLEEVE INSTALLATION... C/W SB 2X-78-07 DATED 06/13/07, HEAT EXCHANGER INSPECTION, NO DEFECTS FOUND... C/W AD 2006-21-03 DATED 11/17/2006, TO DETECT, CORRECT AND PREVENT OVERHEAT DAMAGE TO THE BRAKE CALIPER O-RINGS IN ACCORDANCE WITH PARAGRAPH (e) (1-4), INSTALLED (2) NEW BRAKE CALIPER O-RINGS, SERVICED BRAKES AND PERFORMED INSPECTION/CHECK PER CIRRUS SR20 MM 32-42, OPS CHECKED GOOD.... C/W SB 2X-32-14 R1 MAIN LANDING GEAR FAIRING MOD FOR INSPECTION HOLE			
The above work was performed in accordance with current regulations of the Federal Aviation Administration and is approved for return to service. Details are on file at this certified repair station.			
DATE: 7/21/2007	SIGNED:  Ralph Michalka Certified Repair Station No. K9AR289N		Work Order: 4996-07-2007 Printed by EBis 3 (datcomedia.com)

MAINTENANCE RECORD F.A.R. 43.9


DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
Nov 1 2007	TSN: 581.4	<p>COMPLIED WITH ANNUAL INSPECTION. INSPECTED ELT IN ACCORDANCE WITH PAR 91.207. BATTERY DUE MARCH 2011. SERVICED TIRES, BATTERY & WHEEL BEARINGS. RAN AIRCRAFT WITH NO DISCREPANCIES.</p> <p>I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND DETERMINED TO BE IN AIRWORTHY CONDITION.</p> <p><i>Tommy J. Ely</i> IA373864232</p>	


MAINTENANCE RECORD F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
		ALBATROSS AVIATION Owosso MI 48867	
		March 20, 2010 N7728A Cirrus SR 20 S/N: 1454 Tach: <i>624.5</i> TT: <i>624.5</i>	
		Complied with Annual inspection. Replaced #2 aircraft batteries p/n 50979-001. Inspected ELT in accordance with FAR91.207. Replaced air filter element BA24. Cirrus kit 70230-001 oil breather line clamp kit on order. Complied with AD2008-11-14(e)(1) 100hr repetitive inspection of heat exchanger. AD2008-14-13 not applicable by serial number. Serviced tires & wheel bearings. Ran aircraft with no leaks noted. I certify that this aircraft has been inspected in accordance with an annual inspection and determined to be in airworthy condition.	
		 Timothy L. Embury IA573869232	
		ELT: March 2011 IFR: Dec 2011	

**MAINTENANCE RECORD
F.A.R. 43.9**

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERV
--------------------	--------------------------	---	--

Owosso Aviation, Inc. 1510 E. Main St. Owosso, MI 48867	N 7728A	Tach/Hobbs:	Hobbs 628.8	TTAF:	628.8	
	Logbook:	Airframe				
	TTE:	628.8	SNEW:	628.8		
Removed Gill battery PN: G243, SN: GO214253 and installed a new Gill battery PN: G243, SN: G030776026. Replaced cable nipple on Main Aircraft Battery, PN: MS25171-4S. Replaced missing Bracket Air Filter Assembly, PN BA111. Replaced fuel gascolator drain with new 50242-001 drain. Replaced ELT batteries with new Duracell MH1600 that expire March 2029. ELT ops checks good.						
		A&P3506601IA	9/01/2020			

Owosso Aviation, Inc. 1510 E. Main St. Owosso, MI 48867	N 7728A	Tach/Hobbs:	Hobbs 628.8	TTAF:	628.8	
	Logbook:	Airframe				
	TTE:	628.8	SNEW:	628.8		
Removed #2 batteries and replaced with two new 50979-001 batteries.						
		A&P3506601IA	9/01/2020			

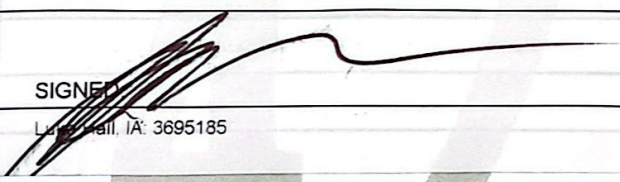
MAINTENANCE RECORD F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
		<div style="display: flex; align-items: center;"><div>Waterford Aviation, Inc. 6548 Highland Rd Suite 900 Waterford, MI 48327 Phone: 248-724-2400</div></div>	DATE: 23 December 2020 A/C TSN: 629 HOBBSS: 629
		Airframe Entries This aircraft has been visually inspected and has been found safe for the intended flight in accordance with Special Flight Permit dated 12/23/2020 Researched AD's thru bi-weekly 2020-26 - no AD's are currently due at this time	
		DATE: 23 December, 2020	SIGNED: Jeff Bowers A&P: 2738624
			Work Order: 6273-12-2020 Printed by EBis 3 (datcomedia.com)

MAINTENANCE RECORD F.A.R. 43.9

SERVICE	DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
			1 of 2	
			<p>MAKE Cirrus Aircraft MODEL SR20 S/N: 1454 REG NO: N7728A WORK ORDER: 6297-01-2021</p>	<p style="text-align: right;">DATE: 06 April, 2021 A/C TSN: 830.2 HOBBS: 830.2</p>
			<p>Waterford Aviation, Inc. 6548 Highland Rd Suite 900 Waterford, MI 48327 Phone: 248-724-2400</p>	
			<p>Airframe Entries</p> <ul style="list-style-type: none"> · C/W Cirrus MSB2X-25-17R1, Crew Seat Break-over Pin Replacement, dated 15th December 2005, revised 20th January, 2006, by replacing pilot and copilot break-over pins with new, PN: 17063-002 (x4). No further action necessary. · C/W SB2X-27-16R2 Modification to Prevent Asymmetric Flaps by replacement of flap actuator hardware with kit PN: 70255-002. · C/W Cirrus MSB2x-28-12R1, Electric Fuel Pump Inspection, dated July 15th, revised August 19th, 2015, by disconnecting electric fuel pump drain line and inspecting for internal leaks during ops check, no leaks found. · C/W SB2X-32-18R4 by performing Nose Landing Gear Upper Gusset Plate and Attach Point Arms Inspection. No defects noted at this time. Inspection due again next 100 hours. · Complied with service bulletin SB2X-52-08R2 by replacing Catcher/Diverter, G2 Type 1 R Part Number 17582-008, Door Strut kit Part Number 70544-001 · C/W Cirrus Mandatory SB2X-61-02R1 Propeller Spinner Assembly Torque Inspection Checked and re torqued as required. No further action required. · C/W SB2X-71-11R1 by installing engine electrical seal kit P/N 70136-001 · C/W Cirrus Recommended SB2X-77-02R2 Engine Sensor Modification. Replaced all CHT and EGT connectors with new style using kit, P/N 70134-001 Ops check good. · C/W SB2X-95-24R2 CAPS Rocket Shelf Ground Wire by installation of ground wire kit 70572-001. Updated weight and balance information. No further action required. · Completed 10-year overhaul of Cirrus CAPS system, complied with SB2x-95-18R5. Installed Inspected Packed Parachute Assembly SR22, P/N: 25574-004 S/N: 3991R1. Parachute inspected by Cirrus Design Corporation, Certificate Number: PC#YD5R855Y under Work Order: CSO 1158337. Parachute replacement due again 02/24/2031. Installed new Rocket Motor Assembly 3400lb, P/N: 29500-405, S/N: 4262. Rocket replacement due again 02/03/2031. Installed new Frangible Link Assembly, P/N: 29705-402 Rev C (L/N 723745), Electronic Ignition Retrofit kit (P/N: 70268-002) and G5 Rocket Retrofit Kit (P/N: 70271-001). All work performed IAW Cirrus Maintenance Manual, Cirrus Component Maintenance Manual and SB2x-95-18R5. Updated POH with revised weight and balance and TPOH13-06R1. · Installed new pyrotechnic line cutter kit P/N 25347-002 IAW CMM 95-01-01. Due for replacement 03/2027 · Replaced mixture control cable, P/N 14392-101 and rigged system as required. Replaced Mixture control rod end, P/N 11314-003 at fuel control during reassembly, ops check good. · Replaced MCU logic module with new, PN: 14610-004, SN: 0537 IAW Cirrus SR20 AMM chapter 24-30 · Installed new NLG strut pucks P/N 11879-006 (qty 5) IAW Cirrus SR20 AMM chapter 32-20 · Replaced LH and RH MLG strut mounting grommets with new, PN: 16937-002 (x2) IAW Cirrus SR20 AMM chapter 32-10 	

MAINTENANCE RECORD F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
		2 of 2	
		<p>Installed new gauged fire extinguisher P/N A344T. Replaced aft rudder rod end. P/N 11315-004. Rim swapped L/H and R/H MLG tires top even and extend tread life IAW Cirrus SR20 AMM chapter 32-40. Adjusted nose spindle tension to spec IAW Cirrus SR20 AMM chapter 32-20. Adjusted ngging of alternate air valve door to spec. Stop drilled crack in RH baffling at #5 cylinder bracket. Replaced RH strobe light with new. PN: 36-0050705-00. SN: 8679 Ops check good. Drained fuel and removed RH IB fuel quantity sender for overhaul. PN: 12638-002. SN: 1484 and replaced with overhauled fuel sender. PN: 12638-002. SN: 1198 Overhaul performed by Air Parts of Lockhaven. CRS#: QK1R429 under WO#: 210878. Adjusted fuel level indication per spec. CW SB2x-95-13 CAPS strap grommet installation by modification of CAPS compartment and installation of caterpillar grommet MS21266-6N and MS21266-1N as required. Completed Annual Inspection in scope and detail of FAR 43 App. D and using Cirrus SR20 Service Manual Checklist as a guide. Researched AD's thru bi-weekly 2021-07 - none due at this time. Replaced BA-24 induction air filter with new. Lubricated airframe as required. I certify that this Airframe has been inspected in accordance with an Annual Inspection and has been found to be in Airworthy condition. Tested & Inspected ELT IAW FAR 91.207(d). Battery Replacement due March 2029.</p>	
DATE: 06 April, 2021		SIGNED:  License No. IA: 3695185	Work Order: 6297-01-2021 Printed by EBis 3 (datcomedia.com)

INSPECTION RECORD F.A.R. 43.11-91.409

DATE	AIRCRAFT TIME IN SERVICE	KIND OF INSPECTION - STATUS & DISCREPANCY LIST SIGNATURE - CERT. NO. OF PERSON APPROVING OR DISSAPPROVING AIRCRAFT FOR SERVICE
17 AUG 04	11.4	<p>Production Flight Test accomplished in accordance with Cirrus Procedure #90500.</p> <p>Name: Ross Rotramel Date <u>AUG. 17. 2004</u></p> <p>Signature: <u>Ross Rotramel</u></p> <p>Title: Production Flight Test Pilot</p>
08-19-04	11.9 Hrs	<p>I find that the aircraft meets the requirements for the certification requested and have issued an U.S. Standard Airworthiness Certificate dated <u>08 / 19 / 04</u>.</p> <p>The next inspection is due <u>08 / 31 / 05</u>.</p> <p><i>Timothy L. Boderer</i></p> <p>TIMOTHY L. BONDERER DMIR410074CE</p>

MAINTENANCE RECORD F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
--------------------	--------------------------	---	---

MAKE Cirrus Aircraft
MODEL SR20
S/N: 1454
REG NO N7728A
WORK ORDER:
7150-09-2021



Waterford Aviation, Inc.

6548 Highland Rd
Suite 900
Waterford, MI 48327
Phone 248-724-2400

DATE 30 September 2021
A/C TSN 660 4
HOBBS 660 4

Airframe Entries

Removed MFD (700-0004-006, S/N 21147294) and installed repaired unit (700-0004-006, S/N 1787) from Extant Aerospace (CRS# 5S5R934B, W.O 7010-23319RS) Removed GNS430 (011-00280-10, S/N 97116956) and installed serviceable GNS430 (011-00280-10, S/N 97122003) Operational check satisfactory all both units

DATE: 30 September, 2021

SIGNED:

Jeff Bowers, A&P 2738624

Work Order: 7150-09-2021

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Aircraft
MODEL SR20
S/N: 1454
REG NO: N7728A
WORK ORDER:
8051-06-2022



Waterford Aviation, Inc.

6548 Highland Rd
Suite 900
Waterford, MI 48327
Phone 248-724-2400

DATE 17 June 2022
A/C TSN: 663 8
HOBBS 663 8

Airframe Entries

Completed Annual Inspection in scope and detail of FAR 43 App. D and using Cirrus SR20 Service Manual Checklist as a guide. Researched AD's thru bi-weekly 2022-12. Replaced BA-24 induction air filter with new Lubricated airframe as required. I certify that this Airframe has been inspected in accordance with an Annual Inspection and has been found to be in Airworthy condition.
Tested and inspected ELT in accordance with FAR 91.207(d). Ops check good. Battery replacement due no later than March-2029

DATE: 17 June, 2022

SIGNED:

Dan Lynch, A&P 3624030 1A

Work Order: 8051-06-2022

Printed by EBis 3 (datcomedia.com)

**MAINTENANCE RECORD
F.A.R. 43.9**

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
--------------------	--------------------------	---	---

MAKE Cirrus Aircraft
MODEL SR20
S/N 1454
REG NO N7728A
WORK ORDER
8051-06-2022




Waterford Aviation, Inc.
6548 Highland Rd
Suite 900
Waterford, MI 48327
Phone 248-724-2400

DATE 17 June 2022
A/C TSN 663 8
HOBBS 663 8

Airframe Entries

Complied with AD 2008-11-18, effective date 7/7/2008 Exhaust System Leaks Performed pressurization check of exhaust IAW SB2x-78-07R1 no defects noted at this time due again next 100 hours TIS
Removed pilots upper door hinge and resealed with RTV
Adjusted elevator tip clearance IAW Cirrus SR20 AMM 55-20
Tightened bolt and re-cotter pinned nut
Removed and replaced nose landing gear rebound bumpers with new pucks P/N 14020-001
Removed tail pipe clamps cleaned with scotch brite applied anti-seize and reinstalled Work done IAW Cirrus SR20 amm ch 78-20
Removed and replaced RH wheel pant bracket with new bracket P/N 17205-002 Work done IAW Cirrus SR20 AMM ch 32-10
Removed and replaced gascolator o-ring with new o-ring P/N MS29513-137
Removed spiral wrap and installed new heat resistant anti chafe material on mixture control cable

DATE: 17 June, 2022 SIGNED: 
Lyle Bonney A&P 4135044

Work Order: 8051-06-2022
Printed by EBis 3 (datcomedia.com)

F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
--------------------	--------------------------	---	---

MAKE: Cirrus Aircraft
 MODEL: SR20
 S/N: 1454
 REG NO: N7728A
 WORK ORDER:
 8051-06-2022



Waterford Aviation, Inc.

6548 Highland Rd
 Suite 900
 Waterford, MI 48327
 Phone: 248-724-2400

DATE: 17 June, 2022
 A/C TSN: 663.8
 HOBBS: 663.8

Airframe Entries

Removed existing Garmin GMA340 audio panel (011-00401-10, S/N 96269970) and installed Garmin GMA345 audio panel (011-03520-00, S/N 320013204) IAW Garmin Installation Manual GMA342/GMA345 190-01878-02, Rev. 5, Dated November 1, 2020. W&B change negligible.

DATE: 17 June, 2022

SIGNED:

Brent Tygielski, A&P 3569797

Work Order: 8051-06-2022

Printed by EBis 3 (datcomedia.com)

MAKE: Cirrus Aircraft
 MODEL: SR20
 S/N: 1454
 REG NO: N7728A
 WORK ORDER:
 8176-07-2022

Waterford Aviation, Inc.

6548 Highland Rd
 Suite 900
 Waterford, MI 48327
 Phone: 248-724-2400

DATE: 13 July, 2022
 A/C TSN: 670.7
 HOBBS: 670.7

Airframe Entries

Repaired damaged pins at J112 connector. Boost pump ops check good in both Hi and low boost. Work done IAW Cirrus SR20 AMM 20-10.

DATE: 13 July, 2022


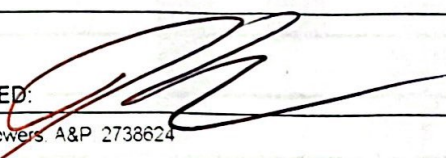
SIGNED:

Sean Farrelly, A&P 3890041


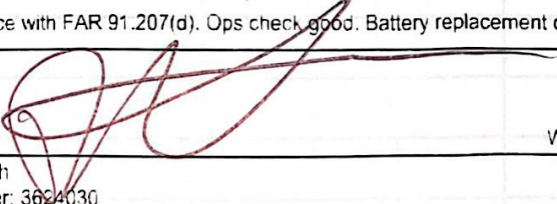
Work Order: 8176-07-2022

Printed by EBis 3 (datcomedia.com)



MAINTENANCE RECORD F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
		<p>  Waterford Aviation, Inc. 6548 Highland Rd Suite 900 Waterford, MI 48327 Phone 248-724-2400 </p>	DATE 03 November 2022 A/C TSN 670.7 HOBBS 670.7
		<p> MAKE Cirrus Aircraft MODEL SR20 S/N 1454 REG NO N7728A WORK ORDER 8598-11-2022 </p> <p> Airframe Entries removed faulty tach sensor and adapter Installed new tach sensor, P/N 12323-003, and new tach sensor adapter P/N 641531 work done with reference to Cirrus SR20 AMM Ch. 77-10 </p>	
		<p> DATE: 03 November, 2022 SIGNED:  Jeff Bowers A&P 2738624 </p>	<p> Work Order: 8598-11-2022 Printed by EBis 3 (datcomedia.com) </p>

**MAINTENANCE RECORD
F.A.R. 43.9**

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
			
		Waterford Aviation, Inc.	
		6548 Highland Rd Suite 900 Waterford, MI 48327	Page 1 / 1 W/O #: PTK-9391-07-2023 DATE: 07-28-2023 A/C TT: 691.4 Hobbs: 691.4
		Airframe Entries	
		<ul style="list-style-type: none">Completed Annual Inspection in scope and detail of FAR 43 App. D and using Cirrus SR20 Service Manual Checklist as a guide. Researched AD's thru bi-weekly 2023-15. Replaced BA-24 induction air filter with new. Lubricated airframe as required. I certify that this Airframe has been inspected in accordance with an Annual Inspection and has been found to be in Airworthy condition.Tested and inspected ELT in accordance with FAR 91.207(d). Ops check good. Battery replacement due no later than Mar 2029.	
		DATE: 07-28-2023	
		SIGNED:  Dan Lynch IA Number: 3624030	WORK ORDER: PTK-9391-07-2023 Printed by EBIS (EBISCloud.com)

MAINTENANCE RECORD F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
PTK-9391-07-2023 (07-28-2023)			Page 1 / 1
	MAKE: Cirrus Aircraft MODEL: SR20 S/N: 1454 REG. NO: N7728A	 Waterford Aviation, Inc. 6548 Highland Rd Suite 900 Waterford, MI 48327	W/O #: PTK-9391-07-2023 DATE: 07-28-2023 A/C TT: 691.4 Hobbs: 691.4
Airframe Entries			
<ul style="list-style-type: none"> • Complied with AD 2008-11-18, effective date 7/7/2008. Exhaust System Leaks. Performed pressurization check of exhaust IAW SB2x-78-07R1, no defects noted at this time, due again next 100 hours TIS. • Checked elevator cable tension. Lubricated pitch trim cartridge and verified no water in static line water/moisture trap. Work performed in reference to Cirrus SR20 AMM ch. 12-20, 27-30. • Re-adhered RH MLG clickbond fastener as required. Work performed in reference to Cirrus SR22 AMM ch. 32-10. • Removed and replaced LH entry step grip tape P/N 12683-006. Work performed in reference to Cirrus SR20 AMM ch. 53-20. • Complied with service bulletin SB2X-27-12R1 on LH side control yoke. Operational check good. 			
DATE: 07-28-2023	SIGNED:		WORK ORDER: PTK-9391-07-2023
	Zac Dunkley		Printed by EBIS (EBISCloud.com)
	A&P Number: 4439395		