



AIRFRAME MAINTENANCE RECORDS

Log No. 1

Aircraft Registration No. N249WS/N6300B

Aircraft Mfg. Cirrus Model SR20 Serial No. 1157

Engine Mfg. Teledyne Model IO360ES6 Serial No. 357359

Engine Mfg. CONTINENTAL Model _____ Serial No. _____

Propeller Mfg. Hartzell Model PAC T34F IMF Serial No. JC127B

Hub Design No. _____ Hub Serial No. _____

Blade Design No. _____ Blade Serial No's. _____

Propeller Mfg. Hartzell Model _____ Serial No. _____

Hub Design No. _____ Hub Serial No. _____

Blade Design No. _____ Blade Serial No's. _____

(All applicable information must be filled in)



AEROTECH PUBLICATIONS INC.

www.adlog.com

P.O. Box 1359 / Southold, NY 11971-0965

(631) 765-9375

1-800-235-6444

FAX: (631) 765-9359

©1979 AeroTech Publications, Inc.

MAINTENANCE RECORD

F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
11-16-01	7.2 HRS	<p>Repaired Interior and Exterior Cosmetic Discrepancies, Cleaned and Lubricated Seat Tracks IAW standard maintenance practices, Tightened receiver prongs on Passenger MIG Jacks IAW standard maintenance practices Checked wiring between Remote gyro and Standoff HSI, changed Remote gyro to standard and function checked IAW Cirrus Avionics Setup Manual Doc # 90400 Rev B</p>	<p>Pertinent details are on file at this agency under Work Order # 111401-03 Date 11-16-01</p> <p>Signature <i>[Signature]</i></p> <p>Cirrus Design Factory Service Center Duluth, MN Repair Station Cert. No. YD5R855Y</p>
11-16-01	15.6	<p>Replaced Flare and EMSR IAW standard maintenance practices Setup software on EMSR IAW Cirrus Avionics Setup Manual Doc 90400 OPS CHECK OK Replaced Captain PFD Switch IAW MM 23-12</p>	<p>Pertinent details are on file at this agency under Work Order # 111601-02 Date 11-16-01</p> <p>Signature <i>[Signature]</i></p> <p>Cirrus Design Factory Service Center Duluth, MN Repair Station Cert. No. YD5R855Y</p>

AIRWORTHINESS DIRECTIVE / FACTORY BULLETIN COMPLIANCE RECORD

AD / BULL. NUMBER	ITEM AFFECTED	DATE & HRS. AT COMP.	METHOD OF COMPLIANCE	TYPE OF A.D. 1 TIME/RECUR.	NEXT COMP. DATE/HRS./CYCLE	AUTHORIZED SIGNATURE CERTIFICATE NO.
21-22		11-13-01 6.9	Searched AD's through bi-weekly issue <u>2001-22</u> . All AD's are in compliance at this time.			<div style="display: flex; align-items: center;"> <div style="flex: 1;"> <i>Ray S. Kuyumjian</i> 11-13-01 </div> <div style="border: 1px solid black; padding: 2px; margin-left: 10px;"> 40 CDG </div> </div>

MAKE: Cirrus
MODEL: SR20
S/N:
REG. NO: 249WS
WORK ORDER: 350-12-2001

Top Gun Aviation, Inc.
6100 S. Lindbergh St
Stockton, CA 95206

DATE: 12/4/2001
TTA:
TACH: 42.5

Airframe Entries

(1) CW SB 20-55-06; Stabilizer rivet insp OK no repair required...

I certify that this AIRCRAFT is airworthy with respect to the work performed.

DATE: 12/4/2001

SIGNED:

Mark T. Rouch

MARK T. ROUCH
IAE 6321421

WORK ORDER: 350-12-2001

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 7736

Air West Aircraft Engines
670 Airport Blvd.
San Carlos, CA 94070
Repair Station No. TV3R881L

DATE: 2-27-02
TTA: 88.00
TACH: 88.00

Airframe Entries

CW SB A22-95-01 CAPS Activation Cable Assy by modification of activation cable IAW BRS SB95-01...

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 2-27-02

SIGNED:


David Campbell

WORK ORDER: 7736

Certified Repair Station No. TV3R881L

Printed by FRIs (<http://www.datcomedia.com>)

AIRWORTHINESS DIRECTIVE / FACTORY BULLETIN COMPLIANCE RECORD

A.D./BULL. NUMBER	ITEM AFFECTED	DATE & HRS. AT COMP	METHOD OF COMPLIANCE	TYPE OF A.D. 1 TIME/RECUR.	NEXT COMP. DATE/HRS./CYCLE	AUTHORIZED SIGNATURE CERTIFICATE NO.
	<p>AIRCRAFT LOG BOOK ENTRY N249WS CIRRUS SR20 S/N 1157</p> <p>JUNE 26, 2002</p>					
	<p>ACCOMPLISHED CIRRUS DESIGN SERVICE BULLETIN 20-34-03 DATED FEBRUARY 04, 2002 BY REMOVING ARNAV ICDS-2000 MFD AND INSTALLING AVIDYNE EX-5000 MFD. REMOVED MID CONTINENT 4305-150 REMOTE DIRECTIONAL GYRO AND SENT TO MANUFACTURER FOR ACCOMPLISHMENT OF GENERAL DESIGN SERVICE BULLETIN 4305-150-02, REINSTALLED MODIFIED UNIT. UPDATED SANDEL SN3308 EHSI SOFTWARE TO VERSION 2.10 AND INSTALLED CURRENT NAV DATABASE. ACOMPLISHED GARMIN SERVICE BULLETIN 0203 TO BOTH GNS 430 NAV/COM/GPS UNITS. REFERENCE UPDATED AIRCRAFT WEIGHT AND BALANCE DATA AS WELL AS LAC WORK ORDER NUMBER 15450. NO FURTHER ENTRY.</p>					
	<div style="text-align: center;">  </div> <p>LOYD B NESBITT JR, ASSISTANT INSPECTOR LAC AVIONICS INC. FAA CERTIFIED REPAIR STATION NUMBER FM4R185M</p>					
	<p>LOG249WS.202</p>					
	<p style="text-align: center;">40 20-52-02 on PAGE 31</p>					

AIRWORTHINESS DIRECTIVE / FACTORY BULLETIN COMPLIANCE RECORD

A.D./BULL. NUMBER	ITEM AFFECTED	DATE & HRS. AT COMP.	METHOD OF COMPLIANCE	TYPE OF A.D. 1 TIME/RECUR.	NEXT COMP. DATE/HRS./CYCLE	AUTHORIZED SIGNATURE CERTIFICATE NO.
----------------------	------------------	-------------------------	-------------------------	-------------------------------	-------------------------------	---

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 7813

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070
Repair Station No. TV3R881L

DATE: 3/27/02
TTA: 101.40
TACH: 101.40

Airframe Entries

CW AD 2002-05-05 CAPS Activation System by modification IAW SB 20-95-02...

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 3/27/02

SIGNED: 

WORK ORDER: 7813

Certified Repair Station No. TV3R881L

Printed by EBis (<http://www.datcomedia.com>)

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 8294

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070
Repair Station No. TV3R881L

DATE: 7/22/2002
TTA: 163.70
TACH: 163.70

Airframe Entries

CW SB 20-32-04 Spindle Cup Inspection by inspection & adjustment; OK... CW SB 20-78-01 Exhaust Ball Joint Flange Tension by inspection & adjustment; OK... CW SB 20-95-03 CAPS Handle Access Cover by installation of new cover... CW SB 20-95-04 CAPS Activation Handle Bracket by installation of new bracket/ hardware & testing; OK... CW SB 20-95-05 CAPS Activation Cable by installation of new cable assy & modification of rocket shield and cone... R & L cabin heat box assy; weld repair duct attach flange...

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 7/22/2002

SIGNED: 

WORK ORDER: 8294

Certified Repair Station No. TV3R881L

Printed by EBis (<http://www.datcomedia.com>)

MAINTENANCE RECORD

F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO
11-17-01	Hobbs 18.5	Removed and Replaced remote gyro with new P/N 14357-5/N 072 11927 IAW Standard maint practices. Setup chg IAW CDC Avionics Setup manual ops ✓ good.	

Pertinent details are on file at this agency under

Work Order # 111701-01

Date 11-17-01

Signature

Cirrus Design Factory Service Center
Duluth, MN
Repair Station Cert. No. YD5R855Y

AIRCRAFT LOG BOOK ENTRY N249WS CIRRUS SR20 S/N 1157
JUNE 26, 2002

INSTALLED NEW PILOT AND COPILOT BOSE SERIES X HEADSET INTERFACES.
NO AIRCRAFT WEIGHT AND BALANCE DATA CHANGE. REFERENCE LAC WORK
ORDER NUMBER 15450. NO FURTHER ENTRY.

LOYD B NESBITT JR, ASSISTANT INSPECTOR
LAC AVIONICS INC. FAA CERTIFIED REPAIR
STATION NUMBER FM4R185M

LOG249WS.102

MAINTENANCE RECORD

F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
-----------------------	-----------------------------	--	--

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 8556

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070

Repair Station No. TV3R881L

DATE: 12/13/2002
TTA: 236.00
TACH: 236.00

Airframe Entries

Completed ANNUAL Inspection IAW Air West Aircraft Engines scope & detail and Cirrus Manual 12137-001... C/W AD 2002-21-02 Trim Retention Nuts by installation of new MS21044N3 nuts per SB 20-27-06 ... C/W SB 20-77-01 Avidyne Engine Instrument Kit by installation of kits 70030-901, 70030-903 & 70030-905 and C/W Avidyne SB 03 & 04... Installed new alternators #1 50933-001 s/n C083133 & #2 50846-001 s/n H-260215... Installed new NAV/COM antenna p/n CI-109... Installed all new 066-14100 brake linings... Rotated both main tires on respective wheels... Installed new SANDEL bulb per drawing 90122-1M... Installed new BA-24 air filter element... ELT insp. IAW FAR 91.207(d) & found to be in satisfactory condition, battery exp: 03/2005...

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 12/13/2002

SIGNED: 

WORK ORDER: 8556

Certified Repair Station No. TV3R881L

Printed by EBis (<http://www.datcomedia.com>)

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 8770

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070

Repair Station No. TV3R881L

DATE: 2/28/2003
TTA: 241.00
TACH: 241.00

Airframe Entries

Serviced & installed new G-243 battery s/n G01995044... C/W SB 20-52-02 Cabin & Baggage Door Drains by drilling necessary drain holes... Repositioned copilot seatbelt under backrest for proper alignment...

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 2/28/2003

SIGNED: 

WORK ORDER: 8770

Chris Camp
Certified Repair Station No. TV3R881L

Printed by EBis (<http://www.datcomedia.com>)

AD NOTES COMPLIANCE RECORD

Airframe - Cirrus - SR20

N/A- NOT APPLICABLE

P/N- PART NUMBER

S/N- SERIAL NUMBER

P/C/W- PREV. COMPLIED WITH

AD#	Applicable S.B. # & Subject	Date & Hours @ Comp.	Method of Compliance	One Time	Recurring	Next Comp. @ Hrs/Date	Authorized Signature & Number
2001-25-03	Detect and replace understrength rivets in the	12/5/01	P/C/W	X			AIR WEST TV3R881L
2002-05-05	Limit the chance of failure of the CAPS activation system	3/27/02 101 TT	P/C/W IAW SB 20-95-02	X			AIR WEST TV3R881L
2002-21-02	Prevent loss of the self-locking retaining nut on the roll and yaw	12/11/02 236 TT	P/C/W	X			AIR WEST TV3R881L
64-01-01	Airborne vacuum pumps		N/A BY MODEL	X			AIR WEST TV3R881L
70-16-01	Woodward governor installations		N/A BY ENGINE MODEL	X			AIR WEST TV3R881L
70-20-02	Woodward governors		N/A BY MODEL	X			AIR WEST TV3R881L
74-18-05	Slick magnetos		N/A BY MODEL	X			AIR WEST TV3R881L
76-16-02	Airborne pumps		N/A BY MODEL	X			AIR WEST TV3R881L
79-13-08	Airborne dry air pumps		N/A BY MODEL	X			AIR WEST TV3R881L
80-06-05	Slick magnetos		N/A BY MODEL	X			AIR WEST TV3R881L
81-15-03	Brackett air filters		N/A BY MODEL	X			AIR WEST TV3R881L
81-16-05	Slick magnetos		N/A BY MODEL	X			AIR WEST TV3R881L
81-25-01	Woodward governor flyweights		N/A BY MODEL	X			AIR WEST TV3R881L
86-01-06	Airborne dry air pumps		N/A BY MODEL	X			AIR WEST TV3R881L
93-05-06	ACS ignition switches	NEW @ MANUF.	EA 2000 HRS		X	2000 TT	AIR WEST TV3R881L
95-03-02	Brackett air filter gasket		SUPERCEDED	X			AIR WEST TV3R881L
96-09-06	Brackett air filter gasket		N/A BY MODEL	X			AIR WEST TV3R881L
98-23-01	Flexible coupling		N/A BY S/N	X			AIR WEST TV3R881L
81-13-10 R1	Engine oil pump drive shaft		N/A BY MODEL	X			AIR WEST TV3R881L
88-03-06	Oil filter		N/A BY P/N	X			AIR WEST TV3R881L
91-19-03	Champion oil filter		N/A BY DATE CODE	X			AIR WEST TV3R881L
92-04-09	Rocker shaft		N/A BY S/N	X			AIR WEST TV3R881L
93-10-02	Cylinder valve retainer		N/A BY S/N	X			AIR WEST TV3R881L
97-26-17	Crankshaft fatigue cracks		@ OVERHAUL		X		AIR WEST TV3R881L
2000-23-21	Fracture of the crankshaft connecting rod journal		N/A BY S/N	X			AIR WEST TV3R881L
2002-13-04	Correction - Prevent engine failure and loss of control of the		N/A BY MAGNETO S/N's	X			AIR WEST TV3R881L

AD#	Applicable S.B. # & Subject	Date & Hours @ Comp.	Method of Compliance	One Time	Recurring	Next Comp. @ Hrs/Date	Authorized Signature & Number
PL2000-08-51	Crankshaft connecting rod journal fracture		N/A BY S/N	X			AIR WEST TV3R881L
PL2000-11-51	Possible engine failure		N/A BY MAGNETO S/N's	X			AIR WEST TV3R881L
77-12-06 R2	Prop blade		SUPERCEDED	X			AIR WEST TV3R881L
89-22-05	Propeller hub failure		SUPERCEDED	X			AIR WEST TV3R881L
93-16-14	Prop hub cracks		SUPERCEDED	X			AIR WEST TV3R881L
94-17-13	Prop hub failure		N/A BY S/N	X			AIR WEST TV3R881L
2001-07-03	Correction - Prevent propeller failure of the propellers returned		N/A BY VENDOR	X			AIR WEST TV3R881L
2002-09-08	Prevent failure of the propeller blade from fatigue cracks		N/A BY BLADE S/N's	X			AIR WEST TV3R881L

MAINTENANCE RECORD

F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
-----------------------	-----------------------------	--	--

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 9050

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070

Repair Station No. TV3R881L

DATE: 4/15/2003
TTA: 247.20
TACH: 247.20

Airframe Entries

Installed new RH cabin door assist strut p/n 12545-001... Re seated SANDEL in rack; ground checked & apps ok...

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 4/15/2003

SIGNED:

Chris Camph
Certified Repair Station No. TV3R881L

WORK ORDER: 9050

Printed by EBis (<http://www.datamedia.com>)

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 9457

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070

Repair Station No. TV3R881L

DATE: 7/25/03
TTA: 297.90
TACH: 297.90

Airframe Entries

Serviced tires with air ... Replaced ring connector at Cyl #3 CHT connector... C/W SB 2X-57-04 Aileron hinge by inspection per SB instructions; ok, no further action required ... C/W SB 2X-32-06 by installation of nose pant washers per SB instructions...

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 7/25/03

SIGNED:

Nelson Andrade
Certified Repair Station No. TV3R881L

WORK ORDER: 9457

Printed by EBis (<http://www.datamedia.com>)

MAINTENANCE RECORD

F.A.R. 43.9

DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE WORK PERFORMED/RETURNED
---	--

MAKE: Cirrus
MODEL: SR20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 170-09-2003



Cirrus Design Factory Service Center

4515 Taylor Circle
Duluth, MN 55811

Repair Station No. YD5R855Y

DATE: 9/4/03
TTA: 368.4
HOBBS: 368.4

Airframe Entries

(1) Removed lightning mesh under stormscope antenna IAW standard maintenance practices. Repaired stormscope antenna cable at processor tray IAW Cirrus Design Corp. Drawing # 14768. ... (2) Replaced both MLG, inboard fairings, (p/n 14209-001 & 002), IAW Cirrus Design Corp. maintenance manual chap. 32.... (3) Replaced R/H navigation light bulb, (p/n 50911-001), IAW Cirrus Design Corp. maintenance manual chap. 23. ... (4) Removed and replaced both left and right anti-skid tapes on steps with new P/N 12883-003 IAW cirrus mm chapter 53 and standard maintenance practices.... (5) Preped and painted chaff mark on R/H flap IAW standard maintenance practices. Installed anti chaff material to both flaps IAW Cirrus Design Corp. 57-50.... (6) Replaced missing screw in tachometer IAW standard maintenance practices.... (7) Installed Velcro to both upper, AFT courtesy lights IAW standard maintenance practices.... (8) Replaced sensor interface unit, (p/n14843-001), IAW Cirrus Design Corp. maintenance manual 77-30.... (9) Replaced center bolster panel, (p/n 13104-002), resecured both door interior panels and trim IAW Cirrus Design Corp. maintenance manual chap. 25....

I have reviewed the file on this aircraft and the accompanying discrepancy forms. The aircraft, airframe, aircraft engine, propeller, or appliance identified was repaired/inspected in accordance with current requirements of the Federal Aviation Administration and is approved/disapproved for return to service. Pertinent details of repair are on file at this Certified Repair Station CRS YD5R855Y.

DATE: 9-4-03

SIGNED:

Aaron Holmgren

Certified Repair Station No. YD5R855Y

WORK ORDER: 170-09-2003

Printed by EBis (<http://www.datcomedia.com>)

MAINTENANCE RECORD

F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
--------------------	--------------------------	---	---

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 9997

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070

Repair Station No. TV3R881L

DATE: 12/24/03
TTA: 406.10
HOBBS: 406.10

Airframe Entries

Completed ANNUAL Inspection IAW Cirrus Design SR-20 manual 12137-001 & Air West Aircraft Engines Scope & Detail... C/W SB 2X-25-05 Am-Safe Belts by installation of kit 70064-001... C/W SB 2X-34-05 Transponder Antenna Ground Plane Improvement by installation of kit 70058-001... Replaced both main wheel tires... ELT insp. IAW FAR 91.207(d) & found to be in satisfactory condition, battery exp: 3/2005... AD 2002-24-08 CAPS Activation System P/C/W (7/22/02) by modification IAW Cirrus SB's 22-95-03, 22-95-04 & 22-95-05, ok; No further action required... Replaced nose landing gear upper bumpers and washers...

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were retained and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 12/24/03

SIGNED: 

WORK ORDER: 9997

Nelson Andrade
Certified Repair Station No. TV3R881L

Printed by EBis (<http://www.datcomedia.com>)

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 10124

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070

Repair Station No. TV3R881L

DATE: 1/15/04
TTA: 415.20
HOBBS: 415.20

Airframe Entries

Secured loose Adel clamp at heater ducting, Rigged and lubed heater control...

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 1/15/04

SIGNED: 

WORK ORDER: 10124

Nelson Andrade
Certified Repair Station No. TV3R881L

Printed by EBis (<http://www.datcomedia.com>)

AD NOTES COMPLIANCE RECORD

Airframe - Cirrus - SR20

1157

N/A- NOT APPLICABLE

P/N- PART NUMBER

S/N- SERIAL NUMBER

P/CW- PREV. COMPLIED WITH


Engine - Teledyne Continental - IO-360-ES

357359

AD#	Applicable S.B. # & Subject	Date & Hours @ Comp.	Method of Compliance	One Time	Recurring	Next Comp. @ Hrs/Date	Authorized Signature & Number
2001-25-03	Detect and replace understrength rivets in the	12/5/01	P/CW	X			AIR WEST TV3R881L
2002-05-05	Limit the chance of failure of the CAPS activation system	3/27/02 101 TT	P/CW IAW SB 20-95-02	X			AIR WEST TV3R881L
2002-21-02	Prevent loss of the self-locking retaining nut on the roll and yaw	12/11/02 236 TT	P/CW	X			AIR WEST TV3R881L
2002-24-08	Prevent failure of the CAPS activation system in an	7/02 163.7 TTA	P/CW (7/22/02) BY MOD PER SB'S 20-95-03, 20-95-04, & 20-95-05	X			AIR WEST TV3R881L
64-01-01	Airborne vacuum pumps		N/A BY MODEL	X			AIR WEST TV3R881L
70-16-01	Woodward governor installations		N/A BY ENGINE MODEL	X			AIR WEST TV3R881L
70-26-02	Woodward governors		N/A BY MODEL	X			AIR WEST TV3R881L
74-18-05	Slick magnetos		N/A BY MODEL	X			AIR WEST TV3R881L
76-16-02	Airborne pumps		N/A BY MODEL	X			AIR WEST TV3R881L
79-13-08	Airborne dry air pumps		N/A BY MODEL	X			AIR WEST TV3R881L
80-06-05	Slick magnetos		N/A BY MODEL	X			AIR WEST TV3R881L
81-15-03	Brackett air filters		N/A BY MODEL	X			AIR WEST TV3R881L
81-16-05	Slick magnetos		N/A BY MODEL	X			AIR WEST TV3R881L
81-25-01	Woodward governor flyweights		N/A BY MODEL	X			AIR WEST TV3R881L
86-01-06	Airborne dry air pumps		N/A BY MODEL	X			AIR WEST TV3R881L
93-05-06	ACS ignition switches	NEW @ MANUF.	EA 2000 HRS		X	2000 TT	AIR WEST TV3R881L
95-03-02	Brackett air filter gasket		SUPERCEDED	X			AIR WEST TV3R881L
96-09-06	Brackett air filter gasket		N/A BY MODEL	X			AIR WEST TV3R881L
98-23-01	Flexible coupling		N/A BY S/N	X			AIR WEST TV3R881L
2002-26-03	Detect and correct incorrect installation of the air filter		N/A BY BRACKETT ASSY PART NO.	X			AIR WEST TV3R881L
81-13-10 R1	Engine oil pump drive shaft		N/A BY MODEL	X			AIR WEST TV3R881L
88-03-06	Oil filter		N/A BY P/N	X			AIR WEST TV3R881L
91-19-03	Champion oil filter		N/A BY DATE CODE	X			AIR WEST TV3R881L
92-04-09	Rocker shaft		N/A BY S/N	X			AIR WEST TV3R881L
93-10-02	Cylinder valve retainer		N/A BY S/N	X			AIR WEST TV3R881L

AD#	Applicable S.B. # & Subject	Date & Hours @ Comp.	Method of Compliance	One Time	Recurring	Next Comp. @ Hrs/Date	Authorized Signature & Number
97-26-17	CORRECTION - Crankshaft fatigue cracks		@ OVERHAUL		X		AIR WEST TV3R881L
2000-23-21	Fracture of the crankshaft connecting rod journal		N/A BY S/N	X			AIR WEST TV3R881L
2002-13-04	CORRECTION - Prevent engine failure and loss of control of the		N/A BY MAGNETO S/N's	X			AIR WEST TV3R881L
PL2000-08-5 1	Crankshaft connecting rod journal fracture		N/A BY S/N	X			AIR WEST TV3R881L
PL2000-11-5 1	Possible engine failure		N/A BY MAGNETO S/N's	X			AIR WEST TV3R881L
77-12-06 R2	Prop blade		SUPERCEDED	X			AIR WEST TV3R881L
89-22-05	Propeller hub failure		SUPERCEDED	X			AIR WEST TV3R881L
93-16-14	Prop hub cracks		SUPERCEDED	X			AIR WEST TV3R881L
94-17-13	Prop hub failure		N/A BY S/N	X			AIR WEST TV3R881L
2001-07-03	CORRECTION - Prevent propeller failure of the propellers		N/A BY VENDOR	X			AIR WEST TV3R881L
2002-09-08	Prevent failure of the propeller blade from fatigue cracks		N/A BY BLADE S/N's	X			AIR WEST TV3R881L

DIRWORTHINESS DIRECTIVE / FACTORY BULLETIN COMPLIANCE RECORD

ITEM AFFECTED	DATE & HRS. AT COMP.	METHOD OF COMPLIANCE	TYPE OF A.D. 1 TIME/RECUR.	NEXT COMP. DATE/HRS./CYCLE	AUTHORIZED SIGNATURE CERTIFICATE NO.
<p>MAKE: CIRRUS MODEL: SR-20 S/N: 1157 REG. NO. 249WS WORK ORDER: 10185</p> <p>Air West Aircraft Engines 670 Airport Blvd. San Carlos, CA 94070 Repair Station No. TV3R881L</p> <p>DATE: 2/19/04 TTA: 425 60 HOBBS: 425 60</p>					
<p>Airframe Entries</p> <p>C/W SB 2X-95-06 by inspection of CAPS lanyard rigging per SB instructions; ok ... Reattached loose sealant on pilots side windshield... Installed missing wheel fairing cover... C/W SB 2X-95-07 by installation of CAPS warning placard per SB instructions...</p> <p>The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.</p>					
DATE: 2/19/04		SIGNED: 		WORK ORDER: 10185	
		Nelson Andrade Certified Repair Station No. TV3R881L		Printed by EBis (http://www.datcomedia.com)	

MAINTENANCE RECORD

F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
7.04		INSTALLED ROSEN SUNVISORS	C. Smith

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG NO: 249WS
WORK ORDER: 10374

Air West Aircraft Engines

870 Airport Blvd.
San Carlos, CA 94070

Repair Station No. TV3R881L

DATE: 4/16/04
TTA: 425.60
HOBBS: 425.60

Airframe Entries

Troubleshoot inop #2 alternator, removed #2 alternator and reinstalled after repair, reference Cirrus Maint manual 13773-001, Ch 24-30; leak check & ops check ok... Serviced tires with air ... C/W SA 04-01 by checking brake lines for chafing; checked ok...

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 4/16/04

SIGNED:

Nelson Andrade
Certified Repair Station No. TV3R881L

WORK ORDER: 10374

Printed by EBis (<http://www.datamedia.com>)

LIMITED MAINTENANCE RELEASE

Make and Model TCM ALTERNATOR 24 V

Customer C. SMITH

Part # 653344

Serial # 11-260215

The Aircraft Component identified above was repaired and inspected in accordance with Current Regulations of the Federal Aviation Administration. Only work detailed on the work order listed below is approved for return to service.

WARNING: Further inspection and repair may be necessary, to return this component to serviceable condition.


Pertinent details of this repair are on file at this repair station under

Work Order # 10374

Date APR 16 04

Signed [Signature] CCAMPH

AIR WEST
AIRCRAFT ENGINES

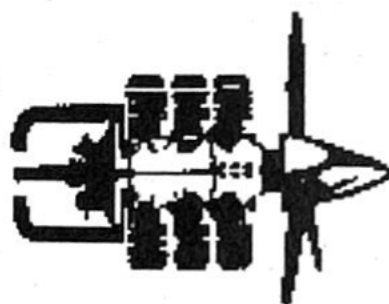

SAN CARLOS AIRPORT

670 AIRPORT BLVD.

SAN CARLOS, CA. 94070

FAA APPROVED REPAIR STATION TV3R881L

PHONE (650) 593-8403

DATE

TOTAL
TIME
IN
SERVICETACH OR
RECORDING
METER
TIMEDESCRIPTION OF WORK PERFORMED—
SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORKMAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 9457**AIR WEST**
AIRCRAFT ENGINES

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070
Phone: (650) 593-8403DATE: 7/29/2003
A/C TSN: 297.90
TACH: 297.90

Airframe Entries

Serviced tires with air ... Replaced ring connector at Cyl #3 CHT connector... C/W SB 2X-57-04 Aileron hinge by inspection per SB instructions; ok, no further action required ... C/W SB 2X-32-06 by installation of nose pant washers per SB instructions

The component(s) and/or discrepancy (ies) identified on this work order , to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 7/29/2003

SIGNED:

DUPLICATE

Work Order: 9457

Printed by EBis 3 (datcomedia.com)

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 9997**AIR WEST**
AIRCRAFT ENGINES

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070
Phone: (650) 593-8403DATE: 1/5/2004
A/C TSN: 406.10
HOBBS: 406.10

Airframe Entries

Completed ANNUAL Inspection IAW Cirrus Design SR-20 manual 12137-001 & Air West Aircraft Engines Scope & Detail.... C/W SB 2X-25-05 Am-Safe Belts by installation of kit 70064-001... C/W SB 2X-34-05 Transponder Antenna Ground Plane Improvement by installation of kit 70058-001... Replaced both main wheel tires... ELT insp.IAW FAR 91.207(d) & found to be in satisfactory condition, battery exp: 3/2005... AD 2002-24-08 CAPS Activation System P/C/W (7/22/02) by modification IAW Cirrus SB's 22-95-03, 22-95-04 & 22-95-05, ok; No further action required... Replaced nose landing gear upper bumpers and washers

The component(s) and/or discrepancy (ies) identified on this work order , to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 1/5/2004

SIGNED:

DUPLICATE

Work Order: 9997

Printed by EBis 3 (datcomedia.com)

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 10185**AIR WEST**
AIRCRAFT ENGINES

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070
Phone: (650) 593-8403DATE: 2/25/2004
A/C TSN: 425.60
HOBBS: 425.60

Airframe Entries

C/W SB 2X-95-06 by inspection of CAPS lanyard rigging per SB instructions; ok ... Reattached loose sealant on pilots side windshield... Installed missing wheel fairing cover... C/W SB 2X-95-07 by installation of CAPS warning placard per SB instructions

The component(s) and/or discrepancy (ies) identified on this work order , to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 2/25/2004

SIGNED:

DUPLICATE

Work Order: 10185

Printed by EBis 3 (datcomedia.com)

MAKE: CIRRUS
MODEL: SR-20
S/N: 1157
REG. NO: 249WS
WORK ORDER: 10374**AIR WEST**
AIRCRAFT ENGINES

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070
Phone: (650) 593-8403DATE: 4/19/2004
A/C TSN: 425.60
HOBBS: 425.60

Airframe Entries

Troubleshoot inop #2 alternator, removed #2 alternator and reinstalled after repair, reference Cirrus Maint manual 13773-001, Ch 24-30; leak check & ops check ok... Serviced tires with air ... C/W SA 04-01 by checking brake lines for chafing; checked ok

The component(s) and/or discrepancy (ies) identified on this work order , to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 4/19/2004

SIGNED:

DUPLICATE

Work Order: 10374

Printed by EBis 3 (datcomedia.com)

DATE	TOTAL TIME IN SERVICE	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED — SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
	MAKE CIRRUS MODEL SR-20 S/N 1157 REG NO 249WS WORK ORDER 10473	AIR WEST AIRCRAFT ENGINES 670 Airport Blvd San Carlos, CA 94070 Phone (650) 593-8403	DATE 5/14/2004 A/C TSN 448 40 HOBBS 448 40
	Airframe Entries Replaced RH aft nav light... Per Cirrus SR20 Maintenance Manual No. 12137-001, Sec 5-10, Overhaul & Replacement Schedule; Reefing Line Cutters due for replacement after 6 years from date of reefing line cutters manufacture. C/W SB 20-55-08 by enlarging rudder and elevator tip drain holes		
	The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.		
DATE: 5/14/2004	SIGNED:	DUPLICATE	
		Work Order: 10473	
		Printed by EBis 3 (datcomedia.com)	

Syracuse Executive Air Service, Inc.Reg #: N6300B
AC S/N: 1157Make: Cirrus
ACTT: 602.8Model: SR20
Hobbs: 602.8

Airframe

Tach: 0.0

Complied with annual inspection per FAR 91.409(a)1 and checklist
 Complied with annual ELT inspection per FAR 91.207 (d) and replaced batteries, next due 12/2006
 Replaced batteries in turn and bank and clock
 Complied with SB 2x-25-06R2 on seat
 Complied with SB 2x-28-03 on fuel selector
 SB 20-95-02R1 found PCW by SB 20-95-05
 Complied with SB 2x-95-08 on cap line cutters, corrected entry in los next due 2/2007
 Complied with AD research
 Replaced nose wheel teflon washer
 Replaced engine air filter
 Found AD2001-25-03 PCW by SB 20-55-06
 AD2004-10-15 found PCW by upgrade to version 6
 AD2001-23-17 DNA per PN SN
 Replaced brake linings
 Run up and leak check good

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
 For details of work performed, see workorder on file with this Repair Station.

Signature: **COPY**

Date: 12/23/2004

Work Order: 4278

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
 211 Tuskegee Road
 Syracuse, NY 13211

EXEC AIR**Syracuse Executive Air Service, Inc.**Reg #: N6300B
AC S/N: 1157Make: CIRRUS
ACTT: 627.3Model: SR-20
Hobbs: 627.3

Airframe

Tach: 0.0

1: Completed SB2X-25-07 R1 dated 02/03/2005 Dual Inertia Reel Seat Belt Installation. Weight & Balance and Equipment list updated.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
 For details of work performed, see workorder on file with this Repair Station.

Signature: **COPY**

Date: 03/01/2005

Work Order: 4393

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
 211 Tuskegee Road
 Syracuse, NY 13211

EXEC AIR

Syracuse Executive Air Service, Inc.

Reg #: N6300B

Make: Cirrus

Model: SR20

Airframe

AC S/N: 1157

ACTT:

Hobbs: 689.9

Tach:

Installed New landing light bulb PN# Q5596. Ops check good.

All work performed IAW current FAA regulations and current manufacturers technical data. The work performed above is approved for return to service.

Signature:

COPY

Date: 04/29/2005

A&P:

2803181

Syracuse Executive Air Service, Inc.

Reg #: N6300B

Make: Cirrus

Model: SR20

Airframe

AC S/N: 1157

ACTT: 916.9

Hobbs: 916.9

Tach:

Repaired landing light connector at lower cowl disconnect.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature:

COPY

Date: 04/04/2006

Work Order: 5018

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C

211 Tuskegee Road

Syracuse, NY 13211

EXEC-AIR**Syracuse Executive Air Service, Inc.**

Reg #: N6300B

Make: Cirrus

Model: SR20

Airframe

AC S/N: 1157

ACTT: 990.1

Hobbs: 990.1

Tach:

Installed new tach generator, model no. TG0100-05010 part no. 12630-001.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature:

COPY

Date: 08/16/2006

Work Order: 5236

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C

211 Tuskegee Road

Syracuse, NY 13211

EXEC-AIR

MAKE: Cirrus
MODEL: SR20
S/N: 1157
REG. NO: N6300B
WORK ORDER: 192

Advanced Aircraft Services LP

500 Airport Rd. Suite D
Lititz, PA 17543
Phone: 717-735-5179

DATE: 2/8/2007
A/C TSN: 1067.5
HOBBS: 1067.5

Airframe Entries

Completed an Annual Inspection using the Cirrus AMM check list ch. 5-20.... Replaced the left aft nav lamp socket... Complied with SB 20-73-02 Improved starting kit installation.... Complied with SB 2X-52-04 Cabin door strut modification.... Complied with AD 06-19-10 Crew seat break over bolt and recline locks.... Complied with AD 06-21-03 replacement of the brake caliper O-rings.... Complied with Airborne SL 39a Vacuum manifold valve test and inspection.... Replaced the exhaust muffler and muffler/heat exchanger.... Installed a conical washer in the lower gascolator fitting to prevent further leaking, Leak checked good.... Replaced the left and right main gear grommets.... Replaced all door strut grommets on the left and right cabin doors.... Replaced the aileron/rudder interconnect shock cord and rigged bungee per the Cirrus AMM.... Replaced the CAPS reefing line cutters (Due Oct 2012)... Replaced the Central vac filter.... Replaced the vacuum hoses between the vacuum pump and the manifold valve. Cleaned and repacked all wheel bearings, Serviced all tires, Replaced the vac regulator filter, Replaced the central vac filter, Serviced the battery, Serviced the brake fluid, completed a light check, C/W FAR 91.207 (d) ELT check. All AD's current thru 07-03.-END-

I certify that this AIRFRAME has been inspected IAW an Annual Inspection and was found to be in Airworthy condition.

DATE: 2/8/2007

SIGNED:

Work Order: 192

Richard A. Barnhart II, A&P: 3124994 *IA*

Printed by EBis 3 (datamedia.com)

Syracuse Executive Air Service, Inc.

Reg #: N6300B
AC S/N: 1157

Make: Cirrus Design
ACTT: 1105.9

Model: SR-20
Hobbs: 1105.9

Airframe

Tach:

- 1: Completed SB A2X-95-10 R2 dated 04/30/2007 CAPS pick-up collar support replacement.
- 2: Completed SB 2X-95-09 R1 dated 04/10/2007 CAPS strap abrasion inspection. Found 3 longitudinal strands severed. Cirrus Design technical support released installation as airworthy after digital picture documentation.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature: **COPY**

Date: 05/10/2007

Work Order: 5540

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
211 Tuskegee Road
Syracuse, NY 13211

EXECAIR

Syracuse Executive Air Service, Inc.

Reg #: N6300B
AC S/N: 1157

Make: Cirrus Design
ACTT: 1110.7

Model: SR-20
Hobbs: 1110.7

Airframe

Tach:

- 1: Removed and installed engine metal baffling to facilitate cleaning out bird's nest.
- 2: Installed 2 new adel clamps for intake pipe stand-off installations.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature: **COPY**

Date: 05/10/2007

Work Order: 5563

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
211 Tuskegee Road
Syracuse, NY 13211

EXECAIR

DATE

TOTAL
TIME
IN
SERVICETACH OR
RECORDING
METER
TIMEDESCRIPTION OF WORK PERFORMED—
SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK**Syracuse Executive Air Service, Inc.**Reg #: N6300B
AC S/N: 1157Make: Cirrus
ACCT: 1157Model: SR20
Hobbs: 1137.9

Airframe

Tach:

Installed new tach generator, model no. TG0100-05010 part no. 12323-001, serial no. 1436.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature:

COPY

Date: 07/17/2007

Work Order: 5620

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
211 Tuskegee Road
Syracuse, NY 13211

EXEC AIR

Syracuse Executive Air Service, Inc.Reg #: N6300B
AC S/N: 1157Make: Cirrus Design
ACCT: 1180.2Model: SR-20
Hobbs: 1180.2

Airframe

Tach:

Removed #1 dry air pump p/n 215CC s/n 10AU 3445. Installed new dry air pump p/n AA3215CC s/n N41943
Installed new filter elements p/n AAD9-18-1 and p/n B3-5-1. Operational check satisfactoryAll work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature:

COPY

Date: 10/06/2007

Work Order: 5739

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
211 Tuskegee Road
Syracuse, NY 13211

EXEC AIR

Syracuse Executive Air Service, Inc.Reg #: N6300B
AC S/N: 1157Make: Cirrus Design
ACCT: 1195.9Model: SR-20
Hobbs: 1195.9

Airframe

Tach:

Installed new socket and lamp for rt wing aft nav light.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature:

COPY

Date: 11/06/2007

Work Order: 5787

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
211 Tuskegee Road
Syracuse, NY 13211

EXEC AIR

MAKE: Cirrus
MODEL: SR20
S/N: 1157
REG. NO: N6300B
WORK ORDER: 924**Advanced Aircraft Services LP**500 Airport Rd. Suite D
Litz, PA 17543
Phone: 717-735-5179DATE: 5/1/2009
A/C TSN: 1186.4
HOBBS: 1186.4**Airframe Entries**

Replaced the aircraft battery with a concord sealed battery P/N RG24-11M

Maintenance Release

The aircraft and/or component(s) on N6300B was repaired and inspected in accordance with current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this facility under Work Order No. 924, Dated 5/1/2009.

DATE: 5/1/2009

SIGNED:

James J. Mazzanti, A&P: 2699478

Work Order: 924

Printed by EBis 3 (datcomedia.com)

DATE

TOTAL
TIME
IN
SERVICETACH OR
RECORDING
METER
TIMEDESCRIPTION OF WORK PERFORMED—
SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK**Syracuse Executive Air Service, Inc.**

Reg #: N6300B

Make: Cirrus Design

Model: SR-20

Airframe

AC S/N: 1157

ACTT: 1208.0

Hobbs: 1208.0

Tach: N/A

Complied with Annual Inspection IAW FAR 91.409(a)1.

Complied with ELT Inspection IAW FAR 91.207(d). Installed new batteries, replacement date 3/2013.

Complied with AD research thru bi-weekly 2008-02.

Inserted Revision A6, A7, and A8 into POH.

Requirements of AD 2007-14-03 previously complied with on 05/10/2007 by completion of SB A2X-95-10R2.

Complied with SB 2X-27-14 R3, aileron rudder interconnect modification.

Verified completion of SB 2X-32-14R1 by visual inspection.

Complied with SB 2X-57-05 R2, aileron hinge inspection.

Complied with SB 2X-71-10R1, oil breather line insulation.

Complied with SB 2X-78-07R1, SR 20 heat exchanger inspection.

SB 2X-80-01, starter replacement, not applicable.

Complied with 5 year replacement of aileron/rudder interconnect bungee.

Complied with time replacement of turn coordinator batteries.

Replaced OAT/CLOCK batteries.

Completed Airborne check valve manifold 12 month leak check.

Installed new central vacuum and regulator filters.

Installed new induction air filter.

Complied with 5 Year replacement of Gasculator seals and all drain seals

Complied with 5 Year replacement of all brake lines and replaced brake O-rings, bled and leaked check.

Replaced both wheel fairings lower brackets and reglued right strut faring attach fitting.

Installed new bearings and races in left main wheel.

All work performed IAW current FAA regulations and current manufacturers technic & data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature:

COPY

Date: 01/26/2008

Work Order: 5871

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
211 Tuskegee Road
Syracuse, NY 13211**EXEC AIR**

SUB-TOTAL this page

TOTAL-Carry forward to next page