



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

Telephone: 317-769-4487
Fax:



Bill To: Redacted

Invoice Number: TYQ-INV25-00032
Account Code: TANGO
P.O. Number:
Job Number:
Invoice Date: 01/15/2025

Payment Type: On Account
Exchange Rate: 1.000000 USD

Payment Terms:

INVOICE SUMMARY FOR WORK ORDER NUMBER: 1374
AC Hours: **AC Cyc/Lnd:** **AC Hr Meter:**

Registration Number: N913MT

	Time & Materials	Flat Rate	Total
Squawk:	---	19,330.00 USD	19,330.00 USD
Labor:	4,030.45 USD	4,432.75 USD	8,463.20 USD
Parts:	968.01 USD	---	968.01 USD
Misc Charges:	142.99 USD	---	142.99 USD
Freight:	60.00 USD	---	60.00 USD
Total:	5,201.45 USD	23,762.75 USD	28,964.20 USD
Shop Supplies			338.53 USD
Subtotal:			29,302.73 USD
Previous Billing:			-10,000.00 USD
Total:			19,302.73 USD

Remit Wire to:
Jet Access Maintenance LLC
JP Morgan Chase, New York, NY 10017

Routing Number: 021000021
Account Number: 886512760
SWIFT Code: CHASUS33

Remit ACH to:
Jet Access Maintenance LLC
JP Morgan Chase, New York, NY 10017

Routing Number: 074000010
Account Number: 886512760

Remit Check To:
Jet Access Maintenance LLC
Attn: Accounts Receivable
11329 E State Rd 32
Zionsville, IN 46077

PLEASE NOTE THE INVOICE # AND ACCT CODE ABOVE ON ALL FORMS OF PAYMENT



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

February 10, 2025

Telephone: 317-769-4487

Fax:

Bill To: Redacted	WO #: 1374	Invoice Number: TYQ-INV25-00032
Item: 1 CIRRUS SR22	Part/Model #: SR22	
	Item Serial Number:	
	Registration Number: N913MT	
	Aircraft Serial Number: 1597	

Discrepancy: 1.2 COMPLY WITH CIRRUS SR20 PRE-DELIVERY INSPECTION

Resolution: COMPLIED WITH CIRRUS SR20 PRE-DELIVERY INSPECTION

Discrepancy: 1.4 PERFORM SB2X-95-31R1 10 YEAR CAPS REPLACEMENT

Resolution: PERFORMED 10 YEAR CAPS PARACHUTE AND ROCKET REPLACEMENT IAW CIRRUS SR22 SB2X-95-31R2.REMOVED PACKED PARACHUTE P/N: 25574-004-REB REV C S/N: 01644R1 WITH A PACK DATE OF 2/2/15 AND ROCKET ASSY P/N: 29500-403 S/N: 0909 WITH AN EXPIRATION DATE OF 2/12/25 AND INSTALLED A NEW PACKED PARACHUTE ASSY P/N: 25337-005 S/N: FEC1292 WITH AN EXPIRATION DATE 10/17/2034 AND NEW ROCKET ASSY P/N: 29554-405 S/N: 0736 WITH AN EXPIRATION DATE OF 10/24/34. ALL OPS CHECKS GOOD AT THIS TIME. REMOVED AND REINSTALLED EXISTING LINE CUTTERS P/N: 26707-001 S/N: 16087, 16040 WITH A DOM OF 11/19. NEXT PARACHUTE AND ROCKET REPLACEMENT DUE 10/17/2034 AND LINE CUTTER REPLACEMENT DUE 11/25.

	Hours & Rate	Time & Materials	Flat Rate	Total
Squawk:		---	18,580.00 USD	18,580.00 USD
Total:		0.00 USD	18,580.00 USD	18,580.00 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.4 #1	70789-401	KIT, SR2X ROCKET IGNITOR	1.00	-	-
1.4 #2	25337-005	UPGRADE, 3400# DOMESTIC PACKED PARACHUTE ASSY 3400 LB	1.00	-	-
1.4 #3	51364-250	Serial Number(s) FEC1292 RIVETS	1.00	-	-

Discrepancy: 1.5 COMPLY WITH CIRRUS SR22/T ANNUAL/100 HOUR INSPECTION

S/N RANGE: 22-0002 THRU 22-4434,
22T-0001 THRU 22T-1459, 22T-1461 THRU 22T-1470, 22T-1472

MM P/N 13773-001 REVISION B8

Resolution: COMPLETED ANNUAL/100 HOUR INSPECTION IAW FAR 43 APPENDIX D REFERENCING CIRRUS SR22 AMM 5-20 ANNUAL/100 HOUR CHECKLISTS AS A GUIDE. CLEANED FUEL SCREEN. SERVICED ALL TIRES WITH SHOP AIR TO PROPER PRESSURES. LUBED ALL CONTROLS AND CHECKED TRAVELS. GROUND RUN. OPS CHECKS, LEAK CHECKS OK.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:		---	3,576.00 USD	3,576.00 USD
Parts:		20.23 USD	---	20.23 USD
Total:		20.23 USD	3,576.00 USD	3,596.23 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.5 #1	50803-001 SHORT	WELL NUT	2.00	3.00 USD	6.00 USD
1.5 #2	50802-001 LONG	WELL NUT	1.00	5.23 USD	5.23 USD
1.5 #3	50763-002	WELL NUT	3.00	3.00 USD	9.00 USD



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

February 10, 2025

Telephone: 317-769-4487

Fax:

Bill To: Redacted		WO #: 1374		Invoice Number: TYQ-INV25-00032	
Discrepancy:	1.6	RECORD AIRCRAFT HOURS			
Resolution:	HOBBS-1860.1				
Discrepancy:	1.7	MAP OUTBD BOTTOM WINGS W/ PICTURES FOR CIRRUS EVALUATION OF DENTS			
Resolution:	TOOK PHOTOS OF DELAMINATION, SENT TO CIRRUS. SEE DISCREPANCY 1.19 FOR RESOLUTION.				
Discrepancy:	1.8	CIRRUS SR22/T LABOR ADDITION FOR FIKI EQUIPPED MODELS			
Resolution:	NOTED				
		Hours & Rate	Time & Materials	Flat Rate	Total
Labor:			---	298.00 USD	298.00 USD
Total:			0.00 USD	298.00 USD	298.00 USD
Discrepancy:	1.9	OWNER REQUEST - EROSION TAPE ON FLAPS WORN			
Resolution:	SCRAPED OFF THE OLD ANTI CHAFE TAPE ON THE LH AND RH FLAPS, CLEANED THE SURFACES, AND APPLIED NEW 3M ANTI CHAFE TAPE 8672. ALL WORK DONE IN REFERENCE TO CIRRUS AMM CHAP 27.				
		Hours & Rate	Time & Materials	Flat Rate	Total
Labor:			---	223.50 USD	223.50 USD
Total:			0.00 USD	223.50 USD	223.50 USD
Discrepancy:	1.10	OWNER REQUEST - GAP SEALS ON AILERONS NEEDS REPLACED			
Resolution:	REMOVED AND REPLACED BOTH AILERON GAP SEAL P/N 14390-003 PER OWNER'S REQUEST IAW CIRRUS AMM 57-50				
		Hours & Rate	Time & Materials	Flat Rate	Total
Labor:		2.00 @ 149.00 USD	298.00 USD	---	298.00 USD
Parts:			44.00 USD	---	44.00 USD
Total:			342.00 USD	0.00 USD	342.00 USD
Parts:					
Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.10 #1	14390-003	GAP SEAL (WHITE)	2.00	22.00 USD	44.00 USD
Discrepancy:	1.11	OWNER REQUEST - PANEL AND REAR HEAT VENTS ARE NOT SUPPLYING WARM HEAT			
Resolution:	HEATER OPERATES ON HEATED AIR FROM EXHAUST HEAT EXCHANGER. CHECKED HOSES FOR DISCONNECTION AND BLOCKAGES AND FOUND NO ISSUES. WORK DONE I.R.T. CIRRUS SR22 MAINTENANCE MANUAL, CH. 21-40.				
		Hours & Rate	Time & Materials	Flat Rate	Total
Labor:		1.50 @ 149.00 USD	223.50 USD	---	223.50 USD
Total:			223.50 USD	0.00 USD	223.50 USD



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

February 10, 2025

Telephone: 317-769-4487

Fax:

Bill To: Redacted

WO #: 1374

Invoice Number: TYQ-INV25-00032

Discrepancy: 1.12

OWNER REQUEST - AILERON RIGGING NEEDS CHECKED, RH TRIM TAB HAS BEEN ADJUSTED TO COMPENSATE

Resolution: PERFORMED AILERON RIGGING ADJUSTMENT TO BRING AILERONS TO NEUTRAL TOLERANCE. WORK DONE I.R.T. CIRRUS SR22 MAINTENANCE MANUAL, CH. 27-10.

Labor: 2.00 @ 149.00 USD

298.00 USD

298.00 USD

Total: 298.00 USD

0.00 USD

298.00 USD

Discrepancy: 1.13

OWNER REQUEST - ALT 1 FEEDBACK PRESENT HEADSETS (ESTIMATE TROUBLESHOOTING)

Resolution: REMOVED AND REINSTALLED #1 BRUSH BLOCK ASSEMBLY P/N ALE-3045BS IAW HARTZELL CMM. GROUND RUN, NO FEEDBACK NOTED. ALT #2 OPS CHECKS GOOD.

Labor: 1.00 @ 149.00 USD

149.00 USD

149.00 USD

Total: 149.00 USD

0.00 USD

149.00 USD

Discrepancy: 1.14

OWNER REQUEST - HEADLINER IS DISPLACED AND MISSING SCREWS

Resolution: RESECURED HEADLINER WITH NEW SCREWS AND WASHERS IRW CIRRUS SR22 AMM CH 25-10

Labor: 1.00 @ 149.00 USD

149.00 USD

149.00 USD

Total: 149.00 USD

0.00 USD

149.00 USD

Discrepancy: 1.15

OWNER REQUEST - FAR 91.411/91.413 IFR RECERTIFICATION DUE.

Resolution: I CERTIFY THAT ON THIS DATE, THE ALTIMETER(S)/STATIC SYTEM(S), TRANSPONDER(S) HAVE BEEN TESTED AS REQUIRED BY AC 43.6D, FAR 43, APPENDICIE F, 91.411 AND 91.413 TO 20,000 FT. THE COMPONENTS AND SYSTEMS WERE FOUND TO BE AIRWORTHY, COMPLY WITH THE LIMITS OF THE FAR'S, AND ARE APPROVED FOR RETURN TO SERVICE. THE DATE OF THIS TEST AND THE MAXIMUM ALTITUDE OF THE TEST HAVE BEEN RECORDED ON THE ALTIMETERS.

Squawk: ---

750.00 USD

750.00 USD

Total: 0.00 USD

750.00 USD

750.00 USD

Discrepancy: 1.16

KELLY A/C ICA, DOC #NC-14-024

Resolution: COMPLIED WITH KELLY A/C ICA DOCUMENT NUMBER NC- 14-024, INSPECTED ALL ITEMS STATED ON DOCUMENT, NO DEFECTS NOTED AT THIS TIME.

Labor: 0.50 @ 149.00 USD

74.50 USD

74.50 USD

Total: 74.50 USD

0.00 USD

74.50 USD



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

February 10, 2025

Telephone: 317-769-4487

Fax:

Bill To: Redacted

WO #: 1374

Invoice Number: TYQ-INV25-00032

Discrepancy: 1.17

FAR 91.207D (1-4) ELT INSPECTION

Resolution:

COMPLIED WITH FAR 91.207D (1-4) ELT INSPECTION BATTETY EXP DATE: MAR 2033

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	0.75 @ 149.00 USD	111.75 USD	---	111.75 USD
Total:		111.75 USD	0.00 USD	111.75 USD

Discrepancy: 1.18

12 MONTH HAND FIRE EXTINGUISHER WEIGHT CHECK

Resolution:

WEIGHED FIRE EXTINGUISHER AT 535 GRAMS. WEIGHT CHECK GOOD. WORK DONE I.R.T. FIRE EXTINGUISHER MAINTENANCE MANUAL.
NEXT WEIGHT CHECK DUE DEC. 2025.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	0.25 @ 149.00 USD	37.25 USD	---	37.25 USD
Total:		37.25 USD	0.00 USD	37.25 USD

Discrepancy: 1.19

BOTTOM SIDE OF THE LEFT AND RIGHT WINGS HAVE DENTS / DELAMINATION, OUTBOARD OF THE FUEL TANKS. CIRRUS RECOMMENDS CLEARING THE PRESSURE RELIEF HOLES IN THE WING SKIN. HOLES WERE FILLED FROM THE FACTORY.

Resolution:

DRILLED PRESSURE RELIEF HOLES IRW CIRRUS SR22 WING CUFF DEPRESSION PROCEDURE PER CIRRUS ENGINEERING AND AC43.13.1B.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	1.00 @ 149.00 USD	149.00 USD	---	149.00 USD
Total:		149.00 USD	0.00 USD	149.00 USD

Discrepancy: 1.20

LH LOWER COWL T/E SEAL TORN/MISSING

Resolution:

REPLACED MISSING COWL SEAL (PN: 53722-073U) WITH NEW COWL SEAL (PN: 53722-063U) I.R.T. CIRRUS SR22 MAINTENANCE MANUAL, CH. 20-10.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	0.50 @ 149.00 USD	74.50 USD	---	74.50 USD
Parts:		13.86 USD	---	13.86 USD
Total:		88.36 USD	0.00 USD	88.36 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.20 #1	53722-063U	COWL SEAL	3.00	4.62 USD	13.86 USD



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

February 10, 2025

Telephone: 317-769-4487

Fax:

Bill To: Redacted

WO #: 1374

Invoice Number: TYQ-INV25-00032

Discrepancy: 1.21 LH MAIN TIRE WORN, RECOMMENDED.

Resolution: REMOVED WORN LH MAIN TIRE (PN: 156E66-4, SN: 72862055) AND TUBE (PN: 14076-002) AND REPLACED WITH NEW TIRE (PN: 025-501-0, SN: 4163T00004) AND TUBE (PN: 14076-002) I.R.T. CLEVELAND MAINTENANCE MANUAL, SEC. 300.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:		---	223.50 USD	223.50 USD
Parts:		546.63 USD	---	546.63 USD
Total:		546.63 USD	223.50 USD	770.13 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.21 #1	025-501-0	TIRE	1.00	363.94 USD	363.94 USD
		Serial Number(s) 4163T00004			
1.21 #2	14076-002	MLG TUBE, 15 X 6.00 X 6, TR-20 (MICHELIN)	1.00	182.69 USD	182.69 USD

Discrepancy: 1.22 LH AND RH RIGID BRAKE LINES CHAFFING ON GEAR FAIRINGS.

Resolution: CLEANED LH AND RH RIDGED BRAKE LINES AND APPLIED ANTI CHAFE TAPE. ALL WORK DONE IN REFERENCE TO CIRRUS AMM CHAP 20.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:		---	74.50 USD	74.50 USD
Total:		0.00 USD	74.50 USD	74.50 USD

Discrepancy: 1.23 PILOT KICK PLATE AIR GASPER STUCK

Resolution: REMOVED AND REPLACED PILOT'S KICK PANEL GASPER P/N 50464-002 IAW CIRRUS AMM 21-20 AND 25-10

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:		---	37.25 USD	37.25 USD
Parts:		15.75 USD	---	15.75 USD
Total:		15.75 USD	37.25 USD	53.00 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.23 #1	50464-002	2" BALL LOUVER	1.00	15.75 USD	15.75 USD



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

February 10, 2025

Telephone: 317-769-4487

Fax:

Bill To: Redacted

WO #: 1374

Invoice Number: TYQ-INV25-00032

Discrepancy: 1.24 LH LOWER RUDDER ROD END WORN

Resolution: REMOVED LH LOWER RUDDER ROD END. INSTALLED NEW LH LOWER RUDDER ROD END PN:11315-004 REF CIRRUS SR22 AMM 27-20. RUDDER DEFECTION GOOD.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	1.00 @ 149.00 USD	149.00 USD	---	149.00 USD
Parts:		60.00 USD	---	60.00 USD
Freight:		60.00 USD	---	60.00 USD
Total:		269.00 USD	0.00 USD	269.00 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.24 #1	11315-004	ROD END	1.00	60.00 USD	120.00 USD
		Freight:		60.00 USD	

Discrepancy: 1.25 LH MLG UPPER FAIRING WELL NUT MISSING (1)

Resolution: REPLACED LH MLG FAIRING WELL NUT PN: 50803-001 CIRRUS SR22 AMM 32-10.

	Hours & Rate	Time & Materials	Flat Rate	Total
Parts:		3.00 USD	---	3.00 USD
Total:		3.00 USD	0.00 USD	3.00 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.25 #1	50803-001 SHORT	WELL NUT	1.00	3.00 USD	3.00 USD

Discrepancy: 1.26 ALT AIR CABLE CHAFFING ON BRACKET

Resolution: ALT AIR CABLE READJUSTED TO PREVENT CHAFFING ON BRACKET ALL WORK DONE IRW CIRRUS SR22 AMM CH 71-60

Discrepancy: 1.27 NOSE WHEEL PANT NOSE CONE FIBERGLASS DAMAGED WITH HOLE IN IT. PERFORM FIBERGLASS REPAIR AND PAINT NOSE CONE.

Resolution: TEMP FIBERGLASS REPAIR NOSE CONE AND PAINTED REFERENCE AC 43-13-1B

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	5.00 @ 149.00 USD	745.00 USD	---	745.00 USD
Misc Charges:		139.00 USD	---	139.00 USD
Total:		884.00 USD	0.00 USD	884.00 USD

Miscellaneous Charges:

Ref. No.	Miscellaneous Charge	Amount
1.27 #1	PAINT AND CONSUMABLES	139.00 USD

Discrepancy: 1.28 AVIDYNE ICA DFC90 AP-AVDFC-030

Resolution: COMPLETED ICA'S FOR DF90 AUTOPILOT IAW ICA AVDFC-030. NO DEFECTS NOTED.

Discrepancy: 1.29 AVIDYNE ICA IFD 540/550- AVIFD-315

Resolution: COMPLETED ICA'S FOR AVIDYNE IFD 540-550 IAW ICA AVIFD-315. NO DEFECTS NOTED.



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

Telephone: 317-769-4487

February 10, 2025
Fax:

Bill To: redacted		WO #: 1374	Invoice Number: TYQ-INV25-00032		
Discrepancy:	1.30	AVIDYNE ICA AXP322-AVAXP-007			
Resolution:	COMPLETED ICA'S FOR AXP322 TRANSPONDER IAW AVIDYNE INSTALLATION MANUAL 600-00312-000. NO DEFECTS NOTED.				
Discrepancy:	1.31	AD 2024-24-11 POWER LEVER INSPECTION. FOR TRACKING PURPOSES ONLY, THIS AD IS N/A BY POWER LEVER PART NUMBER.			
Resolution:	FOR TRACKING PURPOSES ONLY, THIS AD IS N/A BY POWER LEVER PART NUMBER.				
Discrepancy:	1.32	OWNER REQUEST SB2X-27-18 RUDDER AILERON INTERCONNECT REMOVAL			
Resolution:	REMOVED RUDDER-AILERON INTERCONNECT ASSEMBLY I.A.W. CIRRUS SB2X-27-18R2.				
		Hours & Rate	Time & Materials	Flat Rate	Total
Labor:		3.00 @ 149.00 USD	447.00 USD	---	447.00 USD
Total:			447.00 USD	0.00 USD	447.00 USD
Discrepancy:	1.33	DURING IFR CERTIFICATION, STATIC LEAK BEYOND LIMITS			
Resolution:	FOUND SEVERAL LEAKS AT VARIOUS LOCATIONS INCLUDING ENCODER, ALT STATIC SUPPLY VALVE AND STATIC MANIFOLD. REPAIRED STATIC SYSTEM PER CIRRUS AMM CH 34-10, OPS AND LEAK CHECKS WITHIN LIMITS, NO OTHER DEFECTS NOTED AT THIS TIME.				
		Hours & Rate	Time & Materials	Flat Rate	Total
Labor:		3.50 @ 149.00 USD	521.50 USD	---	521.50 USD
Total:			521.50 USD	0.00 USD	521.50 USD
Discrepancy:	1.34	DURING POST RUN UP AC INOP			
Resolution:	TROUBLESHOT AC ELECTRICAL SYSTEM, FOUND POWER AT MCU, NO POWER AT REAR UNIT CIRCUT BREAKER BUS BAR, GROUND GOOD, POSSIBLE OPEN BETWEEN MCU AND REAR TREMINAL BLOCK, CUSTOMER DENIES FURTHER TROUBLESHOOTING AT THIS TIME				
Discrepancy:	1.35	DURING POST RUN UP TKS ON TAIL INOP			
Resolution:	PURGED AIR FROM ELEVATOR WING POROUS PANELS IRW CIRRUS SR22 AMM 30-00. OPS CHECK AND LEAK CHECK GOOD				
Discrepancy:	1.36	VACUUM INTERIOR			
Resolution:	VACUUMED INTERIOR AS REQUIRED				



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

February 10, 2025

Telephone: 317-769-4487

Fax:

Bill To: redacted	WO #: 1374	Invoice Number: TYQ-INV25-00032
Item: 2 ENGINE	Part/Model #: Item Serial Number: Registration Number: N913MT Aircraft Serial Number: 1597	

Discrepancy: 2.1 COMPLY WITH ENGINE 100 HOUR INSPECTION

Resolution: COMPLETED ANNUAL/100 HOUR INSPECTION IAW FAR 43 APPENDIX D REFERENCING CIRRUS SR22 AMM 5-20 ANNUAL/100 HOUR CHECKLISTS AS A GUIDE. DRAINED OIL. TOOK BLACKSTONE OIL SAMPLE HOT AT SUMP. CUT OPEN FILTER, NO METAL NOTED. INSTALLED NEW OIL FILTER AA48108-2 AND SERVICED WITH 8 QUARTS OF PHILLIPS 20W-50 X/C OIL. CLEANED FUEL SCREEN. CLEANED, GAPPED, TESTED AND INSPECTED ALL SPARK PLUGS. LUBED ALL CONTROLS AND CHECKED TRAVELS. GROUND RUN, OPS CHECKS, LEAK CHECKS OK. COMPRESSIONS: M.O 46/80 #1)71/80, #2)75/80, #3)79/80, #4)74/80, #5)79/80, #6)78/80.

	Hours & Rate	Time & Materials	Flat Rate	Total
Parts:		156.88 USD	---	156.88 USD
Misc Charges:		3.99 USD	---	3.99 USD
Total:		160.87 USD	0.00 USD	160.87 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
2.1 #1	SR22 ENGINE SERVICE KIT	SR22 ENGINE SERVICE KIT	1.00	83.76 USD	83.76 USD
2.1 #2	20W50 X/C DRUM	P66 X/C OIL 55 GALLON DRUM	8.00	9.14 USD	73.12 USD

Miscellaneous Charges:

Ref. No.	Miscellaneous Charge	Amount
2.1 #1	OIL DISPOSAL FEE	3.99 USD

Discrepancy: 2.2 OWNER REQUEST - #2 CHT PROBE INTERMITTANT

Resolution: UPON FURTHER INSPECTION, THE GROUND WIRE CONNECTION WAS LOOSE/DISCONNECTED FOR #2 CYLINDER CHT PROBE. REPLACED SPADE TERMINAL AND COMPLETED OPS CHECK IN REFERENCE TO CIRRUS SR22 AMM CH77-20 THAT PASSED

NO NEED TO REPLACE COMPONENT WITH NEW CHT PROBE

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	0.30 @ 149.00 USD	44.70 USD	---	44.70 USD
Total:		44.70 USD	0.00 USD	44.70 USD

Discrepancy: 2.3 AFT ENGINE BAFFLE NEAR MAGS RIVETS PULLED THROUGH

Resolution: REMOVED PULLED THROUGH RIVETS ON AFT ENGINE BAFFLE AND REPLACED WITH 2 AN470AD4-6 RIVETS AND 1 CR3213-4-05 CHERRY RIVET I.R.T. AC 43.13-1B, SEC. 4-57.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	0.50 @ 149.00 USD	74.50 USD	---	74.50 USD
Total:		74.50 USD	0.00 USD	74.50 USD



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

February 10, 2025

Telephone: 317-769-4487

Fax:

Bill To: redacted

WO #: 1374

Invoice Number: TYQ-INV25-00032

Discrepancy: 2.4 #2,4 AND 6 EGT AND CHT WIRES MISSING ADEL CLAMPS

Resolution: REPLACED MISSING ADEL CLAMP (PN: MS21919WDG6) WITH NEW ADEL CLAMP (PN: MS21919WDG6) SECURING #2, 4, AND 6 WIRES I.R.T. CIRRUS SR22 MAINTENANCE MANUAL, CH. 20-70.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	0.25 @ 149.00 USD	37.25 USD	---	37.25 USD
Parts:		7.20 USD	---	7.20 USD
Total:		44.45 USD	0.00 USD	44.45 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
2.4 #1	MS21919WDG6	CLAMP	3.00	2.40 USD	7.20 USD

Discrepancy: 2.5 #2 CYLINDER TOP AND BOTTOM SPARK PLUGS FAILED RESISTANCE TEST

Resolution: REPLACED #2 CYLINDER TOP AND BOTTOM SPARK PLUGS PN: URHB32E REF CONTINENTAL IO-550-N MAINTENANCE AND OVERHAUL MANUAL AND TEMPEST SPARK PLUG CMM.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	0.25 @ 149.00 USD	37.25 USD	---	37.25 USD
Parts:		90.16 USD	---	90.16 USD
Total:		127.41 USD	0.00 USD	127.41 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
2.5 #1	URHB32E	PLUGS	2.00	45.08 USD	90.16 USD

Discrepancy: 2.6 #2 CYL BAFFLE SPRING NEEDS RELOCATED

Resolution: #2 CYL BAFFLE SPRING RELOCATED IRW CIRRUS SR22 AMM CH 20

Discrepancy: 2.7 LEFT TAIL PIPE BALL JOINT LOOSE

Resolution: ADDED 3 WASHERS TO EACH BALL JOINT BOLT. WHILE ADDING WASHERS, DISCOVERED ONE BOLT WITH STRIPPED THREADS AND NUT. REMOVED STRIPPED BOLT (PN: AN3C14) AND NUT (PN: AN310C3) AND REPLACED WITH NEW BOLT (PN: AN3C14) AND NUT (PN: AN310C3). ADDING WASHERS TIGHTENED LEFT TAIL PIPE BALLJOINT AND MADE PROPER CLEARANCE BETWEEN THE TAIL PIPE AND FUSELAGE. ALL WORK DONE I.R.T. CIRRUS SR22 MAINTENANCE MANUAL, CH. 78-20.

	Hours & Rate	Time & Materials	Flat Rate	Total
Labor:	0.75 @ 149.00 USD	111.75 USD	---	111.75 USD
Parts:		10.30 USD	---	10.30 USD
Total:		122.05 USD	0.00 USD	122.05 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
2.7 #1	AN3C14	BOLT	1.00	5.98 USD	5.98 USD
2.7 #2	AN310C3	NUT (CASTELLATED)	1.00	4.32 USD	4.32 USD

Discrepancy: 2.8 PROP GOV CONTROL ROD END LOCK NUT LOOSE

Resolution: PROP GOV CONTROL ROD END LOCK NUT RESECURED IRW CIRRUS SR22 AMM CH 61-20



11329 EAST STATE ROAD 32
ZIONSVILLE, IN 46077
United States

Telephone: 317-769-4487

February 10, 2025
Fax:

Bill To: redacted		WO #: 1374		Invoice Number: TYQ-INV25-00032	
Discrepancy:		2.9 CUSTOMER REQUESTS BORESCOPE INSPECTION OF ALL CYLINDERS PER SAVVY BORESCOPE INSPECTION GUIDE.			
Resolution:		PERFORMED CYLINDER BORESCOPE INSPECTION I.R.T. SAVVY AVIATION CYLINDER BORESCOPE INSPECTION CHECKLIST (REV.1.1)			
		Hours & Rate	Time & Materials	Flat Rate	Total
Labor:		2.00 @ 149.00 USD	298.00 USD	---	298.00 USD
Total:			298.00 USD	0.00 USD	298.00 USD
Discrepancy:		2.10 IDLE MIXTURE RICH			
Resolution:		ADJUSTED IDLE MIXTURE IAW CONTINENTAL SID97-3 REV G, OPS CHECKS GOOD.			
Discrepancy:		2.11 IDLE HIGH			
Resolution:		ADJUSTED IDLE IAW CONTINENTAL SID97-3 REV G.			
Item:	3 PROP	<div>Part/Model #:</div> <div>Item Serial Number:</div> <div>Registration Number: N913MT</div> <div>Aircraft Serial Number: 1597</div>			
Discrepancy:		3.1 COMPLY WITH PROP 100 HOUR INSPECTION			
Resolution:		COMPLETED ANNUAL/100 HOUR INSPECTION IAW FAR 43 APPENDIX D REFERENCING CIRRUS SR22 AMM 5-20 ANNUAL/100 HOUR CHECKLISTS AS A GUIDE. INSPECTED BLADES, HUB SPINNER AND SPINNER BULKHEAD. GROUND RUN, OPS CHECKS, LEAK CHECKS OK.			
Discrepancy:		3.2 OWNER REQUEST - PROP GOVERNOR WILL NOT ADJUST BELOW 2600 RPM			
Resolution:		PROPELLER/ENGINE MAX RPM IS 2700 PER POH AND PROPELLER/ENGINE STATIC RPM IS AT 2660. AIRCRAFT NEEDS TEST FLOWN TO VERIFY CRUISE FLIGHT RPM.			