The Standard AIRCRAFT LOG

ASA-SA-Z

Aircraft Record General Informati	on			
Дігога				
Manufacturer CIPFUS		Model SRZO		
Serial 1661		Pogistration Number	N 468 PR	
serial MAV 7		negistration Number		
Date of Manufacture MAY 20	6			
Engine(s) currently installed:				
Manufacturer Continental	Model I	0.360-ES s	erial 360158	
Manufacturer	Model		arial	
Manufacturer	Wodel			
Propeller(s) currently installed:				
		Model PHC-33	YF-IRF	
HUB Model			,	
Blade Model	Sovial J7	7180 Sarial 77	7184 Savial 577186	
Blade Model	Serial	Seriai	Serial	



44050 Russia Road Elyria, Ohio 44035 00 440-323-7098 (FAX)

440-323-7000

A/C N468PF	₹	LIFE LIMITED PARTS		03/27/23		
PART NAME		PART NUMBER	SERIAL NUMBER	<u> </u>	<u>EXPIRES</u>	
CAPS ROCKET MO	TOR	29500-003	3851		02/2030	
CAPS PARACHUTE		25574-004-REB	03904R1		03/2030	
CAPS REEFING LINE CUTTERS		25347-002 25347-002	16044 16061		11/2025 11/2025	
AAIR CONTROLLER		508358-421	35869675		03/2027	
PILOTS SEAT INFLA	ATOR	20905-005	Z7EE231D0964		03/2030	
Co-PILOTS SEAT IN AAIR	FLATOR	20905-005	Z7EE231D0010		03/2030	
ELT BATTERIES		MN1300			7-25 (Ins)	

TOTAL	TOTAL Current Weight and B		Information	
SERVICE	Empty Weight	Empty CG	Useful Load	Remarks
		M	RKAviation	out-register
		44050 Russia Roa	<i>pany, Inc.</i> d Elvria. Ohio 440	35
	440-323-700			323-7098 (FAX)
N468PR	FLIGHT: 1	1149.6 HC	DBBS: 1469.2	DATE: 05-08-23
Replaced	d oil pressure sensor P/N 12	2033-004, ran engine- op	s and leak checks good	
James R	. Schall 3399344 IA		70 to 10	
	4405	MRK Company 0 Russia Road Elyr		
	440-323-7000		440-323-70	098 (FAX)
N468PR	TACH: 117	78.6	HOBBS: 1507.4	DATE: 06-28-23
Removed and	replaced damaged cabin	n speaker grill with nev	N	

Joseph Mourton	1	. / _		

<u>s</u>



44050 Russia Road Elyria, Ohio 44035

440-323-7000

440-323-7098 (FAX)

N468PR

YEAR

DATE

TACH: 1180.3

HOBBS: 1509.0

ACTT: 1180.3

DATE: 07-14-23

James R. Schall 3399344 IA



44050 Russia Road Elyria, Ohio 44035

440-323-7000

440-323-7098 (FAX)

N468PR

TACH: 1201.7

HOBBS: 1539.5

TTAF: 1201.7

DATE: 09-26-23

Adjusted nose gear fork tension to 23 lbs. in accordance with Cirrus SR-20 maintenance manual 32-20.-----

James R. Schall 3399344 IA

AR TE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alteratentries must be endorsed with Name, Rating and Certificate Number Technician or Repair Facility. (See back pages for other specific entors)	er of 2
	wo: WO_315	1		Airframe · page 1 of 1	
				STEEL	
		Steel	Aviation · 53 No	orth Street Ext · Phillipsburg, Ohio 45354 · 937 332 7587	
	N468PR FLIGHT: 120		HOBBS: 1	10 N W265	
	otanoa i /ii Oi	IZA GO DE	ZEE DEACK -	N SR2X panel overlays G1/2/3 - SR2X panel overlays G1/2/3, In-SR2X G3 BEZEL BLACK.	
	With respect to formed are on	o the work file with St	performed, the	his Airframe is approved for return to service. Details of work pernder work order: WO_315.	
	Echota Hende	rson A/P 4	076904		
0					
					—.

R E	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description Entries mus Technician	on of Inspect t be endorsed was r Repair Facility	ions, Tes ith Name, R . (See back	ts, Repairs and Alter Rating and Certificate Nu pages for other specific	mbe
	wo: WO_315			~			Airframe · page 1 of 1	\neg
				ST	eel ation			
		Steel	Aviation · 53 No	N	Phillipsburg, Ohio 4	5354 - 937 33	32 7587	
	N468PR FLIGHT: 12	06.0	HOBBS: 1	544.9			December 17, 2023	7
	stalled P/N SI	R2X G3 BE	ZEL BLACK	SH2X G3 BE	ZEL BLACK.		nel overlays G1/2/3, In-	
	With respect formed are or	to the worl	teel Aviation u	his Airframe is inder work ord	approved for reter: WO_315.	urn to servi	ce. Details of work per-	
	Echota Hende	erson A/P 4	1076904	A				
0			r (50	The name of the				<u>니</u>

*

YEAR

20 ___ Date



Steel Aviation · 53 North Street Ext · Phillipsburg, Ohio 45354 · 937 332 7587

N468PR CIRRUS DESIGN CORP, SR20, S/N: 1661 HOBBS: 1544.9

December 27, 2023

1. REMOVED: Removed P/N 011-00401-10 - SR2X GMA340 AUTO PANEL (SERVICEABLE) S/N: 96277462, Removed P/N 011-01060-40 - SR2X GNS 430W NAVE/COM/GPS (SERVICEABLE) S/N: 97133295, Removed P/N 011-01060-40 - SR2X GNS 430W NAVE/COM/GPS (SERVICEABLE) S/N: 97133453, Removed P/N 01192-4-53-30P - SR20 S-Teck 55X (SERVICEABLE) S/N: 0434-7288, Removed P/N 011-03300-00 - SR2X GTX335 (SERVICEABLE) S/N: 3EE021947, Removed P/N AC-30 - AC-30 MOD 9 ENCODER (SERVICEABLE) S/N: 101183, Removed P/N 15963-001 - TAWS, GA-EGPWS LRU (SERVICEABLE) S/N: 5204, Removed, Sent for Repair P/N 700-0006-000

EX5000 PFD (TO BE REPAIRED) S/N: 23721136.
INSTALLED Installed P/N 850-00218-001 - AMX 240 S/N: c02086, Installed P/N 850-00182-020 I-IFD550 S/N: M213806519, Installed P/N 850-00179-000 - IFD440 S/N: M214511265, Installed P/N 850-00170-000 - DFC90 S/N: M210794001, Installed P/N 850-00229-007 - NGT9000R S/N: LXE 15634, Installed P/N NGT9000 - NGT9000 install kit S/N: 153233, Installed P/N AVIDYNE 1 YEAR WARRANTY - AVIDYNE 1 YEAR WARRANTY, Installed P/N AVIDYNE 8.2.2 MFD UPDATE - AVIDYNE 8.2.2 MFD UPDATE, Installed P/N 28959-001 - Fan, Avionics, Cooling 3 Port Assembly S/N:

003-022056, Installed P/N AC-30 - AC-30 MOD 9 ENCODER S/N: 163026, Installed P/N AV-74 - RAM AV-74 XPONDER ANTENNA, Reinstalled P/N 700-0006-000 - EX5000 PFD (REPAIRED) S/N:

 R&R STANDBY INSTERMENTS AND INSTALL GI 275 STANDBY, RAM MOUNT & GSB15 Installed P/N 010-02326-10 - SR2X GI-275 UPGRADE KIT, Installed P/N SR2X G3 BEZEL BLACK - SR2X G3 BEZEL BLACK.

wo: WO_315



Avionics - page 2 of 2

Steel Aviation · 53 North Street Ext · Phillipsburg, Ohio 45354 · 937 332 7587

With respect to the work performed, this avionics is approved for return to service. Details of work performed are on file with Steel Aviation under work order: WO 315.

Danny Potter A/P I/A 3176242

RECORDING TACH TIME

TODAY'S **FLIGHT**

TOTAL TIME IN SERVICE Description of Inspections, Tests, Repairs and Alteration

Entries must be endorsed with Name, Rating and Certificate Number Technician or Repair Facility. (See back pages for other specific entrig



44050 Russia Road Elyria, Ohio 44035

440-323-7000

440-323-7098 (FAX)

N468PR

TACH: 1209.9

HOBBS: 1550.6

TTAF: 1209.9

DATE: 02-21-24

Customer complaint of elevated CO levels in cockpit ~20 PPM and low air flow/no heat. Inspected ventilation system. Checked and adjusted rigging of heat controls. Inspected exhaust system. Complied with AD 2008-11-18 and Cirrus SB 2X-78-07 by pressure testing exhaust heat exchanger on RH exhaust. No defects noted. Next inspection due at ACTT 1309.9. Found loose exhaust clamp on LH tailpipe. Resecured clamp and made faying seals on belly panels inline with exhaust. While inspecting exhaust, also found crack on NLG strut weldment exceeded limits in Cirrus SB 2X-32-18. Complied with terminating action of SB 2X-32-18 by removing and replacing NLG strut with new improved unit, new bushings, and bellville washers. No further action required. Flight test needed to ops check ventilation / CO issues.

NLG Strut PN OFF: 11907-005, SN OFF: 4094 / NLG Strut PN ON: 11907-008, SN ON: 20-4975-

Joseph Mourton A&P3682899 4

	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Entries must I	oe endorsed with	ons, Tests, Repairs and Cert on Name, Rating and Cert of See back pages for other	tificate Number of
- - -		440-	4405 323-7000	MRI Compai 60 Russia Road El	yria, Ohio 44035	-7098 (FAX)	
	N468PR	TACH	l: 1226.0	HOBBS: 1570.5	TSN: 1226.0	DATE: 04-25-24	
_		•					
_	Benjamin Do	ougher A&P 48	345863 <u>Den</u>	jamin Par	gher-		
	Benjamin Do	ougher A&P 48	345863 <u>Din</u>	janum Par	ghez-		
	Benjamin Do	ougher A&P 48	345863 <u>Den</u>	jamin Par	ghez-		
	Benjamin Do	ougher A&P 48	345863 <u>Den</u>	jamin Par	ghez-		
	Benjamin Do	ougher A&P 48	345863 <u>Din</u>	jamin Par	ghez-		
	Benjamin Do	ougher A&P 48	345863 <u>Din</u>	Amin Par	gher_		
	Benjamin Do	ougher A&P 48	345863 <u>Din</u>	Emin Par	<u>ghes</u>		
	Benjamin Do	ougher A&P 48	345863 <u>Din</u>	jamin Par	<u>gher</u>		

YEAR 20 Date	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description Entries must be Technician or F	of Inspections e endorsed with N Repair Facility. (<i>Se</i>	s, Tests, Repairs and A lame, Rating and Certificate ee back pages for other spe	Alteration of the Number ecific entri
				, response and the state of the			
			The state of the s	Compa	KAviation nv. Inc.		_
			440	50 Russia Road El			
		440)-323-7000		The second of th	7098 (FAX)	
	N468PR	TAC	CH: 1242.9	HOBB\$: 1592.9	ACTT: 1242.9	DATE: 07-03-24	_
						"D". AD researched through	
	2X-78-07	R1, next dι	ue 1342.9. Rep	placed left exhaust t	ailpipe P/N 20556-0	st in accordance with SB 02 and clamps P/N 20553- uction air filter P/N BA-24.	_
	Replaced	left fuel qu	antity sending	unit P/N 12638-001	1 and calibrated in a	ccordance with Cirrus SR- Replaced left main tire P/N	_
	072-449-0	0 and rotate	ed right main ti	re on wheel for eve	n wear. Removed A	CK ELT E-01 S/N 055513 th FAR 91.207(d), ELT	_
	battery du	ue Feb 2029	9, Remote / Ale	erter batteries due .	JUN 2034. I certify th	hat this aircraft has been an airworthy condition	_
						-	_
	James R.	Schall 339	9344 IA	16			
	T						

AR 	RECORDING TACH TIME	TODAY'S FLIGHT	I TIME IN LE	Description of Insp Entries must be endorse Technician or Repair Fa	ed with Name. Ratin	and Certificate N	Vium
			-				
				MRKAV Company, In			
			440!	50 Russia Road Elyria, (· ·
			440-323-7000	,	440-323-7098 (FA	AX)	
	N468I	PR	TACH: 1249.5	HOBBS: 1601.8	ACTT: 1249.5	DATE: 07-29-24	
	by A Emp	ir Dallas Ins ity in LH and	struments WO# 170 od RH wings with ur	fuel gauge with repaired un 685. <mark>PN: FQ4030-12034 S</mark> nusable fuel in tanks. Calib	nit from Power Packs I <mark>SN OFF: 0675, SN ON</mark> orated Full in LH and R	I: 0393. Calibrated RH wings with tanks	
	by A Emp toppe temp walk	ir Dallas Instity in LH and ed off. Troub control call wing grip.	struments WO# 170 ad RH wings with ur ubleshot customer of ables to allow fresh Removed RH wing	fuel gauge with repaired up 685. <mark>PN: FQ4030-12034 S</mark>	nit from Power Packs I SN OFF: 0675, SN ON orated Full in LH and R oming from air vents. A c. Customer request re LH cut replacements. I	Plus. Repair done 1: 0393. Calibrated RH wings with tanks Adjusted slack in placement of wing RH wing grip on	
	by A Emp toppe temp walk orde	ir Dallas Instity in LH and ed off. Troub control call wing grip.	struments WO# 176 ad RH wings with ur ubleshot customer of ables to allow fresh Removed RH wing leak checks satisfa	fuel gauge with repaired up 685. PN: FQ4030-12034 So nusable fuel in tanks. Calib complaint of hot air only co air vent valve to open fully g grip. Cirrus has sent two	nit from Power Packs I SN OFF: 0675, SN ON orated Full in LH and R oming from air vents. A c. Customer request re LH cut replacements. I	Plus. Repair done 1: 0393. Calibrated RH wings with tanks Adjusted slack in placement of wing RH wing grip on	
	by A Emp toppe temp walk orde	ir Dallas Instity in LH and ed off. Troub control call wing grip. er. Ops and	struments WO# 176 ad RH wings with ur ubleshot customer of ables to allow fresh Removed RH wing leak checks satisfa	fuel gauge with repaired up 685. PN: FQ4030-12034 So nusable fuel in tanks. Calib complaint of hot air only co air vent valve to open fully g grip. Cirrus has sent two	nit from Power Packs I SN OFF: 0675, SN ON orated Full in LH and R oming from air vents. A c. Customer request re LH cut replacements. I	Plus. Repair done 1: 0393. Calibrated RH wings with tanks Adjusted slack in placement of wing RH wing grip on	
	by A Emp toppe temp walk orde	ir Dallas Instity in LH and ed off. Troub control call wing grip. er. Ops and	struments WO# 176 ad RH wings with ur ubleshot customer of ables to allow fresh Removed RH wing leak checks satisfa	fuel gauge with repaired up 685. PN: FQ4030-12034 So nusable fuel in tanks. Calib complaint of hot air only co air vent valve to open fully g grip. Cirrus has sent two	nit from Power Packs I SN OFF: 0675, SN ON orated Full in LH and R oming from air vents. A c. Customer request re LH cut replacements. I	Plus. Repair done 1: 0393. Calibrated RH wings with tanks Adjusted slack in placement of wing RH wing grip on	
	by A Emp toppe temp walk orde	ir Dallas Instity in LH and ed off. Troub control call wing grip. er. Ops and	struments WO# 176 ad RH wings with ur ubleshot customer of ables to allow fresh Removed RH wing leak checks satisfa	fuel gauge with repaired up 685. PN: FQ4030-12034 So nusable fuel in tanks. Calib complaint of hot air only co air vent valve to open fully g grip. Cirrus has sent two	nit from Power Packs I SN OFF: 0675, SN ON orated Full in LH and R oming from air vents. A c. Customer request re LH cut replacements. I	Plus. Repair done 1: 0393. Calibrated RH wings with tanks Adjusted slack in placement of wing RH wing grip on	
	by A Emp toppe temp walk orde	ir Dallas Instity in LH and ed off. Troub control call wing grip. er. Ops and	struments WO# 176 ad RH wings with ur ubleshot customer of ables to allow fresh Removed RH wing leak checks satisfa	fuel gauge with repaired up 685. PN: FQ4030-12034 So nusable fuel in tanks. Calib complaint of hot air only co air vent valve to open fully g grip. Cirrus has sent two	nit from Power Packs I SN OFF: 0675, SN ON orated Full in LH and R oming from air vents. A c. Customer request re LH cut replacements. I	Plus. Repair done 1: 0393. Calibrated RH wings with tanks Adjusted slack in placement of wing RH wing grip on	
	by A Emp toppe temp walk orde	ir Dallas Instity in LH and ed off. Troub control call wing grip. er. Ops and	struments WO# 176 ad RH wings with ur ubleshot customer of ables to allow fresh Removed RH wing leak checks satisfa	fuel gauge with repaired up 685. PN: FQ4030-12034 So nusable fuel in tanks. Calib complaint of hot air only co air vent valve to open fully g grip. Cirrus has sent two	nit from Power Packs I SN OFF: 0675, SN ON orated Full in LH and R oming from air vents. A c. Customer request re LH cut replacements. I	Plus. Repair done 1: 0393. Calibrated RH wings with tanks Adjusted slack in placement of wing RH wing grip on	

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL E TOTAL SERVICE	Description of Insp Intries must be endorse echnician or Repair Fa	Dections, Tests, I ed with Name, Ratin acility. (<i>See</i> back pag	Repairs and Alterage and Certificate Num ges for other specific e
			Edgi.	MRKAV	iation	
			4405	Company, In		
			440-323-7000	i0 Russia Road Elyria, (unio 44035 440-323-7098 (FA	X)
	N468	BPR	TACH: 1252.2	HOBBS: 1606.2	ACTT: 1252.2	DATE: 08-05-24
	Assi	Grip PN: 126 ist Step Grip oh Mourton A&I	PN: 12683-006	wan		
	8					
	1					