

AIRCRAFT TECHNICAL RECORD

Section 1. AIRFRAME LOG

STEEL 
AVIATION

IF YOU DECIDE TO
SELL YOUR AIRCRAFT,
CALL US FIRST!

WWW.STEELAVIATION.COM

937-332-7587

*Aero*TRANSPORT® 

www.aerotransport.com

R6.00C

STEEL AVIATION

PRIMER Metal- CM0483712

PRIMER Composite- CM0481030

COLOR Acc. Black Peral-SGP06693

COLOR Silver- CM0855660

COLOR Athens Blue- SGP200007

COLOR Charcoal 8parts SGP06693 and 1part CM085560

CLEAR CM0850CC1



SHERWIN-WILLIAMS
Aerospace Coatings

SKYscapes

WWW.STEELAVIATION.COM

Copyright © AeroTRANSPORT® Publications MMX

ISBN 978-0-920406-40-3

Made in Canada

www.aerotransport.com

LIFE LIMITED ITEMS

Date: 12/11/2022
Reg: N444JH
Make: Cirrus
Hobbs: 3652.3

STEEL AVIATION

S/N: 4376
Model: SR22
Tach: 3055.4

PART NAME	PART #	SERIAL #	MFR DATE	EXPIRATION
PARACHUTE	29696-004	0792-LW	6/2016	6/2026
ROCKET MOTOR	29500-004	0971	6/2016	6/2026
LINE CUTTERS	25347-003	8348/8321	2/2022	2/2028
CAPS BATTERY	N/A	N/A	N/A	N/A
ELT BATTERY	452-6504-1	396885-004		12/2028
EMA CONTROLLER	20902-001	A27ADR16-118	4/2016	4/2023
SEATBELT INFLATORS	20902-005	See Entry	4/2016	4/2026
OXYGEN BOTTLE	N/A	N/A	N/A	N/A

WWW.STEELAVIATION.COM

AIRCRAFT DATA

1. Nationality & Registration

N 444JH

2. Manufacturer's Designation
(Make & Model)

Cirrus SR22

3. Manufacturer's Serial
Number

4376

4. Type Approval or
Specification Number

5. Date of Manufacture

6. Aircraft Inspection Cycle



Section 1: Airframe Log

DATE / /	AIR TIME				LANDINGS / CYCLES		DETAILS OF TASK (INSPECTION, REPAIRS & REPLACEMENT)
	DAILY TOTAL		TOTAL		DAILY TOTAL	TOTAL	
	HRS	MIN	HOURS	MIN			
CARRIED FORWARD							

MAKE: Cirrus
MODEL: SR-22
S/N: 4376
REG NO: N444JH
WORK ORDER:
33592-11-2022



First Flight Aviation

10600 Springboro Pike
Miamisburg, Ohio 45342 USA
Phone: 937-885-5580

DATE: 11/17/2022
A/C TSN:
FLIGHTTIME:
3055.4

Airframe Entries

(2) Replaced CAPS Reefing Line Cutters with new kit p/n 25347-003 s/n 8348/8321 Mfg date 09/2022. Due again 2/2028

Maintenance Release

The aircraft and/or component(s) on N444JH was repaired and inspected in accordance with current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service with respect to the work performed. Pertinent details of the repair are on file at this repair station under Work Order No. 33592-11-2022.

DATE: 11/17/2022

SIGNED:

Ponder, Ryan, A&P: 4518586

Work Order: 33592-11-2022

Printed by EBis 3 (datcomedia.com)

wo: LUK145-22462

Airframe - page 1 of 1



Airtech of Ohio, LLC. · 4765 Airport Rd · CINCINNATI, Ohio 45226 · CRS#: 5A8R960B

N444JH

CIRRUS DESIGN CORP, SR22, S/N: 4376

November 17, 2022

FLIGHT HOURS:
3055.4

HOBBS: 3652.3

1. Complied with 24-Month 91.411 and 91.413 Inspections to 20,000ft in accordance with FAR 43 Appendix E and F. No discrepancies noted at this time.

With respect to the work performed, this airframe is approved for return to service. Details of work performed are on file with Airtech of Ohio, LLC. under work order: LUK145-22462.

Craig Harbeson CRS# 5A8R960B

PAGE
TOTALS

CARRY FORWARD to Top of Next Page

NAME/
SIGNATURELICENCE:
AME or
AMO/ACA

wo: WO_122 N444JH Paint and Interior

Airframe - page 1 of 2



Steel Aviation, Inc. · 53 North Street Ext · Phillipsburg, Ohio 45354 · 937 332 7587

N444JH

HOBBS: 3652.3

Cirrus, SR22, S/N: 4376

TACH: 3055.4

December 01, 2022

1. Removed all flight controls, covers, inspection panels, and decals.
2. Stripped all flight controls using PR-2002, neutralized using ALK-600, cleaned and water break tested, Etched, Alodine, and epoxy primed.
3. Prepared flight controls and airframe for paint I/A/W Cirrus AMM 51-20.
4. Painted airframe and flight controls I/A/W Cirrus AMM 51-20 using materials from Cirrus AMM 51-30.
5. Checked all the flight controls are within balance limits.
6. Reinstalled all flight controls, covers and inspection panels, window sealant, wing walk, gap seals and decals.
7. C/W 4 Color- complex paint scheme. See paint code log sticker.
8. R&R Interior after recovering at SCS interiors under order number 53360. Installed P/N 37209-001 - BEZEL, SWITCH, LIGHT, Installed P/N SAUIK001 - ULTIMATE INTERIOR KIT, Installed P/N 34652-001U - Door Seal, Installed P/N 37248-001 - Interior, Dome Lighting, Switch Assembly, Installed P/N SA-28001 - FUEL SELECTOR KNOB, ANODIZED RED, Installed P/N 11253-002 - Mixture Lever Knob- Scrc Cntrl Dwg, Installed P/N 15062-001 - LANYARD PIVOT POINT, Installed P/N 24642-004 - Flap panel overlay.
9. R&R cup holders with PF VMI cup holders Installed (4) P/N SA-00001 - CUP HOLDER WITH CUP, TWIST LOCK, FOLDING.
10. Buffed all antennas installed after paint.
11. R&R waas/gps antenna and Com #1 antenna Reinstalled P/N P/N 013-00245-00 and com 1 antenna P/N AV-10 - WAAS / GPS ANNTENA.
12. Replaced top L/H door hinge assembly Installed P/N 21845-002 - Hinge Assy, Cabin Door.

wo: WO_122 N444JH Paint and Interior

Airframe - page 2 of 2



Steel Aviation, Inc. · 53 North Street Ext · Phillipsburg, Ohio 45354 · 937 332 7587

13. Replaced ball end, piston end fitting and nut cap Installed P/N 19030-001 - DOOR STRUT NUT CAP, BLACK ALUM. W/ BASE, Installed P/N 50567-001 - Ball-End, Installed P/N 18200-102 - Metal End Fitting, Cabin Door Strut.
14. Changed registration number from N305KD to owner supplied registration N444JH.

With respect to the work performed, this Airframe is approved for return to service. Details of work performed are on file with Steel Aviation, Inc. under work order: WO_122 N444JH Paint and Interior.

Echota Henderson A/P 4076904

end

Section 1: Airframe Log

DATE / /	AIR TIME				LANDINGS / CYCLES		DETAILS OF TASK (INSPECTION, REPAIRS & REPLACEMENT)
	DAILY TOTAL		TOTAL		DAILY TOTAL	TOTAL	
	HRS	MIN	HOURS	MIN			
CARRIED FORWARD							

wo: WO_57 N444JH Airframe/Annual

Airframe - page 1 of 2



Steel Aviation, Inc. · 53 North Street Ext · Phillipsburg, Ohio 45354 · 937 332 7587

N444JH
HOBBS: 3652.3

Cirrus, SR22, S/N: 4376
TACH: 3055.4

December 01, 2022

1. Replaced exhaust spring mount brackets with new. Installed P/N 20155-010 - Bracket, Exhaust, Aft Outboard, Left, Installed P/N 20155-009 - Bracket, Exhaust, Aft Outboard, Right, Installed P/N 29200-001 - Exhaust Mount, LH, Installed P/N 29200-002 - Exhaust Mount, RH.
2. Removed, inspected, refinished, and re-installed NLG. Replaced all bushings and worn parts with new. Installed (4) P/N 18645-002 - Nose Landing Gear, Installed (2) P/N NAS75-8-008 - Bushing, Installed (4) P/N 18646-001 - Nose Landing Gear, Installed P/N 26960-104 - Hinge Tab, Installed (4) P/N 18645-002 - Nose Landing Gear, Installed (2) P/N AN8-15 - Bolt, OLEO STRUT, Installed (2) P/N 19300-001 - Nose Landing Gear, Shouldered, Installed P/N AN970-8 - Washer, Installed P/N 50545-001 - NLG, THRUST WASHER, Teflon Coated, Installed (3) P/N 51853-001 - Belleville, Installed P/N MS17825-8 - Nut, Installed (2) P/N 11869-002 - TOWBAR LUG, Installed P/N AN6-72 - BOLT, NLG, AXLE, Installed (2) P/N 11799-004D - NLG WHEEL PANT BRACKET, Installed P/N AN6-72 - BOLT, NLG, AXLE, Installed P/N 27057-002 - Oleo Strut, Nose Landing Gear S/N: 0822-7, Installed P/N 31491-002 - AXLE, Nose Landing Gear, Beringer.
3. Replaced NLG wheel pant assy and NLG leg fairing with new Installed P/N 31782-006 - Nose wheel pant assy., Installed P/N 26607-001 - Fairing Assy. Strut NLG, Primed Only S/N: CIR-90538.
4. Removed and installed MCU 140 with new: Installed P/N 19800-004 - Factory-New, w/CAPS Ignition Mod S/N: 06955 Rev/Lot: 794187.
5. C/W 10Yr brake inspection: Replaced brake pads, disks, seals, pistons, hardware, and overtemp indicators. Bled brakes. Installed (6) P/N VIS-006, 31392-104 - CAP SCREW, Beringer, Back Plate to Caliper Mount, Installed (4) P/N 31392-107 - SEAL, Beringer, Caliper Piston, Installed (4) P/N HYD-005B, 31490-007 - COPPER GASKET, BERINGER, Installed (4) P/N PSE-004, 31392-103 - CALIPER PISTON, Beringer.
6. Replaced LH and RH inner wheel halves with new. Installed (2) P/N JAI-012(B) - INNER WHEEL HALF, Beringer, Installed (16) P/N V-CHC-004 - WHEEL TIE BOLTS, Beringer, Installed (48) P/N CLP-001 - WEAR

wo: WO_57 N444JH Airframe/Annual

Airframe - page 2 of 2



Steel Aviation, Inc. · 53 North Street Ext · Phillipsburg, Ohio 45354 · 937 332 7587

- CLIP, ROTOR TO WHEEL, BERINGER.
7. Replaced NLG wheel bearings with new. Installed P/N B-BE-001 - BEARING, SEALED, BERINGER NLG, Installed P/N B-BE-002 - BEARING, SEALED, BERINGER NLG.
 8. R&R MLG & NLG TIRES. Installed (2) P/N 156E06-1 - 15.00x6.00-6 tubeless tire 10PLY, Beringer, Installed P/N 12020-004 - NLG Tire, 5.00 X 5, Goodyear Flight Eagle LT, Tubeless, 505T08-1.
 9. R&R ELT battery with new. Expires Dec. 2028 Installed P/N 452-6504-1 - BATTERY, ELT 1000 S/N: 396885-004.
 10. Replaced Batt #1 with new and new electrical covers. Installed (2) P/N MS25171-4S - NIPPLE, Installed P/N RG24-15M - MAIN BATTERY, CONCORD, 24V S/N: 41246389.
 11. Replaced Batt #2 with new. Replacement due 11/2024 or Hobbs 4152.3 hrs. Installed (2) P/N NP7-12T, cirrus - BATT #2.
 12. Replaced landing light with New Boom Beam landing light assy. IAW with Whelen installation instructions LSM-500-082. See form 337 dated 12/6/2022. Installed P/N 17298-001 - Lens, Landing Light, Installed P/N LSM-500-082-19 - Landing Light, 85W, Rectangular, Boom Beam.

With respect to the work performed, this Airframe is approved for return to service. Details of work performed are on file with Steel Aviation, Inc. under work order: WO_57 N444JH Airframe/Annual.

Brad Helman A&P 3939968

PAGE TOTALS

CARRY FORWARD to Top of Next Page

wo: WO_57 N444JH Airframe/Annual

Airframe - page 1 of 1



Steel Aviation, Inc. - 53 North Street Ext - Phillipsburg, Ohio 45354 - 937 332 7587

 LICENCE:
 A ME or
 MO/ACA

N444JH

HOBBS: 3652.3

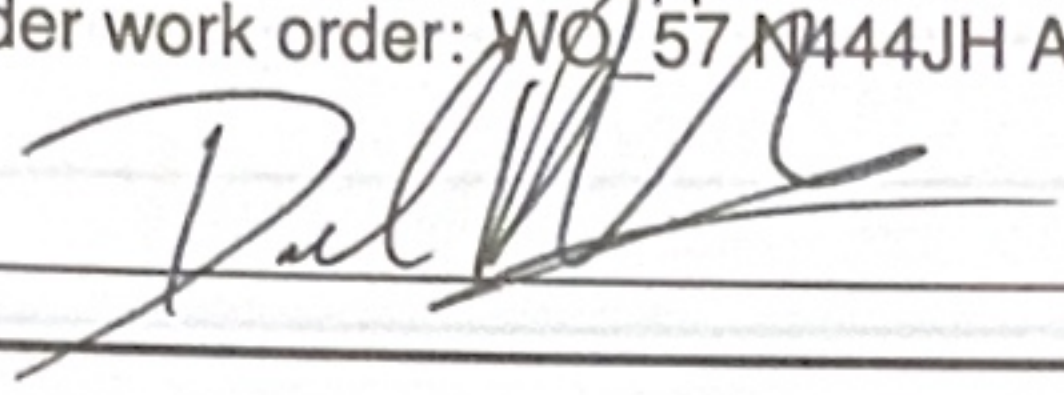
Cirrus, SR22, S/N: 4376

December 01, 2022

TACH: 3055.4

1. Line Cutters c/w 11/17/2022 by First Flight Aviation due again 2/2028 see separate log entry.
2. C/W 91.411 & 91.413 IFR cert from Airtech of Ohio see separate log entry.
3. C/W MSB SB2X-42-19 v0764.38 update.
4. R&R GARMIN PFD, MFD, GFC700, AUDIO PANEL, SENT TO AIRTECHMX. PO_21951 Reinstalled P/N 011-02385-40 - GMA 250C AUDIO PANEL (REPAIRED) S/N: 1UF201010, Reinstalled P/N 011-01737-20 - GMA 705 AUTO PILOT CONTROLLER (REPAIRED) S/N: 1730006809, Reinstalled P/N 011-01757-00 - GMC 478 FMS CONTROLLER (REPAIRED) S/N: 193007114, Reinstalled P/N 011-01440-20 - GDU 1240A MFD (REPAIRED) S/N: 14W006954, Reinstalled P/N 011-01440-30 - GDU 1240A PFD (REPAIRED) S/N: 14Y006915.

With respect to the work performed, this Airframe is approved for return to service. Details of work performed are on file with Steel Aviation, Inc. under work order: WO_57 N444JH Airframe/Annual.

 Danny Potter A/P I/A 3176242
 

wo: WO_57 N444JH Airframe/Annual

Airframe - page 1 of 1



Steel Aviation, Inc. - 53 North Street Ext - Phillipsburg, Ohio 45354 - 937 332 7587

N444JH

HOBBS: 3652.3

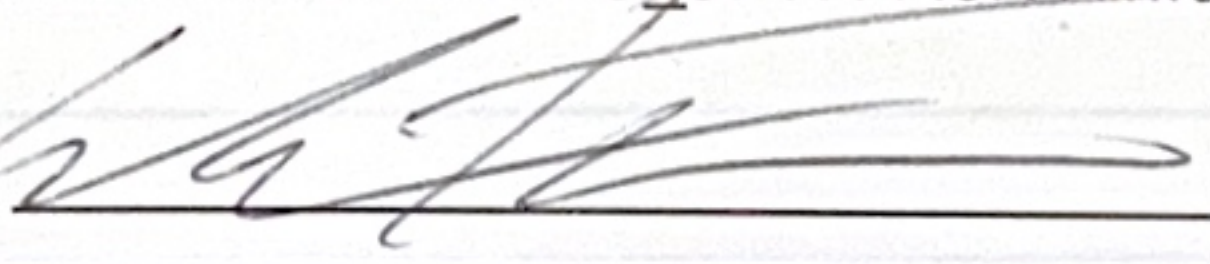
Cirrus, SR22, S/N: 4376

December 01, 2022

TACH: 3055.4

1. Rebonded debonded windows. Installed P/N 25036-001 - AC-251 B 1/2, Black, 3.5oz.
2. Replaced wing tip taxi lights Installed P/N 17385-001 - Recognition Light Lens, LH, Installed P/N 17385-002 - Recognition Light Lens, RH.
3. R&R pitch trim rod end. Installed P/N 11314-003 - Rod End, Female.
4. C/W AD 93-05-06 by installing new ignition. New key number 196. Installed P/N 19537-001, A-510-2 - Ignition Switch, 5-Position, Double Sided Key.
5. Replaced oil door latch Installed P/N 50701-003 - OIL DOOR LATCH.
6. Replaced pitch trim motor with overhauled unit S/N 1230 Installed P/N 11797-006 - MOTOR (OVERHAULED).
7. GSB 15 type A/type C power input: Installed P/N 010-02544-21 - Garmin GSB 15 type a&c S/N: 63M252010, Installed P/N 7277-2-5 - Klaxon circuit breaker 5 amp.

With respect to the work performed, this Airframe is approved for return to service. Details of work performed are on file with Steel Aviation, Inc. under work order: WO_57 N444JH Airframe/Annual.

 Echota Henderson A/P 4076904
 

wo: WO_57 N444JH Airframe/Annual

Airframe Annual - page 1 of 1



Steel Aviation, Inc. - 53 North Street Ext - Phillipsburg, Ohio 45354 - 937 332 7587

N444JH

HOBBS: 3652.3

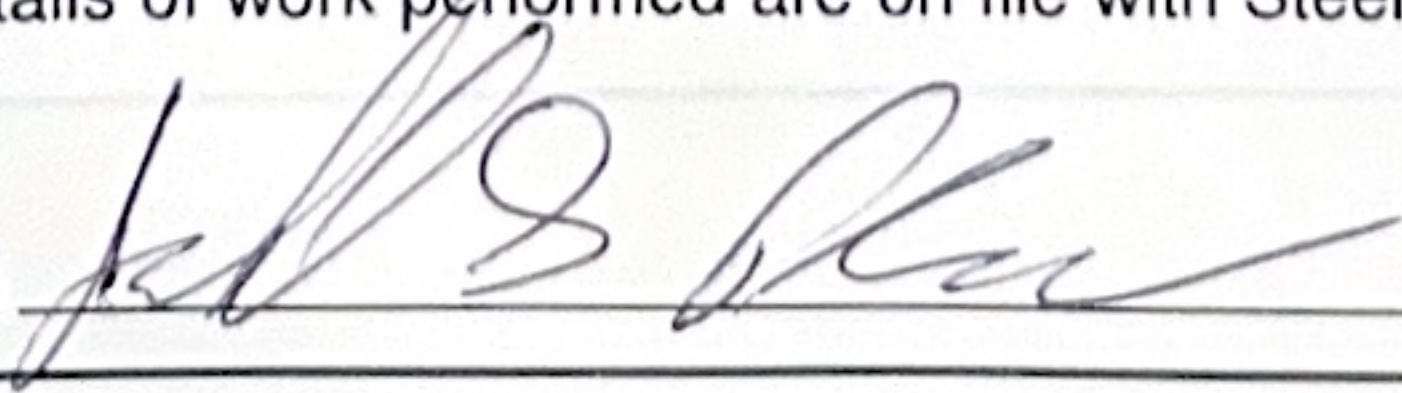
Cirrus, S/N: 4376

December 01, 2022

TACH: 3055.4

1. C/W Annual Inspection in accordance with FAR 43 Appendix D - using Cirrus AMM as a guide.
2. C/W ELT Inspection IAW FAR 91.207(D).
3. ELT Battery Due. 12/2028.
4. Airworthiness Directives Due: C/W AD 93-05-06 Ignition switch by replacement. Due again in 2000 hours @ 5055.4 tach.

I certify that this AIRFRAME has been inspected in accordance with an (annual) inspection and was determined to be in airworthy condition. Details of work performed are on file with Steel Aviation, Inc. under work order: WO_57 N444JH Airframe/Annual.

 Jeff Pleiman A/P I/A 3304319
 

[illegible]

PAGE
TOTALS

CARRY FORWARD to Top of Next Page

MAKE Cirrus Design Corp
MODEL Sr22
S/N 4376
REG NO N444JH
WORK ORDER
KTKI3303-01-2024



Cirrus McKinney Service Center

Repair Station No. CDCR140E
1500 Industrial Blvd.
Hangar #19
McKinney, TX 75069
Phone 469 215 4452

DATE 2/7/2024
A/C TSN 3354 5
HOBBS 4010 2

NAME/
SIGNATURE

LICENCE:
AME or
MO/ACA

Airframe Entries

- (2) Performed annual inspection of this aircraft IAW SR22 AMM Chapter 05-20 inspection checklist.
- (5) Performed research of the aircraft logbooks for applicable Airworthiness Directives through bi-weekly 2024-01.
- (6) Performed research of the aircraft records for any mandatory service bulletins that are due.
- (13) Inspected and weighed the fire extinguisher IAW SR22 AMM 26-20. Recorded weight: 2.5 lbs.
- (14) Complied with inspection of the ELT in accordance with 91.207(d). Battery due date: 12/1/2028.
- (18) Tie down rings painted to match customer requested color and finish IAW SR22 AMM 51-20.
- (22) Secured main vent duct to evaporator IAW SR22 AMM 21-20. Ops check good.
- (23) Replaced static wick on horizontal stabilizer IAW AMM Ch.23-60.
- (28) Repaired front R/H baffling IAW AC43.13-1B.
- (29) Replaced worn LH and RH MLG brake pads with new pads P/N 31392-105 and conditioned brake pads IAW Cirrus SR22 AMM 32-42. Ops check good.
- (30) Removed and replaced drain manifold IAW SR22 AMM 71-70.
- (31) Resealed LH belly fire shield IAW SR22 AMM 53-30.
- (32) Installed new condenser blower exhaust duct. Ops checked performed and found satisfactory. Work completed IAW SR22 AMM 21-50.
- (33) Resealed all lower antennas IAW SR22 AMM 20-10.
- (34) Resealed baggage compartment window IAW SR22T AMM 56-20 & 56-30.
- (36) Applied chafe tape to both flaps. Work completed IAW SR22 AMM 57-50.
- (37) Installed new baggage compartment edge plate well nuts IAW SR22 AMM Ch.25-10.
- (38) Installed Alternator #2 mounting hardware in correct orientation IAW SR22 24-30.
- (39) Secured RH MLG Grommet. Work completed IAW SR22 AMM 32-10.
- (40) Installed new LH and RH MLG tires P/N:14075-010 IAW SR22 AMM 32-41.
- (41) Removed pitch trim motor, tightened screws on mount plate & installed pitch trim motor IAW SR22 AMM 27-30. Pitch trim travels and ops check good.
- (42) Installed new fire extinguisher P/N:12533-004 S/N: H-27919063 IAW SR22 AMM 26-20.
- (43) Replaced velcro on CAPS handle cover IAW SR22 AMM 11-30.
- (44) Removed seals on top cowl RH, and LH lower cowls and installed new P/N 53722-063U IAW SR22 AMM 71-10 and 20-10.
- (45) Replaced ELT P/N: 33940-001 S/N: 251-08206 with new ELT S/N: 323-07423 IAW SR22 AMM 25-60. Next ELT battery expiration: Jan 2030. Ops check good. **41246389 205/10/25**
- (47) Replace battery 1 P/N: RG24-15M SN:41366507 with new Battery S/N:41366507 IAW SR22 AMM 24-30. Ops check good.
- (48) Stop drilled crack in front right baffle IAW AC 43.13.
- (50) Installed new CO detector P/N:24660-004 IAW SR22 AMM 31-20.
- (51) Performed magnetometer calibration IAW Garmin Perspective Line Service Maintenance Manual Ch. 7.2.3.4. Next magnetometer calibration due: 01/2026.
- (52) Performed 2 year GSM 86 Servo Clutch Test IAW SR22 AMM 22-12.
- (53) Completed SB2X-25-30 Crew seat back break-over adjustment inspection and adjusted as required. Work completed IAW SB2X-25-30 and SR22 AMM 25-10.
- (54) Complied with SB2X32-25 by inspecting oleo strut production number for effectivity. Oleo strut is not in the affected production number range SN: 0622-36.
- (55) Complied with SB2X-95-30 CAPS Installation and Correction.
- (56) Replaced L/H and R/H cabin door struts P/N 18200-005 IAW SR22 AMM 52-10.
- (58) Replaced nose gear fairing bulb seal IAW SR22 AMM 32-20.
- (60) Performed fuel calibration of RH fuel tank IAW SR22 AMM 28-40.
- (61) Adjusted wiring at Amsafe test port and installed new EMA controller P/N 20902-001, S/N A26APR23-64 IAW SR22 AMM 25-10. Amsafe tests good.
- (62) I certify that this aircraft has been inspected IAW an annual inspection and was determined to be in an airworthy condition.

I have reviewed the file on this aircraft and the accompanying discrepancy forms. The aircraft, airframe, aircraft engine, propeller or appliance identified was repaired/inspected in accordance with current requirements of the Federal Aviation Administration and is approved for return to service. Pertinent details of this work order are on file at this Certified Repair Station CRS# CDCR140E

DATE: 2/7/2024

SIGNED:

Alex Coats
Certified Repair Station No. CDCR140E

Work Order: KTKI3303-01-2024

Printed by EBis 3 (datcomedia.com)

Section 1: Airframe Log

DATE / /	AIR TIME				LANDINGS / CYCLES		DETAILS OF TASK (INSPECTION, REPAIRS & REPLACEMENT)
	DAILY TOTAL		TOTAL		DAILY TOTAL	TOTAL	
	HRS	MIN	HOURS	MIN			
CARRIED FORWARD							

wo: WO_478



Airframe - page 1 of 1

Steel Aviation · 53 North Street Ext · Phillipsburg, Ohio 45354 · 937 332 7587

N444JH

HOBBS: 4047.6

Cirrus, SR22, S/N: 4376

TACH: 3384.9

April 26, 2024

1. Affixed engine heater wire to front L/H baffle.
2. Installed friction screw into copilot sun visor Installed P/N 99-701 - Rosen Repair Kit, Knob, Spring & Washer.
3. Replaced stone guard on R/H wingtip.
4. Secured LH belly heat shield.
5. Touched up black trim paint along windshield.
6. R&R: Removed P/N 29301-001 - GPS2/Iridium Antenna (QUARANTINE) S/N: 33879, Installed P/N 29301-001 - GPS2/Iridium Antenna S/N: 11501.
7. Cleaned sealant stain on headliner near rear window.
8. Inspected all seatbelts for proper operation.
9. R/R CAPS placard velcro pads.
10. Replaced glareshield screw cap panel Installed P/N 29545-002 - Screw Cap, Black.
11. Replaced oxidized interior screws.
12. Applied RTV to superficial nick on alt air scat tube.
13. Applied RTV to oil heater wire.
14. Replaced the landing light bulb with new part number LSM-SCD-009-1. Replaced landing light wire harness with serviceable unit.

With respect to the work performed, this Airframe is approved for return to service. Details of work performed are on file with Steel Aviation under work order: WO_478.

Echota Henderson A/P 4076904



Lore Aviation Services LLC

Date: 5/23/2024
500 Airport BLVD Hangar 1
Lake Charles, LA 70607
Phone: (337)912-4496

Airframe

N444JH

Hobbs: 4058.8

Tach: 3394.7

Installed owner supplied nose wheel fairing. Installed new landing light wire (PN:LMS-SCO-008-12W)

END

Christopher Lore

A&P

3458101



Lore Aviation Services LLC

Date: 3/9/2025
500 Airport BLVD Hangar 1
Lake Charles, LA 70607
Phone: (337) 912-4496

Airframe

N444JH

Hobbs: 4332.6

Tach: 3626.4

TT: 3626.4

Performed Annual inspection IAW CFR 43 appendix D, with reference to Cirrus SR22 inspection checklist. Inspected and tested ELT per FAR 91.207(d). Performed engine ground run and op's check. Removed seats, and interior/exterior inspection panels. Pressure tested exhaust system and inspected for leaks. Disassembled gascolator, inspected, cleaned, and reinstalled. Cleaned, inspected, lubricated pulleys. Verified proper control cable tension and control surface travel. Service NLG swivel. Performed 3 year GSA 81 and 80 servo inspection and lubrication, **Next due Mar. 2028**. R/R brake linings (PN: PQ-110.1(A)). R/R #2 battery (PN:50979-001), **Next due Mar. 2027**. R/R mainship battery (PN: RG24-15M & SN: 70042354). R/R NLG fairing trim seal (PN: 53361-001). R/R stall warning pressure switch (PN:12801-001). Repaired worn lower cowling camlock holes by fiberglassing holes and redrilling. Repaired worn wheel fairing bolt hole by epoxy and bushing. Reinstalled seats, carpets, and interior/exterior inspection panels. Ground run indicates, battery charging properly with load, full static RPM, proper vacuum pressure, minimal vibrations. Complied with all AD's, see AD compliance record.

I certify that this aircraft has been inspected IAW an Annual Inspection and was found to be in airworthy condition.

END

Christopher Lore

A&P 3458101 IA

Date: 1/27/2024

500 Airport BLVD Hangar 1

Lake Charles, LA 70607

Phone: (337)912-4496

TT: 3609.4

Complied with AD-2024-24-11 by visual and Florescent penetrant inspection. No cracks found. Next due 3719.4

Lore Aviation Services LLC

Airframe

Tach: 3609.4

Hobbs: 4308.3

N444JH

Christopher Lore A&P 3458101



Lore Aviation Services LLC

Date: 8/28/2025

500 Airport BLVD

Hangar 1

Lake Charles, LA 70607

Phone:

(337) 912-4496

Airframe

Hobbs: 4534.2

Tach: 3799.8

N444JH

Complied with Cirrus SB2X-76-07 by installing new power lever (PN: 100079-001). AD 2024-24-11 no longer applicable due to installation of new part.

END

Christopher Lofe

A&P 3458101 IA

PAIRS & REPLACEMENT)

PAGE
TOTALS

CARRY FORWARD to Top of Next Page