

N427KG

THE
adlogTM

AIRCRAFT
MAINTENANCE
RECORDKEEPING
SYSTEM

**AIRFRAME
MAINTENANCE
RECORDS**



Flightlogix - 4510 Airport Road - Cincinnati, OH 45226 - 513-321-1200

N427KG
Tach: 1564.5CIRRUS DESIGN CORP, SR22, S/N: 3068
Hobbs: 1893.8

May 16, 2019

1. inspected wiring for #1 alternator. Installed new field control module. Installed (1) 29435-002 - FIELD CONTROL MODULE. Ops checks good
2. Disconnected and cleaned plug with electrical contact enhancer, Ops check good.

With respect to the work performed, this airframe is approved for return to service. Details of work performed are on file with Flightlogix under work order: WO_289.

Greg Herrmann A&P IA 406901563



Flightlogix - 4510 Airport Road - Cincinnati, OH 45226 - 513-321-1200

N427KG
Tach: 1571.8CIRRUS DESIGN CORP, SR22, S/N: 3068
Hobbs: 1902.2

July 31, 2019

1. Inspected aircraft I/A/W a 100hour/Annual inspection per 14 CFR 43 Appendix D and Cirrus SR22 AMM rev. B5 Chapter 5-20.
2. Main battery capacity check performed. test at 92%.
3. Installed new battery 2. Installed (2) 50979-001 - #2 Battery.
4. Removed O2 bottle from plane to ship out for hydrostatic test.
5. Reinstalled oxygen bottle and regulator assembly after overhaul by Precise Flight CRS# 6PCR620B under their WO# 106888. All life limited components were replaced and units are zero time as of the overhaul date of 22/Jul/2019 Installed (1) 102N0100-1 - O2 BOTTLE, S/N: HPR100694/2314.
6. Performed annual ELT inspection per far 91.207d, checked good.
7. Repaired fiberglass damage on L/H main gear fairing.
8. Resealed wing root fairings. Installed (1) 051141-58043 - SEALANT, Installed (20) 51847-045U - Foam Tape, Installed (1) 51847-045U - Foam Tape.
9. Adjusted aileron tension per AMM 27-10.
10. Adjusted rudder rod end.
11. Stop drilled horizontal stabilizer cuff where cracking.
12. Serviced AC system.
13. Performed leak check on ac system, no leak detected.
14. Installed new left and right brake caliper o-rings and temperature stickers. Bled brakes. Installed (2) 51698-003 - Temp Label, Yellow, Installed (2) 51698-001 - Temp label, blue, Installed (4) M83461-1-222 - O-ring.
15. Performed SB 2X-42-17 sw update v0764.37.
16. Complied With TAT SB 12-02.
17. Complied With TAT SB 11-04.
18. Complied With TAT SB 10-01. No issues found.
19. Complied With TAT SB 009-01. No issues found.
20. TAT SI 15-02, Not Applicable to this Aircraft.
21. Complied With TAT SI 11-03.
22. Removed and replaced Wastegate support bolt MS21250-05020. Installed (1) MS21250-05020 - Bolt.
23. Complied With TAT SI 11-01.
24. Complied with TAT SI 08-05.
25. Complied With TAT SI 08-01.
26. Complied with TAT SI 08-04, No leaks found.

With respect to the work performed, this airframe is approved for return to service. Details of work performed are on file with Flightlogix under work order: WO_338.

Greg Herrmann A&P IA 406901563