

MAKE: CIRRUS DESIGN CORP  
MODEL: SR22  
S/N: 1596  
REG. NO: N315DB



**Avias Aircraft Services**  
Part 145: DK7R442E  
2601 Cirrus Way NW  
Kennesaw GA 30144

W/O #: AAS0341  
DATE: 07-31-2025  
Hobbs: 1805.5  
A/C TT: 1805.5  
A/C Tach: 1805.5

## Airframe

- Performed Incoming preliminary inspection IAW 14CFR 145.211 (c) (ii).
- Performed an inbound airplane run-up in accordance with operational/functional check in Cirrus AMM 5-30.
- Complied with Cirrus SR22 10-year mandatory CAPS rocket motor replacement by removing rocket motor assy P/N: 29554-001, S/N: 1130 and installing new rocket motor assy P/N: 29554-405, S/N: 0949 IAW Cirrus CMM 95-01 and SB2X-95-31R3. Next replacement due: 4/8/2035
- Complied with Cirrus SR22 10-year mandatory CAPS parachute replacement by removing parachute assy P/N: 25574-004-REB Rev. C, S/N: 01712R1 and installing new parachute assy P/N: 25337-005, S/N: FEC1533 IAW Cirrus CMM 95-01. Next replacement due: 6/30/2035
- Removed Kelly A/C system to facilitate CAPS replacement, reinstalled Kelly A/C system IAW Kelly Aerospace kit #KATS-14-003 installation instructions NC-14-022 Rev. D. Ops check good.
- Performed a post maintenance airplane run-up in accordance with operational/functional check in Cirrus AMM 5-30. Note faults noted

## Maintenance Release:

This aircraft, airframe, aircraft engine, propeller or appliance identified above was repaired/inspected in accordance with current requirements of the Federal Aviation Administration and is approved to return to service. Pertinent details of the repair are on file at this Certificated Repair Station DK7R442E.

DATE: 07-31-2025

SIGNED:

John Mark Elliott  
Part 145: DK7R442E

WORK ORDER: AAS0341

Printed by EBIS (EBISCloud.com)