



Engines Are Our ONLY Business

Gold Seal Aircraft Engines

ENGINE MAINTENANCE RECORDS

21 Creative Pl. Montrose, CO 81401 (970) 249-0232 • 800-575-9929 • FAX (970) 249-4155 www.westernskyways.com

ENGINE MAINTENANCE RECORDS

	Log No
Aircraft Registration No. N229TA	
Engine Manufacturer	
Model	
Serial No.	
Date installed on aircraft	
Time Between Overhauls (TBO)	- Hours
If used on multi-engine aircraft:	
☐ RIGHT LEFT	
☐ FRONT ☐ REAR	





ENGINE WARRANTY TRANSFER REQUEST Current Owners Name:______ Phone:_______ New Owner's Name:_______ Address:_______ Phone:_______ Address:_______ Date Installed:________ Engine Model:______ Aircraft Model/year:_______ Numbers of Hours Since Installed:_______ Signature of Current Owner:_______



GOLD SEAL AIRCRAFT ENGINES

21 Creative Place Montrose, CO 81401

(970) 249-0232 FAX · (970) 249-4156

www.westomskyways.	com F	AX: (970) 249-4155			
Engine Make	:CONTINENTAL	Moo	del: <u>IO-520-C</u>		
Serial Numb	er: 287232-R	W/0	O No: W0560	90 Date: 24	DEC 2019
Warranty Nu	ımber: <u>L19326</u>	Wa	rranty Start D	ate: JAN 2020	
Crankshaft	Serial No: T958	Cyl	inder Part Nu	mber: SAP SA520	006-A20P NEW
pplicable. See un in a test cell This engine mee	t" dated 11/10/2010 back section for Air Total Previous Timets requirements of	ways, Inc. Repair Spon all Teledyne Continuorthiness Directives are: 6072.2 CONTINENTAL M-CONTINENTAL M-CONTINENT	inental Motor I and Service B Hrs.	Engines and Lycomi ulletin compliance. 1700.00	ng Engines as This engine was Hour TBO
Component	Part No.	Serial No.	Component	Part No.	Serial No.
L/H Mag:	BL-349350-4	F19BA071R	Prop Gov:	N/A	N/A
R/H Mag:	BL-349350-5	F19IA068R	Wastegate:	N/A	N/A

Component	Part No.	Serial No.	Component	Part No.	Serial No.
L/H Mag:	BL-349350-4	F19BA071R	Prop Gov:	N/A	N/A
R/H Mag:	BL-349350-5	F19IA068R	Wastegate:	N/A	N/A
Fuel Pump:	646212-2A2	B02JA070R	Alt/Gen:	N/A	N/A
Inj/Carb:	653377A3	A02JA094R	Controller:	N/A	N/A
Man Valve:	631427-2A11	J129235CR	Pop Off::	N/A	N/A
Starter:	C24ST5 NEW	H-S090772	Controller:	N/A	N/A
Turbo:	N/A	N/A	Pump Vac:	N/A	N/A
			Fuel limiter:	N/A	N/A
			1		

MAINTENANCE RELEASE

The engine and accessories listed above were overhauled and inspected in accordance with current Federal Aviation Regulations and were found airworthy for return to service. Pertinent details of this repair are on file at this Repair Station on above work order.

Form 200

Repair Station No. WS9R575J

Cylinder S/N	Cylinder S/N				
#1: 526J1940206	#5: 526J1940210				
#2: 526J1940207	#6: 526J1940211				
#3: 526J1940208	#7: N/A				
#4: 526J1940209	#8: N/A				

E "	Page 1	of 2	NOTES C	OMPLIANCE RECORD					
	_	AD	NOTES C	DINIPLIANCE RECORD					
	Engine - Cor	tinental Motors - IO-520-C S/N: 28723	C	/estem Skyways Inc. RS: WS9R575J //O: W05609C					
	Appliance - I	lagnetos - TCM (formerly Bendix) S-1200 series S/N: F19B/ S/N: F19IA	068R P	/N: BL-349350-4 /N: BL-349350-5 lodel: S6RN-1225					
	Appliance - 0	Cylinder assembly - Superior Air Parts S/N: 526J1 S/N: 526J1	940206 P	/N: SA52008-A20F					
	-	S/N: 526J1 S/N: 526J1 S/N: 526J1	940208 940209 940210						
	-	S/N: 526J1	940211		0	20			-
-	AD#	Applicable S.B. # & Subject	Date & Hours @ Comp.	Method of Compliance	One Time	ecurring	Next Comp. @ Hrs/Date	Authoriz Signatur Numbe	8.0
	70-14-07 R2	Fuel injection pump needle	24 DEC 2019 6072.2	Verified new style needle installed	x		-	Larry Flatten WS9R575J	24
	72-24-03	Oil filter adaptor	24 DEC 2019 6072.2	New style oil filter adapter installed	T	x	N/A	Larry Flatten WS9R575J	20
╈	74-26-09	Bendix magnetos	24 DEC 2019 6072.2	N/A per magneto serial number	x	H		Larry Flatten WS9R575J	11
1	77-13-22 R1	Crankcase cracks	24 DEC 2019 6072.2	Turk per engine cental transport from etyle lege case	T	х	N/A	Larry Flatten	11
Т	79-05-09	Oil pressure relief valve	24 DEC 2019	installed. "Current" design screw and plunger installed	x			WS9R575J Larry Flatten	H
╀	80-01-04	Cylinder holddown flanges	6072.2 24 DEC 2019	Installed NEW Superior cylinders	x			WS9R575J Larry Flatten	
1	81-24-06	Fuel pump	6072.2 24 DEC 2019	N/A per fuel pump S/N: B02JA070R	<u> </u>	Н	N/A	WS9R575J Larry Flatten	_
+	82-13-01	Bendix magnetos	6072.2 24 DEC 2019	Verified green block not installed	\vdash	Н		WS9R575J Larry Flatten	10
	82-20-01	Bendix magnetos	6072.2 24 DEC 2019	N/A per magneto model number		^	N/A	WS9R575J Larry Flatten	FK
T	88-13-04 R3	Cylinder assemblies	6072.2 24 DEC 2019	The second control of	X			WS9R575J Larry Flatten	OF
	88-03-06	Oil filter	6072.2 24 DEC 2019			Х	N/A	WS9R575J	H
	91-19-03	F-000-000-004	6072.2 24 DEC 2019		×			Larry Flatten WS9R575J	Pa
+		Champion oil filter	6072.2	Installed oil filter P/N: CH48108-1	x			Larry Flatten WS9R575J	10
	93-08-17	Incorrect oil pick-up tube	24 DEC 2019	N/A per engine model.	x	П		Larry Flatten	14
			6072.2	and an army and the form that we contain the transport to the second to		Ш		WS9R575J	//
	93-10-02	Cylinder valve retainer	6072.2 24 DEC 2019 6072.2	- Water St Wate	x			Larry Flatten WS9R575J	DX
			24 DEC 2019	and an army and the form that we contain the transport to the second to	\vdash			Larry Flatten	
	93-10-02 Page 2	of 2 Applicable S.B. # & Subject	24 DEC 2019	and an army and the form that we contain the transport to the second to	X One TI	Recurrin	Next Comp. @ Hrs/Date	Larry Flatten	OV ced
	Page 2	of 2	24 DEC 2019 6072.2 Date & Hours @ Comp.	Installed NEW Superior cylinders Method of Compliance	X One Time	g	Next Comp. @ Hrs/Date	Authoriz Signatur Numbe	DY ceed e & er
	Page 2	of 2 Applicable S.B. # & Subject	Date & Hours @ Comp. 24 DEC 2019 072.2	Installed NEW Superior cylinders Method of Compliance Installed coupling P/N: 653359	One Time X	gni	Next Comp. @ Hrs/Date	Authoriz Signatur Numbel	DX ced e & er
	Page 2 AD#	of 2 Applicable S.B. # & Subject Fuel pumps	Date & Hours @ Comp. 24 DEC 2019 6072.2 24 DEC 2019 6072.2 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number	One Time X	ng	Next Comp. @ Hrs/Date	Authoris Signatur Numbel Larry Flatten WSRR575J	DX ced e & er
	Page 2 AD# 93-16-15 94-01-03 R2	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos	Date & Hours @ Comp. 24 DEC 2019 6072.2 24 DEC 2019 6072.2 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number	One Time X	ing	@ Hrs/Date	Authoriz Signatur Numbu Larry Flatten WSSR575J Larry Flatten WSSR575J	DX cod e & er CX
	Page 2 AD# 83-16-15 94-01-03 R2 94-06-09 95-03-14	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks	Date & Hours @ Comp. 24 DEC 2019 6072.2 24 DEC 2019 6072.2 24 DEC 2019 6072.2 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number N/A per engine serial number. Installed mount legs P/N: 653305 and 653306.	One Time X	ing	Next Comp. @ Hrs/Date	Authorizing Author	DX ned eaa ar Fr Fr Fr Fr Fr
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect.	Date & Hours @ Comp. 24 DEC 2019 6072.2	Installed NEW Superior cylinders Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number N/A per engine serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul	One Time X	x	@ Hrs/Date	Authoriz Signatur Numbel Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten WSSR575J	DX cod e & er CX
	Page 2 AD# 83-16-15 94-01-03 R2 94-06-09 95-03-14	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks	Date & Hours @ Comp. 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number N/A per engine serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul	One Time X X X	x	@ Hrs/Date N/A Anytime crankshaft is	Authoriz Signatur Numbu Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten La	DX ned eaa ar Fr Fr Fr Fr Fr
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect.	Date & Hours & Comp. 24 DEC 2019 6072.2	Installed NEW Superior cylinders Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected	One Time X X X	x x	@ Hrs/Date	Authoriz Signatur Numbu Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten WSSR575J Larry Flatten	OX
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks	Date & Hours @ Comp. 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number N/A per engine serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected	One Time X X X X	x x	@ Hrs/Date N/A Anytime crankshaft is	Authorizing Author	OX O
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17 PL98-01-08	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks Exhaust roller rocker arms	Date & Hours @ Comp. 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number N/A per engine serial number. Installed mount legs P/N: 653305 and 653308. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected N/A Exhaust roller rockers not installed Crankshaft S/N: T958 visual, dimensional and magnetic particle inspected	One Time X X X X X	x x	@ Hrs/Date N/A Anytime crankshaft is	Authoriz Signatur MSSR575J Larry Flatten WSSR575J Larry Flatten WSSR	OX orange of the orange of th
	Page 2 AD# 83-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17 PL98-01-06	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks Exhaust roller rocker arms Crankshafts Crankshafts	Date & Hours @ Comp. 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number N/A per engine serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected N/A Exhaust roller rockers not installed Crankshaft S/N: T958 visual, dimensional and magnetic particle inspected N/A per crankshaft S/N: T958	One Time X X X X X X X	x	@ Hrs/Date N/A Anytime crankshaft is	Authoriz Signatur Numbu Larry Flatten WSSR575J Larry Flatten Larry Flatten WSSR575J Larry F	OX
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17 PL98-01-06 98-17-11 99-19-01	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks Exhaust roller rocker arms Crankshafts Crankshaft failure Fracture of the crankshaft connecting rod journal	Date & Hours @ Comp. 24 DEC 2019 6072.2	Installed NEW Superior cylinders Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number N/A per engine serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected N/A Exhaust roller rockers not installed Crankshaft S/N: T958 visual, dimensional and magnetic particle inspected N/A per crankshaft S/N: T958	One Time X X X X X	x	@ Hrs/Date N/A Anytime crankshaft is	Authoriz Signatur Numbu Larry Flatten WSSR575J	OX O
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17 PL98-01-08 98-17-11 99-19-01 2000-23-21	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks Exhaust roller rocker arms Crankshafts Crankshaft failure Fracture of the crankshaft connecting rod journal Prevent loss of engine power	Date & Hours @ Comp. 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected N/A Exhaust roller rockers not installed Crankshaft S/N: T958 visual, dimensional and magnetic particle inspected N/A per crankshaft S/N: T958 N/A per crankshaft S/N: T958 Installed NEW Superior cylinders.	One Time X X X X X X X	x	@ Hrs/Date N/A Anytime crankshaft is	Authoriz Signatur Numbu MissR575J Larry Flatten WSSR575J	OX PA
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17 PL96-01-06 98-17-11 99-19-01 2000-23-21 2004-08-10 2007-04-19	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks Exhaust roller rocker arms Crankshafts Crankshaft failure Fracture of the crankshaft connecting rod journal Prevent loss of engine power To prevent cylinder separation that can lead to engine failure	Date & Hours @ Comp. 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number N/A per engine serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected N/A Exhaust roller rockers not installed Crankshaft S/N: T958 visual, dimensional and magnetic particle inspected N/A per crankshaft S/N: T958 Installed NEW Superior cylinders. N/A per cylinder part number.	One Time X X X X X X X X X X X X X X X X X X X	x	@ Hrs/Date N/A Anytime crankshaft is	Authoriz Signatur Numbol Larry Flatten WSSR575J	OX O
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17 PL98-01-08 98-17-11 99-19-01 2007-04-19 2007-04-19R1	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks Exhaust roller rocker arms Crankshafts Crankshaft failure Fracture of the crankshaft connecting rod journal Prevent loss of engine power To prevent cylinder separation that can lead to engine failure To prevent cylinder separation that can lead to engine failure	Date & Hours @ Comp. 24 DEC 2019 6072.2	Installed NEW Superior cylinders Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number N/A per engine serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected N/A Exhaust roller rockers not installed Crankshaft S/N: T958 visual, dimensional and magnetic particle inspected N/A per crankshaft S/N: T958 Installed NEW Superior cylinders. N/A per cylinder part number.	One Time X X X X X X X X X X X X X X X X X X X	x	N/A Anytime crankshaft is removed.	Authoriz Signatur Numbu Larry Flatten WS9R575J Larry Flatten WS9R575	OX PO
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17 PL96-01-06 98-17-11 99-19-01 2000-23-21 2004-08-10 2007-04-19	of 2 Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks Exhaust roller rocker arms Crankshafts Crankshaft failure Fracture of the crankshaft connecting rod journal Prevent loss of engine power To prevent cylinder separation that can lead to engine failure Correction - To prevent loss of engine power due to cracks in the cylinder head, possible engine failure and fine in the	24 DEC 2019 6072.2 Date & Hours & Comp. 24 DEC 2019 6072.2	Installed NEW Superior cylinders Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number N/A per engine serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected N/A Exhaust roller rockers not installed Crankshaft S/N: T958 visual, dimensional and magnetic particle inspected N/A per crankshaft S/N: T958 Installed NEW Superior cylinders. N/A per cylinder part number.	One Time X X X X X X X X X X X X X X X X X X X	x x	N/A Anytime crankshaft is removed.	Authoriz Signatur Numb Larry Flatten WSSR575J Larry Flatten WSR675J Larry Flatten	OX O
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17 PL98-01-08 98-17-11 99-19-01 2007-04-19 2007-04-19R1	Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks Exhaust roller rocker arms Crankshafts Crankshafts Crankshaft failure Fracture of the crankshaft connecting rod journal Prevent loss of engine power To prevent cylinder separation that can lead to engine failure To prevent cylinder separation that can lead to engine failure	Date & Hours @ Comp. 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected N/A Exhaust roller rockers not installed Crankshaft S/N: T958 visual, dimensional and magnetic particle inspected N/A per crankshaft S/N: T958 Installed NEW Superior cylinders. N/A per cylinder part number. Installed NEW Superior cylinders	One Time X X X X X X X X X X X X X X X X X X X	x x x x	N/A Anytime crankshaft is removed.	Authoriz Signatur Numbu MissR575J Larry Flatten WSSR575J Larry Flatt	OX PO
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17 PL98-01-06 98-17-11 98-19-01 2002-23-21 2004-06-10 2007-04-19R1 2009-19-07	Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks Exhaust roller rocker arms Crankshaft failure Fracture of the crankshaft connecting rod journal Prevent loss of engine power To prevent cylinder separation that can lead to engine failure To prevent cylinder separation that can lead to engine failure Correction - To prevent loss of engine power due to cracks in the cylinder head, possible engine failure, and fire in the engine compartment To prevent excessive hydraulic lifter wear To prevent an in-flight shuldown due to a failed fuel server	24 DEC 2019 6072.2 Date & Hours @ Comp. 24 DEC 2019 6072.2	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number. Installed mount legs P/N: 653305 and 653306. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected N/A Exhaust roller rockers not installed Crankshaft S/N: T958 visual, dimensional and magnetic particle inspected N/A per crankshaft S/N: T958 Installed NEW Superior cylinders. N/A per cylinder part number. Installed NEW Superior cylinders Installed NEW Superior cylinders	One Time X X X X X X X X X X X X X X X X X X X	x x x x x x x	N/A Anytime crankshaft is removed. N/A N/A N/A N/A	Authoriz Signatur Numbel Larry Flatten WS9R575J Larry Flatten WS9R57	OX PRI
	Page 2 AD# 93-16-15 94-01-03 R2 94-06-09 95-03-14 95-21-15 97-26-17 PL98-01-08 98-17-11 99-19-01 2000-23-21 2004-08-10 2007-04-19R1 2009-19-07	Applicable S.B. # & Subject Fuel pumps Teledyne/Bendix magnetos Teledyne/Bendix magnetos Engine mount cracks Engine teardown and analytical inspect. CORRECTION - Crankshaft fatigue cracks Exhaust roller rocker arms Crankshafts Crankshaft failure Fracture of the crankshaft connecting rod journal Prevent loss of engine power To prevent cylinder separation that can lead to engine failure To prevent cylinder separation that can lead to engine failure Correction - To prevent loss of engine power due to cracks in the cylinder head, possible engine failure, and fire in the engine compartment To prevent excessive hydraulic lifter wear	24 DEC 2019 6072.2 Date & Hours & Comp. 24 DEC 2019 6072.2 24 DEC 2019	Method of Compliance Installed coupling P/N: 653359 N/A per magneto serial number N/A per magneto serial number. Installed mount legs P/N: 653305 and 653308. Engine inspected during overhaul VAR crankshaft, S/N: T958 ultrasonic inspected N/A Exhaust roller rockers not installed Crankshaft S/N: T958 visual, dimensional and magnetic particle inspected N/A per crankshaft S/N: T958 Installed NEW Superior cylinders. N/A per cylinder part number. Installed NEW Superior cylinders Installed NEW Superior cylinders Installed NEW Superior cylinders	One Time X X X X X X X X X X X X X X X X X X X	X	N/A Anytime crankshaft is removed. N/A N/A N/A	Authoriz Signatur Numbu Larry Flatten WSSR575J	OX PO

DATE TACH OR RECORDING METER TIME

DESCRIPTION OF WORK PERFORMED – SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK



GOLD SEAL AIRCRAFT ENGINES

21 Creative Place Montrose, CO 81401 CRS # WS9R575J

Engine Model: IO-520-C

Serial Number: 287232-R

Time: 6072.2 TTE

Work Order: W056090

Date: 24 DEC 2019

Installed S539800M40 starter adapter spring in accordance with Aircraft Specialties Inc. STC SE09846SC and Aircraft Specialties services Service Bulletin No.: S-2008-01, Rev. 0, or later FAA approved revision. Starter Adapter was overhauled in accordance with Continental Motors Overhaul Manual X30039 and applicable Service Information.

Installed Cam Gear P/N: 2078-1 (Ram PMA). This satisfies the requirements of MSB05-8D.

The engine and/or component identified above was overhauled and inspected IAW current FAA Regulations and found Airworthy for return to service. Pertinent details of this repair are on file at this repair station under above work order.

Signed: Larry Flatten

CRS# WS9R575J

FORM 201E

Mountain Air Aviation

11750 Airport Way Hangar B12C Broomfield, CO 80021 (303) 469-1380

Engine Log Entry

N229AT Beech 4-20-20 Tach: 358.9 Time SMO=0.0

I certify that this <u>Engine</u> has been Inspected in accordance with a <u>Annual</u> Inspection and was determined to be in an airworthy condition.

Name ///////

Number [A3277907]