# AIRCRAFT TECHNICAL RECORD

Section 3. ENGINE LOG #2



							Number Number
1. Approvir	ng Competent Authority	2.					3. Form Tracking Number  AE028199
	ro Control GmbH Austria	AUT	THORISED RE	Els. of CE	RTIFICATE		5. Work Order / Contract / Invoice
4. Organisa	ation Name and Address:		EASA	FORM 1	K1111-1-		5. Work Order / State ES191602
							ESTO
			Rudolf D	ngine GmbH esel Straße 11			11. Status/Work
6. Item	7. Description		2700 Wiener	Veustadt, AUS	STRIA	10. Serial No.	New
1	E4PC Engine		8. Part No.	i	9. Qty.	E4P-C-00266	
			E4PC-00-000-000	D las.: 004			
General: The Item 1: The Item 1: Fue	the engine complies with the action of the engine conforms to EASA Tell hose assy P/N: A24119-01 that the items identified above approved design data and a	pe design approved by Canadian Department of Transapplicable airworthiness directives  FCDS E.200 Issue 10; Damper assy P/N: D44-7306-3 (EASA Form1: 220832) acc. DAI-Drawing D44-7306-1  we were manufactured in comformity to:  are in condition for safe operation	00.00 1/EASA For	14a. Certifies that	Part-145.A.50 Release unless otherwise specified in block 12, was accom		-145 and in
	non-approved design data s		mher	14b. Authoris	ed Signature	14c. Ce	ertificate/ Approval Ref. Number
13b. Authorise	ed Signature	13c. Approval / Autorisation Nur AT.21G.0010		14d. Name		14e. Da	nte (dd mmm yyyy)
13d. Name	O Bauer (erti Stari	13e. Date (dd minin yyyy) 1 3 JUN 2019					
authority specifie installation certif	ed in block 1, it is essential tha fication. In all cases aircraft ma	te authority to install the item(s). Where the user/insta t the user/installer ensures that his/her airworthiness a aintenance records must contain an installation certific	aller performs work authority accepts it cation issued in acc		with regulations of an airw worthiness authority spece e national regulations by	orthiness authority differrent that cified in block 1. Statements in b the user/installer before the airc	on the airworthiness blocks 13a and 14a do not constitute craft may be flown.
EASA Form 1 - 2 reigabe: 24.Aug. 2			, 5				

# Section 3A: Engine Service and Maintenance Log



DIAMOND AIRCRAFT INDUSTRIES INC. D.O.T. APPROVED MANUFACTURER #161-93

Registration: AC Serial Number: N502LA LH Engine Serial Number 85 C055 RH Engine Serial Number. E4P-C-00285 LH Prop Serial Number: E4P-C-00266 RH Prop Serial Number. 190626 Airframe Total Time: 190628

RH Total Time Engine Brought forward from Production Test Flight Journey Log (DAI - Form Q-224) 47 Hpg

No STC's incorporated

Bi-weekly AWD check carried out to current revision 2020-04 all applicable AD's complied with, see

attached.

The work described above was carried out IAW the applicable Standard of Airworthiness.

Inspector

FEB 2 6 2020 date

(Intentionally left blank below this point)

ENGINE MODEL: AE330 ENGINE S/N (R): E4P-C-00266 REG NO N502LA WORK ORDER: 0129



# Premier Aircraft Sales, Inc.

3804 Falcon Way W Hangar 18S Fort Worth, TX 76106 Phone: 562.881.5345 DATE BEZ

## Right Engine Entries

Changed oil and filter. Serviced engine with Aeroshell Diesel Ultra

Inspected gearbox chip collector

DATE: 8/6/2020

SIGNED:

Work Order 0129

Printed by EBis 3 (datcomedia.com

Chad Cox, License: AP3782800

ENGINE MODEL: AE330 ENGINE S/N (R): E4P-C-00266 REG. NO: N502LA WORK ORDER: 0250



## Premier Aircraft Service, Inc.

3804 Falcon Way W Hangar 18S Fort Worth, TX 76106 Phone: 562.881.5345

DATE 4/15/2021 AC TSN 'S'
ENG IT (R) 'S'
FLIGHTIME 'S'

#### Right Engine Entries

DATE 4/15/2021

Performed 100 Hour Inspection using DA62 AMM as a guide

Changed oil and filter. Serviced engine with Aeroshell Diesel Ultra

Inspected gearbox chip collector

I certify this engine has been inspected IAW an Annual Inspection and was determined to be in airworthy condition.

Work Order 0250

ad, License: AP3492477 IA TOTALS SINCE NEW

SIGNED:

Printed by EBis 3 (datcomedia.com)

CARRY FORWARD to Top of Next Page

ENGINE MODEL AE330 ENGINE S/N (R) E4P-C-00266 REG NO N502LA WORK ORDER 0549



## Premier Aircraft Service, Inc.

3804 Falcon Way W Hangar 18S Fort Worth, TX 76106 Phone: 562.881.5345

DATE: 4/8/2022 A/C TSN: 270.8 ENG TT (R): 270.8 FLIGHTTIME: 270.8

#### **Right Engine Entries**

- Replaced HPP with new S/N 21-07-08-02-00275
- Replaced fuel rail with serviceable assembly TSN: 148.0
- Replaced injectors with new. IQA: AP8GEE, 6RRB2S, 7ZRDYI, ARHADW

DATE: 4/8/2022

SIGNED

David Seastead, License: AP3492477 IA

Work Order: 0549

Printed by EBis 3 (datcomedia.com)

ENGINE MODEL: AE330 ENGINE S/N (R): E4P-C-00266 REG. NO: N5021 A WORK ORDER 0562



### Premier Aircraft Service, Inc.

3804 Falcon Way W Hangar 18S Fort Worth, TX 76106 Phone: 562.881.5345

DATE: 5/11/2022 A/C TSN: 274.5 ENG TT (R): 274.5 FLIGHTTIME: 274.5

### **Right Engine Entries**

- Performed 100 Hour Inspection using DA62 AMM as a guide
- Changed oil and filter. Serviced engine with Aeroshell Diesel Ultra
- Inspected gearbox chip collector
- Performed 300hr gearoil and filter change
- Performed 300hr Injector Cover Zonal Inspection
- Performed 300hr Alternator Inspection
- Performed 300hr TVD Inspection

1 certify this engine has been inspected in accordance with an Annual Inspection and was determined to be in airworthy condition.

DATE: 5/11/2022

SIGNED:

Chad Cox, License: AP3782800 IA

Work Order: 0562

Printed by EBis 3 (datcomedia.com)

ENGINE MODEL: AF330 ENGINE S/N (R): E4P-C-00266 REG. NO: N502LA WORK ORDER: 0575



#### Premier Aircraft Service, Inc.

3804 Falcon Way W Hangar 18S Fort Worth, TX 76106 Phone 562.881.5345

DATE: 5/11/2022 A/C TSN: 274.5 ENG TT (R): 274.5 FLIGHTTIME: 274.5

#### **Right Engine Entries**

- MSB-E4-029 Installed BPA restrictor
- Replaced turbo and head drain gaskets
- · Replaced oil separator return o-ring

DATE: 5/11/2022

SIGNED:

Chad Cox, License: AP3782800 IA

Work Order: 0575

Printed by EBis 3 (datcomedia.com)

27 June 2022

Tach Time: **Total Time:** 

288.9 288.9 RIGHT POWERPLANT

N502LA **AUSTRO E4P** S/N: E4P-C-00266

- \* Tested wastegate controler per Austro engine maintenance manual, section 81/E4.08.04 Rev.30 using regulated air pressure, wastegate function normal and within limits
- Inspected BPA (Boost Pressure Restrictor) restrictor/bleed for contamination, all clear at this time
- R/R boost pressure electronic actuator control regulator per Austro maintenance manual, part mfg. discription/ Electronic Change-over Valve 24V, p/n: E4A-41-300-801, Lot#RC2200699
- Found gasket missing from engine manifold flange to inlet of turbocharger. Removed engine manifold and lapped mating surfaces for trueness of mating surfaces, replaced all exhaust manifold gaskets to engine block, p/n: EYA-04-000.001 installed new mounting manifold nuts p/n: ISO07044-M8-8-LV. totqued per austro engine maintenance manual
- \* R/R gasket, upper engine manifold to inlet turbo, p/n: E4A-04-000-002
- \* R/R turbo outlet exhaust flange to tailpipe, p/n: EYA-04-000-003
- \* R/R all four bolts securing exhaust manifold outlet to turbo inlet with new, p/n: E4A 04-000-806
- \* Installed eight missing conical washers, p/n: E4A-04-000-804 & p/n: E4A-04-000-805 on exhaust manifold outlet flange to turbo inlet on four mounting bolts
- \* Torqued all nuts and bolts using Austro engine maintenance manual as aproved data and procedures
- \* Ran engine and checked for turbo operation, engine exhaust, oil and coolant leaks,
- none found at this time
- \* Test Flight this date, okay to return to service

Kim Kevin Matthews AP26200711A

Section 3A: Engine Service and Maintenance Log

DATE	TIME RUN	TIME SINCE OVERI		C	YCLES	
1 1	HOURS min	HOURS	min	Sub Total	TOTAL	DESCRIPTION OF WORK PE
, and HT						(INSPECTION, REPAIR WORK
BROUGHT						REPLACE.
	,					
					■DON D	oavic—
					AVIAT	ION
				Going	your way ever	y day since 1957
				KIĘ	ght Engine Lo	
Date: 11-	30-2022				Aircraft: N5 TTAF: 377.	3 SN: 62C022
TSMOH:	377.2					Tach: 377.2  o Engines Maintenance manual chapter 5 require and 100 hour kit p/n E4A-52-000-KIT. Cleaned
gearbox	filter and replace of the state	-/- 15525-03	Lce	rtify that	t this engine	and 100 hour kit p/n E4A-52-000-KIT. Cleaned GXME 75W-80. Tied up misc wiring. Replaced was inspected in accordance with an 100 hour  A&P3296474IA
		Myz	_p		(F) IT	FULL SERVICE FBO - MAINTENANCE
	CHARTER			ANAGEN		3.00
		. 1 - 2154	Lluy 1	36 West -	Henderson, KY	42420 - Telephone 270 826 6000 - Fax 270 826 6040
	Don Davis Avia	ation, Inc - 2134	nwy 1		EDÓN DAVI	<b> </b>
	Don Davis Avia	ition, Inc - 2134		Going VOU	DON DAVI	<b>S</b> v since 1957
	,	ntion, Inc - 2134		Going you Airc	PON DAVIATION  The way every day  The raft Logbook Exircity incress: N502L	v since 1957 Entry SN: 62.C022
Date: 2-16 TSMOH: 3	-2023			Going your Airc	r way every day raft Logbook E ircraft: N502L/ TAF: 391.7	Since 1957 Entry  SN: 62.C022 Tach: 391.7
TSMOH: 3	-2023 91.7			Going you Airc	r way every day raft Logbook E ircraft: N502L/ TAF: 391.7	Since 1957 Entry  A SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been insperent in airworthy condition.  A&P3296474IA
TSMOH: 3	-2023 91.7 aspection complance with an Ar	leted this date	. AD's	Going your Airc  A	r way every day raft Logbook Edircraft: N502LATAF: 391.7  d thru CD20. rermined to be	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspected in airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE
TSMOH: 3	-2023 91.7 aspection complance with an Ar	leted this date	. AD's	Going your Airc  A	r way every day raft Logbook Edircraft: N502LATAF: 391.7  d thru CD20. rermined to be	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspected in airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE
TSMOH: 3	-2023 91.7 aspection complance with an Ar	leted this date	. AD's	Going your Airc  Airc  Airc  S checked was det  AGEMEN  West - Hence	r way every day raft Logbook Edircraft: N502LATAF: 391.7  d thru CD20 ermined to be served to be served.	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspection airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE  20 - Telephone 270 826 6000 - Fax 270 826 6040
Annual in in accorda	-2023 91.7 aspection complance with an Ar  CHARTER  Don Davis Aviation	leted this date	. AD's	Going your Airc Airc Airc Airc Airc Airc Airc Airc	r way every day raft Logbook Edircraft: N502L/TAF: 391.7  d thru CD20/ermined to be derived to be de	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspected in airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE  20 - Telephone 270 826 6000 - Fax 270 826 6040
Annual in in accorda	-2023 91.7  Aspection complance with an Ar  CHARTER -  Don Davis Aviation  0:-00266	AIRCRAFT	. AD's	Going your Airc  A	r way every day raft Logbook Edircraft: N502LATAF: 391.7  d thru CD20 ermined to be derived to be de	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspection airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE  20 - Telephone 270 826 6000 - Fax 270 826 6040
Annual in in accordation in accordat	-2023 91.7  Aspection complance with an Ar  CHARTER -  Don Davis Aviation  Aircra	leted this date	. AD's	Going your Airc  A	r way every day raft Logbook Edircraft: N502LATAF: 391.7  d thru CD20 ermined to be derived to be de	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspected in airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE  20 - Telephone 270 826 6000 - Fax 270 826 6040
Annual in in accordation in accordat	-2023 91.7  aspection complance with an Ar  CHARTER -  Don Davis Aviation	AIRCRAFT	. AD's	Going your Airc  A	r way every day raft Logbook Edircraft: N502LATAF: 391.7  d thru CD20 ermined to be derived to be de	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspected in airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE  20 - Telephone 270 826 6000 - Fax 270 826 6040
Annual in in accordation in accordat	-2023 91.7  aspection complance with an Ar  CHARTER -  Don Davis Aviation	AIRCRAFT	. AD's	Going your Airc  A	r way every day raft Logbook Edircraft: N502LATAF: 391.7  d thru CD20 ermined to be derived to be de	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspection airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE  20 - Telephone 270 826 6000 - Fax 270 826 6040  vice, Inc.
Annual in in accordation in accordat	-2023 91.7  Aspection complance with an Arace with an Arac	eted this date nual inspection AIRCRAFT on, Inc - 2154 Hw	. AD's	Going your Airc  A	r way every day raft Logbook Edircraft: N502LATAF: 391.7  d thru CD20 ermined to be derived to be de	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspection airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE  20 - Telephone 270 826 6000 - Fax 270 826 6040  vice, Inc.
Annual in in accordation accordation in accordation ac	-2023 91.7  Aspection complance with an Arace with an Arac	AIRCRAFT on, Inc - 2154 Hw	. AD's	Going your Airc  A	r way every day raft Logbook Edircraft: N502LATAF: 391.7  d thru CD20 ermined to be derived to be de	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspected in airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE  20 - Telephone 270 826 6000 - Fax 270 826 6040
Annual in in accordation in accordat	-2023 91.7  Aspection complance with an Arace with an Arac	eted this date nual inspection AIRCRAFT on, Inc - 2154 Hw	. AD's	Going your Airc  A	r way every day raft Logbook Edircraft: N502LATAF: 391.7  d thru CD20 ermined to be derived to be de	SN: 62.C022 Tach: 391.7  23-02. I certify that this aircraft has been inspection airworthy condition.  A&P3296474IA  LL SERVICE FBO - MAINTENANCE  20 - Telephone 270 826 6000 - Fax 270 826 6040  vice, Inc.

ENGINE MODEL AE330 ENGINE S/N (R) E4P-C-00266 REG NO N502LA WORK ORDER 0828



# Premier Aircraft Service, Inc.

3804 Falcon Way W Hangar 18S Fort Worth, TX 76106 Phone 562 881 5345 DATE 4/21/2023 A/C TSN 434 6 ENG TT (R) 434 6 FLIGHTTIME 434 6

## Right Engine Entries

Replaced governor with new P-877-16 S/N 22G1306-K/G

David Seastead, License AP3492477 IA  Printed by EBis 3 (datcomedia or City Maintenance  MAKE, DIAMOND  MODEL DAV2  SN. 82.0022  SN. 82			SIGNED:	25			Work Order: 08
MAKE: DIAMOND MODEL: DA62 SIN 62 C022 REG. NO: N502LA SN - R: E4PC-00266 RIGHT ENGINE Entries  Complied with 100Hr/Annaul inspection using Diamond aircraft chapter 5 maintenance manual and FAR part 43 appendix D as a guide. Engine oil drained, oil filter removed and inspected with no defects noted, service engine oil with Shell Diesel Ultra and 100hr service kit PN: E4A-52-000-KIT.  Performed RH engine 300/600 hour inspection and servicing as required using Austro E4.08.04R31 MM as a guide. Replaced RH engine flywheel PN: E4PB-73-000-000-KIT SN: 08204 (old SN: 03232) and wastegate circlip for both our replacement using Austro E4.08.04R31 MM as a guide.  Replaced RH engine banjo fitting seals using Austro MM Ch. 79 as a guide. Operation/leak check good. Replaced RH engine water pump PN: E4A-60-100-000 due to leaks using AUSTRO E4.08.04R31 MM CH. 85-50-00 as a guide. Operation/leak check good. Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine Suffer Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine Suffer Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine Suffer Ch. 81 as a guide. Operation/leak check good.  Replaced RH engine Suffer Ch. 81 as a guide. Opera			David Seastead, Lice	ense: AP3492477 IA		Printed by FRi	
MODEL: DA62 SN: 8C: C022 SN: 8C: C022 SN: REG. NO: NS02LA EG. NO: H. T. STO. 9 ENGTT - R: 570.9 ENGTT - R: 5					- T	tion accommodation of the service	3 0 (001001110010101
MODEL: DA62 SN: 8C: C022 SN: 8C: C022 SN: REG. NO: NS02LA EG. NO: H. T. STO. 9 ENGTT - R: 570.9 ENGTT - R: 5	_						jaanstati aliinaan
AREG. NO: NS02LA LONG BEACH, California 90806  RIGHT ENGINE Entries  Complied with 100Hr/Annaul inspection using Diamond aircraft chapter 5 maintenance manual and FAR part 43 appendix D as a guide. Engine oil drained, oil filter removed and inspected with no defects noted, service engine oil with Shell Diesel Ultra and 100hr service kit PN: E4A-52-000-KIT.  All applicable Airworthiness Directives have been researched through bi-weekly issue 2024-18 Performed RH engine 300/600 hour inspection and servicing as required using Austro E4.08.04R31 MM as a guide. Replaced RH engine flywheel PN: E4PB-73-000-000-KIT SN: 08204 (old SN: 03232) and wastegate circlip for 600 hour replacement using Austro E4.08.04R31 MM as a guide.  Replaced RH turbo drain line banjo fitting seals using Austro MM Ch. 79 as a guide. Operation/leak check good.  Replaced RH engine water pump PN: E4A-60-100-000 due to leaks using AUSTRO E4.08.04R31 MM CH. 85-50-00 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and was determined to be in airworthy condition.  DATE: 09-27-2024  SIGNED:  WORK ORDER: 4608 Printed by EBIS (EBISCloud.com)		MAKE: DIAMOND	-				
REG. NO: NSO2LA  LONG BEACH, California 90806  SN - R: E4P-C-00266  RIGHT ENGINE Entries  Complied with 100Hr/Annaul inspection using Diamond aircraft chapter 5 maintenance manual and FAR part 43 appendix D as a guide. Engine oil drained, oil filter removed and inspected with no defects noted. Service engine oil with Shell Diesel Ultra and 100hr service kit PN: E4A-52-000-KIT.  All applicable Airworthiness Directives have been researched through bi-weekly issue 2024-18  Performed RH engine 300/600 hour inspection and servicing as required using Austro E4.08.04R31 MM as a guide. Replaced RH engine flywheel PN: E4PB-73-000-000-KIT SN: 08204 (old SN: 03232) and wastegate circlip for 600 hour replacement using Austro E4.08.04R31 MM as a guide.  Replaced RH turbo drain line banjo fitting seals using Austro MM Ch. 79 as a guide. Operation/leak check good.  Replaced RH engine water pump PN: E4A-60-100-000 due to leaks using AUSTRO E4.08.04R31 MM CH. 85-50-00 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and use detendined to be in airworthy condition.  DATE: 09-27-2024  SIGNED:  WORK ORDER: 4608  Printed by EBIS (EBISCloud.com)	ь.	MODEL: DA62 S/N: 62.C022	=(HD)=	Aero City Maintenance			
RIGHT ENGINE Entries  Complied with 100Hr/Annaul inspection using Diamond aircraft chapter 5 maintenance manual and FAR part 43 appendix D as a guide. Engine oil drained, oil filter removed and inspected with no defects noted. service engine oil with Shell Diesel Ultra and 100hr service kit PN: E4A-52-000-KIT.  All applicable Airworthiness Directives have been researched through bi-weekly issue 2024-18  Performed RH engine 300/600 hour inspection and servicing as required using Austro E4.08.04R31 MM as a guide. Replaced RH engine flywheel PN: Deration/leak check good.  Replaced RH turbo drain line banjo fitting seals using Austro MM Ch. 79 as a guide. Operation/leak check good.  Replaced RH engine water pump PN: E4A-60-100-000 due to leaks using AUSTRO E4.08.04R31 MM CH. 85-50-00 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and use determined to be in airworthy condition.  DATE: 09-27-2024 SIGNED:  WORK ORDER: 4608  Printed by EBIS (EBISCloud.com)		REG. NO: N502LA		LONG BEACH, California 90806			
Complied with 100Hr/Annaul inspection using Diamond aircraft chapter 5 maintenance manual and FAR part 43 appendix D as a guide. Engine oil drained, oil filter removed and inspected with no defects noted, service engine oil with Shell Diesel Ultra and 100hr service kit PN: E4A-52-000-KIT.  All applicable Airworthiness Directives have been researched through bi-weekly issue 2024-18 Performed RH engine 300/600 hour inspection and servicing as required using Austro E4.08.04R31 MM as a guide. Replaced RH engine flywheel PN: E4PB-73-000-000-KIT SN: 08204 (old SN: 03232) and wastegate circlip for 600 hour replacement using Austro E4.08.04R31 MM as a guide.  Replaced RH turbo drain line banjo fitting seals using Austro MM Ch. 79 as a guide. Operation/leak check good.  Replaced RH engine water pump PN: E4A-60-100-000 due to leaks using AUSTRO E4.08.04R31 MM CH. 85-50-00 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and was determined to be in airworthy condition.  DATE: 09-27-2024 SIGNED:  WORK ORDER: 4608 Printed by EBIS (EBISCloud.com)	-			30000			
Performed RH engine 300/600 hour inspection and servicing as required using Austro E4.08.04R31 MM as a guide. Replaced RH engine flywheel PN: E4PB-73-000-000-KIT SN: 08204 (old SN: 03232) and wastegate circlip for 600 hour replacement using Austro E4.08.04R31 MM as a guide. Operation/leak check good.  Replaced RH turbo drain line banjo fitting seals using Austro MM Ch. 79 as a guide. Operation/leak check good.  Replaced RH engine water pump PN: E4A-60-100-000 due to leaks using AUSTRO E4.08.04R31 MM CH. 85-50-00 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and was determined to be in airworthy condition.  DATE: 09-27-2024 SIGNED:  WORK ORDER: 4608  Printed by EBIS (EBISCloud.com)	2	RIGHT ENGINE Entri	es				
Performed RH engine 300/600 hour inspection and servicing as required using Austro E4.08.04R31 MM as a guide. Replaced RH engine flywheel PN: E4PB-73-000-000-KIT SN: 08204 (old SN: 03232) and wastegate circlip for 600 hour replacement using Austro E4.08.04R31 MM as a guide. Operation/leak check good.  Replaced RH turbo drain line banjo fitting seals using Austro MM Ch. 79 as a guide. Operation/leak check good.  Replaced RH engine water pump PN: E4A-60-100-000 due to leaks using AUSTRO E4.08.04R31 MM CH. 85-50-00 as a guide. Operation/leak check good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and was determined to be in airworthy condition.  DATE: 09-27-2024 SIGNED:  WORK ORDER: 4608  Printed by EBIS (EBISCloud.com)	_	<ul> <li>Complied with 100Hr/ drained oil filter remo</li> </ul>	Annaul inspection using	ng Diamond aircraft chapter 5 maintenance m	ianual and EAR part 43 appe	andiv D as a guide. Engine cil	
Performed RH engine 300/600 hour inspection and servicing as required using Austro E4.08.04R31 MM as a guide. Replaced RH engine flywheel PN: E4PB-73-000-000-KIT SN: 08204 (old SN: 03232) and wastegate circlip for 600 hour replacement using Austro E4.08.04R31 MM as a guide. Replaced RH turbo drain line banjo fitting seals using Austro MM Ch. 79 as a guide. Operation/leak check good. Replaced RH engine water pump PN: E4A-60-100-000 due to leaks using AUSTRO E4.08.04R31 MM CH. 85-50-00 as a guide. Operation/leak check good. Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good. I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and was determined to be in airworthy condition.  DATE: 09-27-2024 SIGNED: WORK ORDER: 4608 Printed by EBIS (EBISCloud.com)	_	All applicable Airwort	thiness Directives beauti	th no defects noted, service engine oil with Sh	nell Diesel Ultra and 100hr se	ervice kit PN: E4A-52-000-KIT.	
Replaced RH turbo drain line banjo fitting seals using Austro MM Ch. 79 as a guide. Operation/leak check good. Replaced RH engine water pump PN: E4A-60-100-000 due to leaks using AUSTRO E4.08.04R31 MM CH. 85-50-00 as a guide. Operation/leak check good. Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and was determined to be in airworthy condition.  DATE: 09-27-2024 SIGNED:  WORK ORDER: 4608  Printed by EBIS (EBISCloud.com)		<ul> <li>Performed RH engine</li> </ul>	e 300/600 bour in-	in order through bi-weekly issue 20	24-18		
Replaced RH turbo drain line banjo fitting seals using Austro MM Ch. 79 as a guide. Operation/leak check good. Replaced RH engine water pump PN: E4A-60-100-000 due to leaks using AUSTRO E4.08.04R31 MM CH. 85-50-00 as a guide. Operation/leak check good. Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/leak check good.  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and was determined to be in airworthy condition.  DATE: 09-27-2024 SIGNED:  WORK ORDER: 4608  Printed by EBIS (EBISCloud.com)	_	E4PB-73-000-000-K	IT SN: 08204 (old SN:	03232) and wastegate circlin for 600 hour rep	4.08.04R31 MM as a guide. I	Replaced RH engine flywheel f	PN:
good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/legk check good  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and was determined to be in airworthy condition.  DATE: 09-27-2024 SIGNED:  WORK ORDER: 4608  Printed by EBIS (EBISCloud.com)		Sher anothesis cuech	K good.		Addition daing Addito E4.00	3.04R31 MM as a guide.	
good.  Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation/legk check good  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and was determined to be in airworthy condition.  DATE: 09-27-2024 SIGNED:  WORK ORDER: 4608  Printed by EBIS (EBISCloud.com)	_	Replaced RH engine	orain line banjo fitting s	seals using Austro MM Ch. 79 as a guide. Ope	eration/leak check good.		
Replaced RH engine tube to wastegate solenoid using Austro MM Ch. 81 as a guide. Operation replaced check good  I certify that this Aircraft has been inspected in accordance with Annual inspection checklist and was determined to be in airworthy condition.  DATE: 09-27-2024 SIGNED:  WORK ORDER: 4608  Jonathan Shea  Cert:: AP 3823821 IA		good.	- 11-10. pomp 1 14. E4A	1-00-100-000 due to leaks using AUSTRO E4.0	08.04R31 MM CH. 85-50-00	as a guide. Operation/leak che	eck ——
DATE: 09-27-2024 SIGNED:  Jonathan Shea Cert:: AP 3823821 IA  WORK ORDER: 4608  Printed by EBIS (EBISCloud.com)	_	<ul> <li>Replaced RH engine</li> </ul>	e tube to wastegate so	lenoid using Austro MM Ch. 81 as a guide On	peration#sak check good		
DATE: 09-27-2024 SIGNED: WORK ORDER: 4608  Jonathan Shea Cert:: AP 3823821 IA  Printed by EBIS (EBISCloud.com)		I certify that this Aircraft I	has been inspected in ac	ccordance with Annual inspection checklist and	determined to be in airworth	v condition	-
Jonathan Shea Cert:: AP 3823821 IA  WORK ORDER: 4608 Printed by EBIS (EBISCloud.com)				18		y condition.	
Cert:: AP 3823821 IA		2112100212024			12		
				21 IA		Printed by EBIS (EBISCIO	ud.com)
							9
							-