CONTRACTOR OF THE PROPERTY OF THE PARTY OF T

wo: MO_1878	AeroMe p h	Engine - page 1 of 1
	Maintenance - 6799 N Glen Harbor Blvd - Glendale, A	AZ 85307 · 6238779334
TACH: 4762.26	ING, O& VO-360 SER, S/N: L-24027-36A TSN: 3600.92 SMOH: 1028.52	November 01, 2024
Piper Cherokee M/M. Inst	leaned challenger Oil Filter, serviced engine w alled (8) P/N AA48110-2 - Tempest Oil Filter, Ins	stalled (b) 1714 00 10000 1 1 11111po
Installed (8) P/N LIM674P	ected, gapped, tested and reinstalled spark plug K - Tempest Spark Plug Gasket.	1
defects noted at this time	ession test with the following readings, #1:65/8	
5 D	neto timing, 25 degrees btdc. Ref Lycoming MN or line assy, Installed new primer line assy usi ck with no defects noted. Installed P/N 31197- iper.	na Evenmina installation and Fiber
6. Working.7. Removed old defective b	paffle seal, cut and fit new seal, secured seal to	o baffle using Piper Cherokee M/M
Installed P/N PA28180-65 8. Removed engine oil finge	5725-CS - Cowl Saver Seal Kit. er screen, inspected, no debris found, reinstalled	
Lycoming M/M. 9. Performed engine idle an 10. Removed broken alterna	nd mixture adjustment using Piper MM. Ator noise filter clamp and replaced with new re	eferencing Piper M/M. Installed P/N
MS21919-DG16 - Clamp		g Piper Cherokee M/M Installed (2)
P/N A66894-03 - Muffler 12. Removed cracked exhau	Assembly, Installed (4) P/N 77611 - Lycoming E ust muffler shrouds and replaced shrouds with	XIIausi Fiange Gasket.
75906 - SILICONE VALV	r cover gasket and replaced with new referencir E COVER GASKET RG-75906.	
This engine has been inspect approved for return to service a Aeromech Aircraft Maintenance		TION and was found Airworthy and is of work performed are on file with
Mark Swartwood A&P3567883	IA CMP Madael	
vo: MO_1958	Aero Mep h	Engine Squawk · page 1 of 1
Aeromech Aircraft	Maintenance · 6799 N Glen Harbor Blvd · Glendale	, AZ 85307 · 6238779334
N9629J TACH: 4832.29		December 18, 2024
	ler with new and serviced engine with 8 quard	ts Phillips 100AW oil referencing Piper 10-2 - Tempest Oil Filter.
th respect to the work performe	d, this engine squawk is approved for return to	o service.
exandre Velasco A&P4813355	Str	

SUPPLEMENTAL MAINTENANCE LOGBOOK-SECTION:

Page:

wo: MO_2069

AeroMe**,**ph

Airframe Squawk page 1 of 1

Aeromech Aircraft Maintenance 6799 N Glen Harbor Blvd - Glendale, AZ 85307 - 6238779334

March 11, 2025

N9629J

TACH: 4922.17

Serviced MLG strut air as required, ref Piper MM.

With respect to the work performed, this Airframe is approved for return to service. Details of work performed are on file with Aeromech Aircraft Maintenance under work order: MO_2069.

Colby Hines A&P3649980

wo: MO_2069

AcroMech

Engine Squawk · page 1 of 1

Aeromech Aircraft Maintenance · 6799 N Glen Harbor Blvd · Glendale, AZ 85307 · 6238779334

N9629J

TACH: 4922.17

March 11, 2025

Drained engine oil, replaced oil filer with new and serviced engine with 8 quarts Phillips 100AW oil referencing Piper M/M. Installed (12) P/N 08-13850-1 - Phillips 100AW Quart, Installed P/N AA48110-2 - Tempest Oil Filter.

With respect to the work performed, this engine squawk is approved for return to service.

Colby Hines A&P3649980

wo: MO_2185

Aero**Mes**h

Airframe Squawk · page 1 of 1

Aeromech Aircraft Maintenance · 6799 N Glen Harbor Blvd · Glendale, AZ 85307 · 6238779334

N9629J

TACH: 4972.91

June 04, 2025

Removed old sheered rivets on muffler shroud, squeezed and Resecured induction scoop to muffler shroud with same size and strength rivets reference AC43.13-1B chapter 4.

With respect to the work performed, this Airframe is approved for return to service. Details of work performed are on file with Aeromech Aircraft Maintenance under work order: MO_2185.

Alexandre Velasco A&P4813355

wo: MO 2185

Aero**Me**ph

Engine Squawk · page 1 of 1

Aeromech Aircraft Maintenance · 6799 N Glen Harbor Blvd · Glendale, AZ 85307 · 6238779334

N9629J

TACH: 4972.91

June 04, 2025

Drained engine oil, removed oil filter, installed new oil filter, oil sample taken, and serviced engine with 8 Phillips 100AW oil using piper M/M chapter 2 Installed P/N AA48110-2 - Tempest Oil Filter, Installed P/N 08-16225 - AOA Kit, Installed (8) P/N 08-13850-1 - Phillips 100AW Quart.

With respect to the work performed, this engine squawk is approved for return to service.

Alexandre Velasco A&P4813355

wo: MO 2304		Engine Squawk - page 1 of 1
	AeroMeph	07 6226770224
	omech Aircraft Maintenance · 6799 N Glen Harbor Blvd · Glendale, AZ 8530	
N9629J TACH: 5018.85		September 03, 2025
Drained engine oil and Cherokee M/M section Quart.	d replaced Oil Filter with new of same PN, serviced engine with 8qt: on 2 Installed P/N AA48110-2 - Tempest Oil Filter, Installed (8) P/I	s Phillips 100AW oil using Piper N 08-13850-1 - Phillips 100AW
With respect to the we	ork performed, this engine squawk is approved for return to service	. –
Matthew McCord A&F	P5141225 M W	_
NO 2004		Engine · page 1 of 1
wo: MO_2361	Aero Meø h	
Aei	romech Aircraft Maintenance · 6799 N Glen Harbor Blvd · Glendale, AZ 853	307 - 6238779334
N9629J TACH: 5052.17	LYCOMING, O& VO-360 SER, S/N: L-24027-36A TTSN: 3890.83 SMOH: 1318.43	November 14, 2025
d. B. dan Janahan	oil and cleaned challenger Oil Filter, serviced engine with 8 qts Phillips 10 08-13850-1 - Phillips 100AW Quart, Installed P/N AA48110-2 - Tempest Oil	0AW oil using Piper Cherokee M/M. Filter, Installed P/N 08-16225 - AOA
 Removed, clean Performed Engir 	ed, and inspected spark plugs, found all spark plugs worn beyond limits. he compression test with the following readings, #1:68/80, #2:65/80, #3:72/8 3.13-1 B chapter 8 as a guide.	80, #4:78/80 No defects noted at this
 Performed engin C/W AD24-21-03 	ne to magneto timing. Ref Piper PA-28-180 M/M section 8, No detects note: 2 by inspection of oil filter for bronze metal particulates, none found. Prefor	d at this time. rmed oil analysis sample taken. Next
Found all spark	DB. plugs worn beyond limits. Replaced all spark plugs with new and reinstal to further defects noted at this time Installed (8) P/N REM40E - Spark Plug. front crankshaft seal with new seal P/N: SL11997 referencing Lycoming ox	lled on aircraft using Piper PA28-180 . verhaul manual section 7. No defects
noted at this time 8. Removed and re	e. eplaced #1, #2, and #4 intake gaskets with new gaskets and retorqued a	attach bolts using Lycoming overhaul
Engine battle for	3 Installed (3) P/N 5L71973 - Gashell. #4 cylinder was removed, repaired by patch fabrication as needed, and release with new gasket and safety using Lycoming M/M section 7 Installe	Temblaned doing no form to the strapes
 Reaffixed oil sun Adjusted oil pres 	np heating element as required. ssure as required using Piper M/M chapter 8.	
This engine has been in service at this time. AD order: MO_2361.	nspected in accordance with a 100 HOUR INSPECTION and was found is checked thru 2025-22. Details of work performed are on file with Aeron	Airworthy and approved for return to nech Aircraft Maintenance under work
0,00.7 mo_200 m	rhad (a)	
Mark Swartwood A&P35	567883IA CALIFICALISM	

DO NOT DESTROY