



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035



Bill To: First Sierra Insurance Services, LLC
2150 N. Winery Avenue
Fresno, CA 93703

Invoice Number: INV20-00545
Account Code: FIRS006
P.O. Number:
Job Number:

Title: N448LM - ANNUAL

Payment Type: On Account

Payment Terms: COD Upon completion/delivery

Invoice Date: 07/09/2020

Exchange Rate: 1.000000 USD

INVOICE SUMMARY FOR WORK ORDER NUMBER: P18546

Registration Number: N448LM

	Time & Materials	Flat Rate	Total
Labor:	0.00 USD	4,386.25 USD	4,386.25 USD
Parts:	5,374.43 USD	---	5,374.43 USD
Services:	0.00 USD	130.00 USD	130.00 USD
Freight:	---	---	282.06 USD
Total:	5,374.43 USD	4,516.25 USD	10,172.74 USD
Shop Supplies (7% of applied labor)			307.04 USD
Tax:			432.36 USD
Subtotal:			10,912.14 USD
Total:			10,912.14 USD

See our website for complete terms and conditions: <http://woodlandaviation.com/WAweb-terms.html>.

Payment Terms: Prices estimated are in US dollars. Sales tax as applicable @ 7.25%. Shipping & handling (including "Priority shipping & handling" for warranty parts / services), and tax are additional and post upon work order closing to invoice. All labor, parts, services, shipping and handling, tax, and fuel provided (including past open invoices) are due upon completion and/or delivery. Estimates and final invoices reflect a 3% discount for paying via cash, check, ACH or wire. Please contact Customer Service if you will be paying with any other form with an updated total.

Deposit Requirements: a. 100% parts & service estimated and ¼ labor, OR b. As determined for specific maintenance/avionics request.

Note 1. Additional parts, labor, and/or service may be required to complete this discrepancy. Additional avionics charges will apply when: Current aircraft engineering, wiring, diagrams, supplements, and/or log entries are not correct. Existing aircraft systems and/or avionics equipment that is to coupled to newly installed avionics is not operating to current factory standards and modification status. Preexisting EMI / RFI interference problems, or those found because of newly installed equipment..

Governing Law

This agreement is construed as having been made in the State of California. Any lawsuit to interpret or enforce this Agreement shall be brought in the State of California and exclusive jurisdiction shall lie with the courts located in the County of Yolo.

I hereby authorize Woodland Aviation, Inc. to complete the above listed work that has been initialed approved, providing the cost does not exceed estimate more than 10%. Woodland Aviation, Inc. will notify owner or agent for the owner of any repair costs necessary in addition to the above items for approval before proceeding with any additional work.

Invoice



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: First Sierra Insurance Services, LLC

WO #: P18546

Invoice Number: INV20-00545

Item: 1. INSPECTION

Part/Model #: SR22

Item Serial Number:
Registration Number: N448LM
Aircraft Serial Number: 2893

Discrepancy: 1.1 PERFORM ANNUAL INSPECTION

OIL CHANGE DETAILS:
BLACKSTONE OIL SAMPLE.
TEMPEST OIL FILTER.
AEROSHELL 100W "PLUS" ENGINE OIL.

AIRWORTHY

Resolution: COMPLIED WITH AN ANNUAL INSPECTION THIS DATE PER FAR 43 APPENDIX D. ALL WORK COMPLETED IN ACCORDANCE WITH APPLICABLE MANUALS. AD'S CHECKED THROUGH BI-WEEKLY 2020-13.

DRAINED OIL AND REMOVED FILTER. OPENED FILTER AND INSPECTED FOR METAL AND DEBRIS; NO DISCREPANCIES NOTED. OIL SAMPLE RECOVERED AND SENT OUT FOR ANALYSIS. INSTALLED NEW FILTER AND SERVICED ENGINE WITH 7 QUARTS AEROSHELL 100W PLUS ENGINE OIL.

RUNUP AND LEAK CHECK NORMAL.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	3,240.00 USD	3,240.00 USD
Parts:	155.19 USD	---	155.19 USD
Freight:	8.50 USD	---	8.50 USD
Total:	163.69 USD	3,240.00 USD	3,403.69 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
1.1 #1	OIL SAMPLE KIT	ENG OIL ANALYSIS - BLACKSTONE KITS	1.00	29.50 USD	38.00 USD
			Freight:	8.50 USD	
1.1 #2	AA48108-2	Tempest Oil Filter	1.00	30.00 USD	30.00 USD
1.1 #3	M-674	GASKET 18MM COPPER	12.00	1.00 USD	12.00 USD
1.1 #4	NAS1523-8B	STAT-O-SEAL	1.00	5.33 USD	5.33 USD
1.1 #5	MS29513-137	SEAL	1.00	1.22 USD	1.22 USD
1.1 #6	51698-001	TEMPERATURE LABEL (20)	2.00	1.64 USD	3.28 USD
1.1 #7	51698-003	STICKER, TEMPERATURE SENSOR	2.00	1.02 USD	2.04 USD
1.1 #8	OIL004	AEROSHELL 100W PLUS QUARTS (DETERGENT + ADDITIVE)	7.00	10.26 USD	71.82 USD

Discrepancy: 1.2 COMPLY WITH DIFFERENTIAL COMPRESSION CHECK PER CMI STANDARD PRACTICES MAINTENANCE MANUAL.

AIRWORTHY

COMPRESSION TEST RESULTS:
#1- 60/80, #2- 61/80, #3- 60/80,
#4- 62/80, #5- 65/80, #6- 66/80.
MASTER ORIFICE: 40/80.

Resolution: COMPLIED WITH DIFFERENTIAL COMPRESSION CHECK PER CMI STANDARD PRACTICES MAINTENANCE MANUAL. COMPRESSION TEST RESULTS: #1- 60/80, #2- 61/80, #3- 60/80, #4- 62/80, #5- 65/80, #6- 66/80. MASTER ORIFICE: 40/80.



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: First Sierra Insurance Services, LLC

WO #: P18546

Invoice Number: INV20-00545

Discrepancy: 1.3 COMPLY WITH AIRCRAFT POST-INSPECTION TEST FLIGHT.

LEAK CHECK ENGINE/ENGINES AFTER TEST FLIGHT.

PREVENTIVE MAINTENANCE.

Resolution: COMPLETED TEST FLIGHT PER WOODLAND AVIATION POST-ANNUAL INSPECTION TEST FLIGHT CHECKLIST.

	Time & Materials	Flat Rate	Total
Labor:	0.00 USD	175.00 USD	175.00 USD
Total:	0.00 USD	175.00 USD	175.00 USD

Discrepancy: 1.4 COMPLY WITH FAR 91.207 (D) ELT INSPECTION.

BATTERY DUE: MARCH 2020.

REMOVE ELT. OPEN AND INSPECT FOR CORROSION. REPLACE BATTERY IF NECESSARY. CLOSE ELT AND TEST G-LIMIT SENSOR. REINSTALL ELT AND TEST WITH REMOTE SWITCH AS APPLICABLE.

AIRWORTHY

Resolution: REMOVED ELT BATTERY P/N 452-6499 S/N 358023-059. INSTALLED NEW ELT BATTERY P/N452-6499 S/N 386959-047.

COMPLIED WITH FAR 91.207 (D) BY INSPECTION AND OPERATIONAL TEST OF ELT WITH NO DEFECTS NOTED. SWITCH PLACED IN THE ARM POSITION.

BATTERIES DUE AUG / 2027

	Time & Materials	Flat Rate	Total
Parts:	244.15 USD	---	244.15 USD
Freight:	33.08 USD	---	33.08 USD
Total:	277.23 USD	0.00 USD	277.23 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
1.4 #1	455-0012	Artex ME406 Series, 5-year Lithium Pack, for ME406, ME406 HM, ME406 ACE, ME406/P Serial Number(s) 386959-047	1.00	244.15 USD	277.23 USD
				Freight:	33.08 USD

Discrepancy: 1.5 12-MONTH INSPECTION AND REWEIGH OF FIRE EXTINGUISHER IS DUE.

COMPLY WITH 12-MONTH VISUAL INSPECTION AND PHYSICAL REWEIGH.

AIRWORTHY

Resolution: COMPLIED WITH 12-MONTH INSPECTION AND REWEIGH OF PORTABLE FIRE EXTINGUISHER. WEIGHT = 2 LBS 9.1 OZ.



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: First Sierra Insurance Services, LLC

WO #: P18546

Invoice Number: INV20-00545

Discrepancy: 1.6 BRACKETT AIR FILTER INSTRUCTIONS FOR CONTINUED AIRWORTHINESS, 12-MONTH REPLACEMENT IS DUE.

REPLACE FILTER ELEMENT AS REQUIRED.

PREVENTIVE MAINTENANCE

Resolution: INSTALLED NEW BRACKETT INDUCTION AIR FILTER ELEMENT P/ N BA-24.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	33.75 USD	33.75 USD
Parts:	29.56 USD	---	29.56 USD
Total:	29.56 USD	33.75 USD	63.31 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
1.6 #1	BA-24	FILTER ELEMENT (ALT. 50207-200)	1.00	29.56 USD	29.56 USD

Discrepancy: 1.7 VERIFY CORRECT POSITION OF GAMI/TUNED FUEL INJECTION NOZZLES.

COMPLY WITH INSPECTION AS REQUIRED.

PREVENTIVE MAINTENANCE

Resolution: VERIFIED CORRECT POSITION OF GAMI/TUNED FUEL INJECTOR NOZZLES.

Discrepancy: 1.9 CHECK AIRWORTHINESS CERTIFICATE, VERIFY IT IS IN THE AIRCRAFT, AND HAS THE CURRENT N NUMBER.

CHECK REGISTRATION, VERIFY EXPIRATION DATE AND THAT IT IS ALSO IN THE AIRCRAFT.

Resolution: AIRWORTHINESS CERTIFICATE IS CORRECT AND IN AIRCRAFT

REGISTRATION EXPIRATION: 31 MAY 2022.

Discrepancy: 1.10 CIRRUS AIRFRAME PARACHUTE SYSTEM (CAPS) REEFING LINE CUTTERS 6 YEAR REPLACEMENT DUE.

INSTALL NEW REEFING LINE CUTTERS AS REQUIRED.

AIRWORTHY

Resolution: COMPLIED WITH CIRRUS AIRFRAME PARACHUTE SYSTEM (CAPS) REEFING LINE CUTTERS 6 YEAR REPLACEMENT. REMOVED REEFING LINE CUTTERS S/N 5829 AND 5841. INSTALLED NEW LINE CUTTERS KIT P/N 25347-002, S/N 16881 AND 17047, DATED 05/20. INSTALLED AND SECURED PER CIRRUS COMPONENT MAINTENANCE MANUAL FOR THE SR22 / SR22T CIRRUS AIRFRAME PARACHUTE SYSTEM, P/N 15994-001, REISSUE E3. DATED JAN 2016. NEXT 6 YEAR REPLACEMENT DUE 05/2026.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	150.00 USD	150.00 USD
Parts:	1,415.00 USD	---	1,415.00 USD
Freight:	91.68 USD	---	91.68 USD
Total:	1,506.68 USD	150.00 USD	1,656.68 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
1.10 #1	25347-002	KIT, LINE CUTTER REPLACEMENT, SR20/22 Serial Number(s) 17047 & 16881	1.00	1,415.00 USD	1,506.68 USD

Freight: **91.68 USD**



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: First Sierra Insurance Services, LLC

WO #: P18546

Invoice Number: INV20-00545

Discrepancy: 1.12 COMPLY WITH CIRRUS MANDATORY SB 2X-32-19R3, NOSE LANDING GEAR ASSEMBLY UPPER GUSSET PLATE INSPECTION.

PREVENTIVE MAINTENANCE

Resolution: COMPLIED WITH CIRRUS MANDATORY SB 2X-32-19R3, NOSE LANDING GEAR ASSEMBLY UPPER GUSSET PLATE INSPECTION. NO DEFECTS NOTED.

Item: 2. INTERIOR

Part/Model #: SR22

Item Serial Number:

Registration Number: N448LM

Aircraft Serial Number: 2893

Discrepancy: 2.2 CO-PILOTS SUN VISOR MOUNT LOOSE.

ACCESS CO-PILOTS SUN VISOR MOUNT AND SECURE HARDWARE.

SEE NOTE 1.

PREVENTIVE MAINTENANCE

Resolution: GAINED ACCESS TO CO-PILOTS SUN VISOR MOUNT AND TIGHTENED HARDWARES.

	Time & Materials	Flat Rate	Total
Labor:	0.00 USD	37.50 USD	37.50 USD
Total:	0.00 USD	37.50 USD	37.50 USD

Discrepancy: 2.3 CAPS PIN LOOSE IN HANDLE AND FALLING OUT.

INSTALL NEW CAPS PIN.

AIRWORTHY

Resolution: INSTALLED NEW CAPS PIN.

	Time & Materials	Flat Rate	Total
Parts:	30.00 USD	---	30.00 USD
Total:	30.00 USD	0.00 USD	30.00 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
2.3 #1	25027-001	SAFETY PIN	1.00	30.00 USD	30.00 USD

Item: 3. AIRFRAME

Part/Model #: SR22

Item Serial Number:

Registration Number: N448LM

Aircraft Serial Number: 2893

Item: 4. FUSELAGE AND TAIL

Part/Model #: SR22

Item Serial Number:

Registration Number: N448LM

Aircraft Serial Number: 2893

Invoice



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: First Sierra Insurance Services, LLC

WO #: P18546

Invoice Number: INV20-00545

Item: 5. WINGS

Part/Model #: SR22

Item Serial Number:

Registration Number: N448LM

Aircraft Serial Number: 2893



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: First Sierra Insurance Services, LLC

WO #: P18546

Invoice Number: INV20-00545

Item: 6. LANDING GEAR AND BRAKES

Part/Model #: SR22

Item Serial Number:

Registration Number: N448LM

Aircraft Serial Number: 2893

Discrepancy: 6.1 NLG PUCKS CRACKED AND EXCESSIVELY TIGHT ON UPPER PUCK PAN. (PROP TO GROUND HEIGHT ABOVE LIMITS)

DISASSEMBLE PUCK PAN. CLEAN AND INSPECT UPPER PAN FOR WEAR. REINSTALL WITH NEW PUCKS AND LOWER REBOUND BUMPER.

SEE NOTE 1.

PREVENTIVE MAINTENANCE

Resolution: DISASSEMBLED PUCK PAN AND INSPECTED. FOUND LOWER PUCK PAN FLANGED BUSHING WORN AND ABRAIDED CAUSING BIND ON UPPER PUCK PAN SHAFT.

REASSEMBLED NOSE GEAR ASSEMBLY WITH 6 NEW PUCKS P/N J-11968-10, NEW LOWER PUCK PAN P/N 18826-001, REBOUND BUMPER P/N 18380-001 AND SPACER BUSHINGS P/N 13705-004. TORQUED AND SAFETIED HARDWARE PER CIRRUS SR22 AMM 32-00.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	300.00 USD	300.00 USD
Parts:	2,771.53 USD	---	2,771.53 USD
Freight:	89.92 USD	---	89.92 USD
Total:	2,861.45 USD	300.00 USD	3,161.45 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
6.1 #1	J-11968-10	BONDED MOUNT (CIRRUS P/N 13386-001)	6.00	150.00 USD	900.00 USD
6.1 #2	MS24665-359	COTTER PIN, SPLIT	1.00	0.00 USD	0.00 USD
6.1 #3	18380-001	BUMPER, REBOUND, NLG SR22	1.00	115.00 USD	115.00 USD
6.1 #7	18826-001	PUCK PAN. Lower, SR20/SR22, Assy W/Bushings	1.00	1,756.53 USD	1,846.45 USD
		Freight:		89.92 USD	
6.1 #8	13705-004	SPACER,BUSHING,NLG	2.00	0.00 USD	0.00 USD



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: First Sierra Insurance Services, LLC

WO #: P18546

Invoice Number: INV20-00545

Discrepancy: 6.3 LEFT MLG TIRE TREAD WORN PAST MINIMUMS.

INSTALL NEW TIRE WITH TUBE AND BALANCE ASSEMBLY.

AIRWORTHY

Resolution: REMOVED OLD LH MLG TIRE AND TUBE. INSTALLED NEW LEFT MAIN TIRE P/N 070-449-0 S/N 9261S00208 AND NEW TUBE P/N 14076-002. TORQUED ALL ATTACHMENT TO SPEC PER CLEVELAND MM. SERVICED TIRE WITH AIR TO SPEC PER CIRRUS SR22 MM. BALANCED AND LEAK CHECKED. NO LEAK NOTED.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	225.00 USD	225.00 USD
Parts:	317.00 USD	---	317.00 USD
Freight:	20.15 USD	---	20.15 USD
Total:	337.15 USD	225.00 USD	562.15 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
6.3 #1	070-449-0	TIRE, 15X6.00-6 MICHELIN AIR: TT Serial Number(s) 9261S00208	1.00	220.00 USD	240.15 USD
			Freight:	20.15 USD	
6.3 #2	14076-002	MLG Tube, 15 X 6.00 X 6, TR-20	1.00	97.00 USD	97.00 USD

Discrepancy: 6.4 RIGHT MLG TIRE TREAD WORN PAST MINIMUMS.

INSTALL NEW TIRE WITH TUBE AND BALANCE ASSEMBLY.

AIRWORTHY

Resolution: REMOVED OLD RH MLG TIRE AND TUBE. INSTALLED NEW RIGHT MAIN TIRE P/N 070-449-0 S/N 9262S00187 AND NEW TUBE P/N 14076-002. TORQUED ALL ATTACHMENT TO SPEC PER CLEVELAND MM. SERVICED TIRE WITH AIR TO SPEC PER CIRRUS SR22 MM. BALANCED AND LEAK CHECKED. NO LEAK NOTED.

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Labor:	0.00 USD	225.00 USD	225.00 USD
Parts:	317.00 USD	---	317.00 USD
Freight:	20.15 USD	---	20.15 USD
Total:	337.15 USD	225.00 USD	562.15 USD

Parts:

<u>Ref. No.</u>	<u>Part number</u>	<u>Description</u>	<u>Quantity</u>	<u>Sell price</u>	<u>Extended</u>
6.4 #1	070-449-0	TIRE, 15X6.00-6 MICHELIN AIR: TT Serial Number(s) 9262S00187	1.00	220.00 USD	240.15 USD
			Freight:	20.15 USD	
6.4 #2	14076-002	MLG Tube, 15 X 6.00 X 6, TR-20	1.00	97.00 USD	97.00 USD

Item: 7. ELECTRICAL

Part/Model #: SR22

Item Serial Number:

Registration Number: N448LM

Aircraft Serial Number: 2893



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: First Sierra Insurance Services, LLC

WO #: P18546

Invoice Number: INV20-00545

Item: 8. ENGINE / PROP

Part/Model #: SR22

Item Serial Number:

Registration Number: N448LM

Aircraft Serial Number: 2893

Discrepancy: 8.1 CUSTOMER NOTED AT LAST ANNUAL, THE PROP GOV WAS ADJUSTED TO INCREASE RPM AND NOW IT OVERSPEEDS AND I HAVE TO THROTTLE BACK OR IT IS IN THE RED.

ADJUST FULL THROTTLE RPM.

LABOR INCLUDED WITH ANNUAL INSPECTION.

PREVENTIVE MAINTENANCE

Resolution: ADJUSTED ROD END AT GOVERNOR AND FOUND ROD END TO BE AT MAX ALLOWABLE ADJUSTMENT FOR RPM GAIN. REMOVED CONTROL CONSOLE AND ADJUSTED PROP CONTROL CABLE. AFTER ROTATING CABLE TWO TURNS WHICH WAS MAX ALLOWABLE RPM GAIN AT CONTROL QUADRANT. FLIGHT CHECK REQUIRED.

TAKEOFF RPM GOOD AT 2680.
ENGINE CRUISE RPM OUT OF SPEC AT 2480
(LIMIT 2500 TO 2525).

SEE WORK ORDER 18595.

Discrepancy: 8.3 CABIN AIR INTAKE NACA DUCT HOSE FROM COWL TO AIR MIX BOX TORN AND FALLING APART.

INSTALL NEW NACA DUCT TO FRESH AIR MIXING BOX.

PREVENTIVE MAINTENANCE

Resolution: INSTALLED NEW DUCT TO FRESH AIR MIXING BOX P/N 19629-001.

	Time & Materials	Flat Rate	Total
Parts:	95.00 USD	---	95.00 USD
Freight:	18.58 USD	---	18.58 USD
Total:	113.58 USD	0.00 USD	113.58 USD

Parts:

Ref. No.	Part number	Description	Quantity	Sell price	Extended
8.3 #1	19629-001	NACA DUCT, FRESH AIR MIXING BOX	1.00	95.00 USD	113.58 USD
				Freight:	18.58 USD



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: First Sierra Insurance Services, LLC

WO #: P18546

Invoice Number: INV20-00545

Item: 9. AVIONICS

Part/Model #: SR22

Item Serial Number:

Registration Number: N448LM

Aircraft Serial Number: 2893

Discrepancy: 9.1 CUSTOMER NOTED PILOT SIDE LEMO PLUG INOP.

ABOUT A WEEK AGO, IT SUDDENLY STOPPED. DUAL PLUGS STILL WORK BUT THAT LEMO PORT DOES NOT.

UNABLE TO DUPLICATE DISCREPANCY. TESTED ALL 4 HEADSETS IN PILOT'S POSITION WITH NO DISCREPANCIES NOTED. BEING THAT THE DUAL PLUGS STILL WORKED, RULES OUT A BAD AUDIO PANEL.

RECOMMEND CUSTOMER CONTINUE TO MONITOR AND ADVISE.

PREVENTIVE MAINTENANCE

Resolution: UNABLE TO DUPLICATE DISCREPANCY. PLUGGED ALL 4 HEADSETS IN AND TRIED EACH LEMO HEADSET IN THE PILOT'S POSITION WITH NO DISCREPANCIES NOTED. BEING THAT THE DUAL PLUGS STILL WORKED, THAT RULES OUT A BAD AUDIO PANEL. RECOMMEND CUSTOMER CONTINUE TO MONITOR AND ADVISE. (CB)

Item: 10. ADDITIONAL EXPENSES

Part/Model #: SR22

Item Serial Number:

Registration Number: N448LM

Aircraft Serial Number: 2893

Discrepancy: 10.1 ENVIRONMENTAL FEES (INCLUDES 2 TIRE AND 1 ELT BATT DISPOSAL FEES)

ANNUAL (OR PHASE) - \$100.00 SINGLE ENGINE

ADDITIONAL ENVIROMENTAL FEES WHICH MAY BE NECESSARY:

- 1) TIRE DISPOSAL- \$10.00 EACH
- 2) ELT BATTERY DISPOSAL- \$10.00 EACH
- 3) LEAD ACID BATTERY DISPOSAL - \$30.00 EACH
- 4) FREON HANDLING CHARGE - \$15.00

Resolution: ENVIRONMENTAL FEES

	<u>Time & Materials</u>	<u>Flat Rate</u>	<u>Total</u>
Services:	0.00 USD	130.00 USD	130.00 USD
Total:	0.00 USD	130.00 USD	130.00 USD

Discrepancy: 10.2 CLEAN AND DETAIL AIRCRAFT (ALSO USED AS APPLIED LABOR TO TOW AND FUEL AIRCRAFT - FUEL COST NOT INCLUDED).

Resolution: PERFORMED EXTERIOR AIRCRAFT WASH, INTERIOR VACUUM, AND WINDOW CLEANING.

Invoice



25170 Aviation Ave.
Davis, CA 95616

July 09, 2020

Telephone: 800-442-1333

Fax: 530-759-6035

Bill To: First Sierra Insurance Services, LLC

WO #: P18546

Invoice Number: INV20-00545

Item: 11. AIRCRAFT ARRIVAL AND DEPARTURE REQUIREMENTS

Part/Model #: SR22

Item Serial Number:

Registration Number: N448LM

Aircraft Serial Number: 2893

Discrepancy: 11.1 COMPLETE WOODLAND AVIATION QUALITY ASSURANCE AIRCRAFT INDUCTION GUIDE REQUIREMENTS:

AIRWORTHINESS CERTIFICATE CHECKED: 27 DEC 2007.
REGISTRATION DATE: 31 MAY 2022.

Resolution: COMPLETED WOODLAND AVIATION QUALITY ASSURANCE AIRCRAFT INDUCTION GUIDE REQUIREMENTS.

Discrepancy: 11.2 INITIATE WOODLAND AVIATION QUALITY ASSURANCE AIRCRAFT DEPARTURE GUIDE.

NOTIFY SERVICE MANAGER / LINE SERVICE / DIRECTOR OF MAINTENANCE / AND CUSTOMER SERVICE.

Resolution: COMPLETED WOODLAND AVIATION QUALITY ASSURANCE AIRCRAFT DEPARTURE GUIDE.

WOODLAND AVIATION INC
25170 AVIATION AVENUE
DAVIS, CA 95616
530-759-6036

Merchant ID: 9000
Term #: 2480

Store #: 0001
Ref #: 0003

Sale

XXXXXXXXXXXX6282

VISA

Entry Method: Manual

Total: \$ 10,912.14

07/15/20

12:17:18

Inv #: 000003

Appr Code: 01572G

Transaction ID: 300197694385221

Apprvd: OnLine

Batch#: 000173

AVS Code: ZIP MATCH Z

CVV2 Code: MATCH M

Customer Copy

THANK YOU
PLEASE COME AGAIN!