Clear Star Aviation

Repair Station No. 5CSR009B 4765 Frank Luke Dr Addison, Texas 75001 Phone: 972-267-2376

Fax: 972-267-2377 Date: 6/18/2009

Customer Invoice

Work Order: 112196

CUSTOMER INFORMATION

McCartney, Scott

Tom Hunse 14784 Winnwood Dallas, TX 75254 214-951-7104 scott.mccartney@wsj.com Reg. No: N262GM

2001 Cirrus SR20

Current A/C TT: 1616.8, Hobbs: 1616.8

A/C Serial: 1129

Item: 1 to 6 - Labor Kit: Isaiah's Sr-20 Annual Inspection Lis
--

Description of Labor KitHoursSubtotalIsaiah's Sr-20 100hr Inspection List(Kit)2,550.00

Complied with preliminary inspection. Hobbs: 1616.8.

Inspection Information:

Inspected: HUERTA, FRANCISCO on 06/10/09

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
2	ea	50802-001	Wellnut - 1032 Long		3.27	6.54
1	ea	50803-001	Wellnut - 1032 Short (P/O: MB-7212)		2.99	2.99
12	EA	M674	Gasket - ** USE PN: 50907-001 Spark Plug Gaskets (P/O: MB-7304)		0.74	8.88
2	ea	M83461-1-224	O-Ring		1.62	3.24
1	ea	MS29513-137	O-Ring (P/O: MB-7292)		1.27	1.27
1	ea	NAS1523-8B	Stat - O - Seal (P/O: MB-7292)		5.33	5.33
1	ea	1151	Oil Analysis Kit (P/O: MB-7315)		17.00	17.00
7	qt	AShell 15/50	Oil - AeroShell 15W50 (Qt) (P/O: MB-7315)		7.96	55.72
1	EA	CH48108-1	Oil Filter - Champion CH48108-1 (P/O: MB-7315)		31.55	31.55
1	STOCK	MS35769-11	GASKET		1.26	1.26

Item: 7 - Airworthy Airframe

DiscrepancyHoursSubtotalReplace vacuum central air filterN/C0.00

Corrective Action

Replaced vacuum central air filter with new.

Inspection Information:

Inspected: SAMMONS, ROBERT on 06/15/09

Qty Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1 ea	RAD9-18-1	Rapco Filter		42.00	42.00

Labor: \$0.00 **Parts:** \$42.00 **Shipping:** \$0.00 **Item Subtotal:** \$42.00

Item: 8 - Airworthy Airframe

Hours Subtotal Discrepancy N/C 0.00

Replace vacuum garter filter element

Corrective Action Replaced vacuum garter filter element with new.

Inspection Information:

Inspected: SAMMONS, ROBERT on 06/15/09

Qty Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1 ea	RAB3-5-1	Filter - Rapco Filter		4.00	4.00
Labor: \$0.00		Parts: \$4.00	Shipping: \$0.00	Item Subtotal:	\$4.00

Item: 9 - Airworthy Airframe

Hours Subtotal Discrepancy N/C 0.00

Turn Coordinator Emergency batteries are due replacement

Corrective Action

Replaced Turn Coordinator Emergency batteries with new.

Inspection Information:

-Functional Chk: SAMMONS, ROBERT on 06/15/09

-Inspected: SAMMONS, ROBERT on 06/15/09

Qty Unit	Part Number	Description	Serial Num	nber Unit Price	Subtotal
3 ea	MN1604	Duracell 9 vol	t battery	4.05	12.15
Labor: \$0.00		Darte: \$12.15	Shinning: \$0.00	Itom Subtotal:	¢12.15

Item: 10 - Airworthy Airframe

Discrepancy Hours Subtotal 1.50 127.50

R/H door latch - rough operation. Linkage is binding, need to remove door panels, adjust, and lubricate.

Corrective Action

Adjusted and lubricated copilots door latching mechanism.

Inspection Information:

·Functional Chk: SAMMONS, ROBERT on 06/16/09

Inspected: SAMMONS, ROBERT on 06/16/09

Parts: \$0.00 Shipping: \$0.00 \$127.50 Labor: \$127.50 Item Subtotal:

Item: 11 - Airworthy Airframe

Hours Subtotal **Discrepancy** ELT battery's due for replacement. 0.50 42.50

Corrective Action

Replaced ELT batteries with new. Batteries due replacement 6-2014.

Inspection Information:

·Functional Chk: SAMMONS, ROBERT on 06/16/09

-Inspected: SAMMONS, ROBERT on 06/16/09

Qty Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
8 ea	MN1300	Durcell D Battery		1.34	10.72
Labor: \$42.50		Parts: \$10.72	Shipping: \$0.00	Item Subtotal:	\$53.22

0.25

21.25

Item: 12 - Airworthy Airframe

Hours Subtotal Discrepancy 42.50 0.50

R/H Flap cover access panel is chaffing flap attach bracket slightly. (Blend and Treat)

Corrective Action

Blended damaged area of R/H flap cover and treated with Alodine.

Inspection Information:

Inspected: SAMMONS, ROBERT on 06/16/09

Item Subtotal: Labor: \$42.50 Parts: \$0.00 Shipping: \$0.00 \$42.50

Item: 13 - Airworthy Airframe

Hours Subtotal Discrepancy 1.50 127.50

Brake linings worn out and need replacement (Riveted style)

Corrective Action

Replaced all brake linings with new.

Inspection Information:

-Functional Chk: SAMMONS, TIMOTHY on 06/17/09

-In-process: SAMMONS, TIMOTHY on 06/17/09

Inspected: SAMMONS, TIMOTHY on 06/17/09

Qty U	nit l	Part Number	Description	Serial Number	Unit Price	Subtotal
4 EA	Α (066-14100	Brake Lining (P/O: MB-7339)		31.92	127.68
12 ea	a '	105-00200	Brake Rivet - Cleveland		0.52	6.24

Item Subtotal: Labor: \$127.50 Parts: \$133.92 Shipping: \$0.00 \$261.42

Item: 14 - Recommended

Hours Subtotal Discrepancy Tail tie down attach bracket has surface rust (Treat with ACF 50) N/C 0.00

Corrective Action

Treated tail tie down attach bracket with ACF 50.

Inspection Information:

Inspected: SAMMONS, ROBERT on 06/16/09

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	---------------	------------------	----------------	--------

Item: 15 - Recommended

Hours Subtotal **Discrepancy**

Comply with SA 02-09 Warning Placard for incorrect screw length and possible control malfunction

MB-7338)

Corrective Action Complied with SA 02-09 by installing warning placard to close out panel.

Inspection Information:

·Inspected: SAMMONS, ROBERT on 06/16/09

Qty Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1	14685-001	PLACARD, ACCESS PANEL, ELEVATOR TORQUE TUBE (P/O:		0.90	0.90

Labor: \$21.25 Shipping: \$0.00 Item Subtotal: \$22.15 **Parts:** \$0.90

Item: 16 - Airworthy Airframe

Hours Subtotal Discrepancy

2.50 Elevator pitch trim motor arm bolt loose (Need to remove the motor and torque screws holding assembly to linkage.)

212.50

21.25

Corrective Action

Tightened Elevator pitch trim motor arm rod end bolt and base plate screws.

Inspection Information:

·Functional Chk: SAMMONS, ROBERT on 06/17/09

-Inspected: SAMMONS, ROBERT on 06/17/09

Labor: \$212.50 Parts: \$0.00 Shipping: \$0.00 **Item Subtotal:** \$212.50

Item: 17 - Recommended

Discrepancy Hours Subtotal

Flaps on both sides have numberous chafe spots (Treat areas with ACF 50) Chafing appears to have stopped and this would cover treating metal to prevent corrosion from occuring.

0.25

Corrective Action

Cleaned and treated chafe spots and flaps with ACF 50.

Inspection Information:

Inspected: SAMMONS, ROBERT on 06/16/09

Labor: \$21.25 Parts: \$0.00 Shipping: \$0.00 **Item Subtotal:** \$21.25

Item: 18 - Airworthy Airframe

Discrepancy Hours Subtotal

Elevator cables tensions low and needs adjustment. 1.50 127.50

Corrective Action

Adjusted Elevator cables tensions.

Inspection Information:

-Functional Chk: SAMMONS, ROBERT on 06/16/09

-Inspected: SAMMONS, ROBERT on 06/16/09

\$127.50 Labor: \$127.50 Parts: \$0.00 Shipping: \$0.00 Item Subtotal:

Item: 20 - Airworthy Airframe

Hours Subtotal Discrepancy

AFT engine baffle cracked above oil cooler. (fabricate doubler and install)

0.62 52.70

Corrective Action

No doubler required. Stopped drilled and deburred AFT engine baffle cracked .

Inspection Information:

Inspected: SAMMONS, ROBERT on 06/17/09

Labor: \$52.70 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$52.70

Item: 21 - Airworthy Airframe

Hours Subtotal Discrepancy

#4 Intake pipe cracked on intake tube flange. Weld repair is not possible due to area part is cracked.

1.50

127.50

Corrective Action

Replaced #4 intake tube with new P/N: 649264.

Inspection Information:

Inspected: SAMMONS, ROBERT on 06/17/09

Notes:

I will check to see if I can get better pricing. This is from Cirrus who does have the part in stock.

Qty Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1 ea	629925	Gasket - Intake Manifold Gasket		2.63	2.63
1	649264	Induction Tube - #4 Cylinder (P/O: MB-7340) (Ship: 18.00)		525.94	525.94

Labor: \$127.50 Item Subtotal: \$674.07 Parts: \$528.57 **Shipping:** \$18.00

Item: 22 - Airworthy Airframe

Hours Subtotal Discrepancy Small crack in L/H baffle forward outboard edge (stop drill) 0.09 7.65

Corrective Action

Stop drilled crack.

Inspection Information:

-Inspected: SAMMONS, ROBERT on 06/16/09

Labor: \$7.65	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$7.65
----------------------	---------------	------------------	----------------	--------

Item: 23 - Airworthy Airframe

Hours Subtotal Discrepancy 0.50 42.50

Two rivets behind Air "Y" intake sheared (Install cherry max rivets)

Corrective Action

Resecured induction support bracket to aft engine baffling.

Inspection Information:

Inspected: SAMMONS, ROBERT on 06/16/09

Qty Unit Par	rt Number	Description	Serial Number	Unit Price	Subtotal
2 STOCK CR	3243-4-3	RIVET		1.22	2.44
Labor: \$42.50	Parts:	\$2.44	Shipping: \$0.00	Item Subtotal:	\$44.94

Item: 24 - Airworthy Airframe

Hours Subtotal Discrepancy 0.25 21.25 R/H baffle cracked at forward outboard edge (stop drill)

Corrective Action

Stop drilled crack.

Inspection Information:

Inspected: SAMMONS, ROBERT on 06/16/09

Labor: \$21.25 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$21.25 Item: 25 - Airworthy Airframe

DiscrepancyHoursSubtotalBattery terminals have minor corrosionN/C0.00

Corrective Action

Cleaned corrosion from battery terminals.

Inspection Information:

·Functional Chk: SAMMONS, TIMOTHY on 06/16/09

·In-process: SAMMONS, TIMOTHY on 06/16/09

Inspected: SAMMONS, TIMOTHY on 06/16/09

 Labor: \$0.00
 Parts: \$0.00
 Shipping: \$0.00
 Item Subtotal:
 \$0.00

Item: 26 - Airworthy Airframe

DiscrepancyHoursSubtotalL/H NLG wheel pant bracket cracked0.5042.50

Corrective Action

Replaced L/H nose wheel pant bracket with new.

Inspection Information:

Inspected: SAMMONS, ROBERT on 06/15/09

Qty UnitPart NumberDescriptionSerial NumberUnit PriceSubtotal1 ea11799-003Pant Bracket - NLG Pant (P/O:54.2854.28

MB-7316)

 Labor:
 \$42.50
 Parts:
 \$54.28
 Shipping:
 \$0.00
 Item Subtotal:
 \$96.78

Item: 27 - Airworthy Airframe

DiscrepancyHoursSubtotalLanding light lens cracked and landing light vibration mounts are cracked.1.0085.00

Corrective Action

Replaced landing light lens and landing light vibration mounts with new.

Inspection Information:

·Inspected: SAMMONS, ROBERT on 06/15/09

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
2 6	ea	14502-003	Vibration Mount - Spec Control		6.95	13.90
1 6	ea	14526-003	Lens - Landing Light		13.76	13.76

 Labor:
 \$85.00
 Parts:
 \$27.66
 Shipping:
 \$0.00
 Item Subtotal:
 \$112.66

Item: 28 - Recommended

DiscrepancyHoursSubtotalAlt #1 500hr internal inspection is dueRejected0.00

Corrective Action

Customer declined any corrective action at this time.

<u> </u>	ty Unit	Part Number	Description	Serial Numbe	r Unit Price	Subtotal
	0	Misc	Cost TBD		0.00	0.00
Labor	: \$0.00		Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00

Item: 29 - Airworthy Airframe

Discrepancy Hours Subtotal

ELT Remote Panel battery is due replacement

1.00

85.00

Corrective Action

Replaced battery in ELT remote panel with new. Battery due replacement 6-2013.

Inspection Information:

·Functional Chk: SAMMONS, TIMOTHY on 06/18/09

·In-process: SAMMONS, TIMOTHY on 06/18/09

Inspected: SAMMONS, TIMOTHY on 06/18/09

Qty Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1 ea	2CR11108	Duracell 6V Battery		6.00	6.00
Labor: \$85.00		Parts: \$6.00	Shipping: \$0.00	Item Subtotal:	\$91.00

Item: 30 - Recommended

Discrepancy Hours Subtotal

Fuel injectors are due 300hr cleaning.

Rejected 0.00

Corrective Action

Customer declined any corrective action at this time.

 Labor:
 \$0.00
 Parts:
 \$0.00
 Shipping:
 \$0.00
 Item Subtotal:
 \$0.00

Item: 31 - Recommended

DiscrepancyHoursSubtotalCabin air control assembly due 500hr inspectionRejected0.00

Corrective Action

Customer declined any corrective action at this time.

 Labor:
 \$0.00
 Parts:
 \$0.00
 Shipping:
 \$0.00
 Item Subtotal:
 \$0.00

Item: 32 - Airworthy Airframe

DiscrepancyHoursSubtotalReoccuring AD 2008-11-18 Exhaust Inspection is Due0.5042.50

Corrective Action

Complied with AD 2008-11-18 in accordance with SB 2X-78-07. Next inspection due at 1716.8 TT.

Inspection Information:

·In-process: SAMMONS, TIMOTHY on 06/16/09

-Inspected: SAMMONS, TIMOTHY on 06/16/09

 Labor:
 \$42.50
 Parts:
 \$0.00
 Shipping:
 \$0.00
 Item Subtotal:
 \$42.50

Item: 33 - Recommended

Discrepancy Hours Subtotal

Comply with SB 2X-25-07 R4 Dual Inertial Reel Seat Belt Installation

eat Belt Installation 3.00 255.00

Corrective Action

Complied with SB 2X-25-07 R4 Dual Inertial Reel Seat Belt Installation by installing Kit P/N 70076-001-8013.

Inspection Information:

·Inspected: DAW, ISAIAH on 06/18/09

Qty Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1 ea	70076-001-8013	Dual Inertia Reel Installation Kit - Gray		338.08	338.08

(15.00 % discount)

Labor: \$255.00 **Parts**: \$338.08 **Shipping**: \$0.00 **Item Subtotal**: \$593.08

Item: 34 - Recommended

DiscrepancyHoursSubtotalFinal saftey inspectionN/C0.00

Corrective Action

Performed Final saftey inspection.

Inspection Information:

Inspected: SAMMONS, TIMOTHY on 06/18/09

 Labor:
 \$0.00
 Parts:
 \$0.00
 Shipping:
 \$0.00
 Item Subtotal:
 \$0.00

Additional Charges Pilot Services Tire Disposal Disposal Fees Oil Analysis Shop Supplies Fuel Misc. Subtotal 0.00 0.00 7.00 0.00 141.19 0.00 0.00 \$148.19 **Total Labor:** \$4,034.10 **Labor Summary** Shop Labor: \$4,034.10 Outside Repair: \$0.00 **Total Parts:**

Taxed Items:

Shop Parts, OSR Parts

Total Parts: \$1,294.50

Total Shipping: \$18.00

Additional Charges: \$148.19

Tax: \$106.80

Amount Due: \$5,601.59 **Deposit:** \$0.00

Balance Due: \$5,601.59

Important Information

McCartney, Scott or Authorized Representative Date