

The Standard
AIRCRAFT LOG

ASA-SA-2

Reg. # N256DB
Make: Beechcraft
Model: A36

Taylor Aviation, Inc.
93 Hangar Rd., Montgomery NY 12549
Airframe

Date: 05/06/10
Tach/Hobbs: 2215.2

Installed new static wick base and discharger on RH elevator. Serviced ships battery and verified charge rate. Installed new LH wing strobe trigger coil # 55-0073-11. Installed new LH wingtip lamp lens cover.

$$x \sim c$$

Philip A. Criscenzo

A&P / IA 14344919

**TODAYS
FLIGHT**

**TOTAL
TIME IN
SERVICE**

Description of Inspections, Tests,

Entries must be endorsed with Name, Rating and Certificate Number of
Technician or Repair Facility. (See back pages for other specific entries.)

Reg. # _____
Make: _____
Model: _____

N256DB

Beechcraft

A36

Taylor Aviation, Inc.

93 Hangar Rd., Montgomery NY 12549

Airframe

Date: 10/07/09
Tach/Hobbs: 2190.1
Total Time: 2190.1

Complied with AD 2008-13-17 Circuit Breaker switch replacement by installing new switches as required.
1 Ea. 35-380132-63, 1 Ea. 35-380132-73, 1 Ea. 35-380132-99, 3 Ea. 35-380132-101, 4 Ea. 35-380132-
103. performed maintenance operational function checks with no discrepancies noted.

Removed / Installed repaired KEA-130A Encoding Altimeter P/N 066-03064-0005 S/N 28010 under
Georgetown Instruments WO # W10915 (See Attached Form 8130-3). Performed maintenance ground
function test and flight test with no discrepancies noted at this time. Customer advised aircraft will need
IFR certification.

Replaced RH aileron static wick and base. Painted as required.


X

Philip A. Criscenzo

A&P / IA 14344919

ING	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
			Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

Reg. # N256DB *Taylor Aviation, Inc.* Date: 10/08/09
 Make: Beechcraft 93 Hangar Rd., Montgomery NY 12549 Tach/Hobbs: _____
 Model: A36 **Airframe** Total Time: _____

Researched AD2009-16-03 on Superior Cylinders. This AD does not apply due to TCM cylinders installed at this time.

Researched AD2009-19-07 on TCM Cylinders. This AD does not apply by date of cylinder manufacture.

No further action is required at this time. -----END-----

 Philip A. Criscenzo A&P / IA 14344919

RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)	
			Reg. # <u>N256DB</u>	<i>Taylor Aviation, Inc.</i>

Make: <u>Beechcraft</u>	93 Hangar Rd., Montgomery NY 12549	Date: <u>01/13/2010</u>
Model: <u>A36</u>	Airframe	Tach/Hobbs: <u>2195.6</u>
		Total Time: <u>2195.6</u>

Inspected aircraft in accordance with FAR 43.13 Appendix D and Beechcraft Guide. Performed landing gear retraction and extension tests including emergency operation. Lubricated as required per Beechcraft requirements. Replaced instrument air system filters in primary and backup systems. Inspected and tested ELT per FAR 91.207 as required. ELT battery next due replacement 12/2010. Serviced engine with oil and filter. Replaced induction air filter. Replaced worn panel hardware as required. Repacked and serviced nose strut. Replaced rusty screws securing elevator balance weights. Replaced fuel cap o-rings. Replaced frayed inboard flap bonding jumper. Resealed windshield. Cleaned and treated wing attachment bathtub drains. Cleaned battery terminals and replaced battery box grommets. Installed winterization plate by request. Replaced worn hardware securing LH exhaust tailpipe. Replaced cabin air inlet duct clamp. Fabricated sheetmetal repair to cabin air duct clamp mounting surface. Verified Airworthiness Directive compliance through this date with Avantext and Federal libraries. CW AD 76-07-12 by inspection of ignition switch. CW AD 84-26-02 by replacement of filter element. C/W AD 2007-08-04 on McCauley Propeller by installation of a placard as close to the tachometer as possible with operational limitations as required and completed the recurring inspection required per ASB248. AD 2009-24-52 superseeded AD 2009-24-51 does not apply as no affected hydraulic lifters have been installed. AD 2009-25-01 on incorrect shoulder harness washers superseeded AD 91-18-19 does not apply by aircraft serial number. Performed maintenance operational inspection and cockpit function checks with no further discrepancies noted at this time. I Certify this Aircraft has been inspected in accordance with an ANNUAL INSPECTION and has been found to be in an Airworthy Condition.

END

Philip A. Criscenzo

A&P / IA 14344919

Reg. # N256DB
Make: Beechcraft
Model: A36

Taylor Aviation Inc.

93 Hangar Rd., Montgomery NY 12549

Airframe

Date: 11/08/10
Tach/Hobbs: 2250.3
Total Time: 2250.3

Removed / reinstalled encoding altimeter after repair with Georgetown Instrument Svcs. Inc. WO. # 6266 (see 8130-3 form tracking # W13385 for details) . Performed maintenance function checks with no further discrepancies noted at this time. -----END-----



Philip A. Criscenzo

A&P / IA 14344919

TODAYS
FLIGHT
TIME IN
SERVICE**Description of Inspections, Tests, Repairs and Alterations**
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)Reg. # N256DB
Make: Beechcraft
Model: A36*Taylor Aviation, Inc.*

93 Hangar Rd., Montgomery NY 12549

AirframeDate: 02/16/2011
Tach/Hobbs: 2265.5
Total Time: 2265.5

Inspected aircraft in accordance with FAR 43.13 Appendix D and Beechcraft Guide. Performed landing gear retraction and extension tests including emergency extension. Lubricated as required per Beechcraft requirements. Replaced instrument air system filters in primary and backup systems. Replaced ELT battery. Inspected and tested ELT per FAR 91.207 as required. **ELT battery next due replacement 01/2013.** Serviced engine with oil and filter. Replaced induction air filter. Replaced worn panel hardware as required. Relined RH/LH brakes. Repacked RH/LH brake calipers. Serviced and bled cabin bulkhead. Replaced missing screws securing cabin fascias. Secured cabin crew door seal. Resealed windshield as required. Replaced inoperative fuel selector post lamp. Cleaned debris from fuselage belly drains. Cleaned lower beacon lamp and lens assy. Repaired A/C compressor clutch actuator wiring. Replaced worn cabin floorboard anchor nut plates as required. Secured loose Velcro on interior carpets. Repaired crack in plastic cabin heat floorboard ducting. Replaced RH muffler # 701-19 with Dawley O/H/E under W.O # 103114 dated 01/27/11. Replaced RH/LH muffler to tailpipe exhaust coupler hardware. Fabricated repairs to rigid engine baffles. Fabricated repair to LH rear engine baffle oil cooler mounting tab. Installed new cabin air inlet duct # 115167DXX081343 and Cabin Heat Inlet Duct # 115167DXX121323. Verified Airworthiness Directive compliance through this date with Avantext and Federal libraries. CW AD 76-07-12 by inspection of ignition switch. CW AD 84-26-02 by replacement of filter element. C/W AD 2007-08-04 on McCauley Propeller by verification of a placard as close to the tachometer as possible with operational limitations as required and completed the recurring inspection required per ASB248. AD 2010-11-04 on TCM excessive hydraulic lifter wear does not apply by records inspection as this engine has not had any lifters replaced after June 19, 2009. Performed maintenance operational inspection and cockpit function checks with no further discrepancies noted at this time. **I Certify this Aircraft has been inspected in accordance with an ANNUAL INSPECTION and has been found to be in an Airworthy Condition.**

END

x

Philip A. Criscenzo

A&P / IA 3491550

TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
----------------	-----------------------	--

Reg. # N256DB
 Make: Beechcraft
 Model: A36

Taylor Aviation, Inc.

93 Hangar Rd., Montgomery NY 12549

Airframe

Date: 02/01/12
 Tach/Hobbs: 2307.2
 Total Time: 2307.2

Inspected aircraft in accordance with FAR 43.13 Appendix D and Beechcraft Guide. Performed landing gear retraction and extension tests including emergency extension. Lubricated as required per Beechcraft requirements. Replaced instrument air system filters in primary and backup systems. Inspected and tested ELT per FAR 91.207 as required. **ELT battery next due replacement 01/2013.** Serviced engine with oil and filter. Replaced induction air filter. Replaced worn panel hardware as required. Replaced inoperative flap down limit lamp. Adjusted main landing gear door travel limits. Adjusted landing gearbox sector gear travel limits. Replaced LH main tire. Fabricated repair to worn floorboard forward of center seats. Replaced worn nose steering collar grease fitting. Replaced Turn and Bank indicator with Mid Continent overhauled exchanged unit P/N 1394T100-3Z S/N 2003-420 per W.O # WRK0191185 dated 12/29/11. Repaired connections to inoperative standby alternator annunciator lamp. Adjusted propeller static RPM setting as required. Replaced worn tyrap securing wiring behind panel as required. Rerouted cooling duct chafing on AC drive pulley. Replaced worn oil dipstick cover seal. Cleaned induction airbox. Verified Airworthiness Directive compliance through this date with Avantext and Federal libraries. CW AD 76-07-12 by inspection of ignition switch. CW AD 84-26-02 by replacement of filter element. C/W AD 2007-08-04 on McCauley Propeller by verification of a placard as close to the tachometer as possible with operational limitations as required and completed the recurring inspection required per ASB248. Performed maintenance operational inspection and cockpit function checks with no further discrepancies noted at this time. **I Certify this Aircraft has been inspected in accordance with an ANNUAL INSPECTION and has been found to be in an Airworthy Condition.**

END


 Philip A. Criscenzo

A&P / IA 3491550

RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
			Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

Reg. # N256DB
 Make: Beechcraft
 Model: A36

93 Hangar Rd., Montgomery NY 12549

Taylor Aviation Inc.

Airframe

Date: 02/01/2012
 Tach/Hobbs: 2308.0
 Total Time: 2308.0

Serviced and installed new Gill G242 battery S/N G02685382 this date. Performed battery load test as required. Installed replacement Dry Air Pump with serviceable used unit P/N AA3216CW, S/N 60633 with 149.1 Hours Time In Service since overhaul with Aero Accessories, Inc. under W.O. # 61230. Performed post maintenance function tests with no discrepancies noted at this time. -----END-----

Philip A. Criscenzo

A&P / IA 3491550

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

— MAKE:
— MODEL:
— S/N:
— REG. NO: N256DB
— WORK ORDER: 9685



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 2/2/2012
A/C TSN: 2308.1
TACH:

Airframe Entries

(1) Inspect aircraft using Hawker BeechCraft manual 36-590001-1G11 Guidelines for 100 hr Inspection. Inspect airframe and related components, jack aircraft. Inspect and perform operation check of landing gear, emergency retraction and dynamic brake function. Check and verify operation of electrical system and installed avionics, flight test aircraft normal.

— Airframe TT = 2308.1
— Engine TT = 1534.17
— Propeller TTSMOH = 563.08

— Annual due: 2/2013
91 411 & 91 413: 10-2012
— ELT Battery Due: 01/2013

— The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 2/2/2012

SIGNED:

Frank R Galella

IA#2764795

Work Order: 9685

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE:
MODEL:
S/N:
REG. NO 256DB
WORK ORDER: 9757



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 4/16/2012

A/C TSN: 2318.1

TACH:

Airframe Entries

(1) INSTALL REPAIRED AUDIO PANEL P/N 011-00401-10 S/N 96265487, OPS CHECK OK.
1 of 1

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 4/16/2012

SIGNED:

Frank R Galella, IA: 2764795

Work Order: 9757

Printed by EBis 3 (datcomedia.com)

MAKE:
MODEL:
S/N:
REG NO 256DB
WORK ORDER: 9798



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 5/16/2012

A/C TSN: 2324.1

HOBBS: 2324.1

Airframe Entries

(2) Replace landing light bulb with new 4596. Operational check OK... (3) replace instrument regulator filter with new B3-5-1.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 5/16/2012

SIGNED:

Frank R Galella, IA: 2764795

Work Order: 9798

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE
<u>DATE</u>			

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of
Technician or Repair Facility. (See back pages for other specific entries.)

FAR 91.411 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Altimeter and Static tests required by FAR 91.411 were performed in accordance with and comply to Appendix E of Part 43. Aircraft N# 256013 altimeters are certified for a maximum altitude of 20,000 feet. The aircraft is returned to service.

Altimeter #1 P/N 066-03064-0005 S/N 28010

Altimeter #2 P/N 123456789 S/N 9/24/12 A 1057
Signature John Doe Date 9/24/12 Work Order # 1057

FAR 91.413 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Transponder tests required by FAR 91.413 were performed in accordance with and comply to Appendix F of Part 43. The aircraft is returned to service.

Transponder #1 P/N 066-01141-0101 S/N 12677

Transponder #1 P/N _____ S/N _____

Signature _____ Date _____ Work Order # _____

Correction Card

lobe

Standard Altitude	Altimeter Reading	Standard Altitude	Altimeter Reading
-1,000	-1000		9980
0	-0	10,000	1980
500	500	12,000	1960
1,000	1000	14,000	1940
1,500	1500	16,000	1920
2,000	2000	18,000	1900
3,000	3000	20,000	1880
4,000	4000	22,000	1860
6,000	6010	25,000	1840
8,000	7980	30,000	1820
		35,000	1800

Date: 9/24/12 Tested By AK W.O. #: 41
25G023 4-1 Aviation CR5/8 LICPR 10/16

RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
			Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)



Lincoln Park Aviation

Repair Station No. LKPR101K
 425 Beaverbrook Road
 Lincoln Park, NJ 07035
 Phone: 973-633-0450

DATE: 10/9/2012
 A/C TSN: 2353:3
 HOBBS: 2353:3

0: 256DB
 ORDER: 9964

Line Entries

ALL JP INSTRUMENTS TEMPERATURE MONITORING SYSTEM EDM730, IN ACCORDANCE WITH STC SA2586NM. INSTALL JP
 MENTS FUEL FLOW TRANSDUCER IN ACCORDANCE WITH STC SA00432SE. UPDATE WEIGHT AND BALANCE, 337 FILED WITH THIS
 (5) REPLACE BATTERY BOX VENT TUBE WITH NEW.... (6) COMPLIED WITH IFR CERTIFICATION, SEE W/O # A1057

aft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the
 Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed

0/9/2012

SIGNED:

Frank R Galella
 Certified Repair Station No. LKPR101K

Inspector 2

Work Order: 9964

Printed by EBis 3 (datcomedia.com)

Changed Taxi lights with
 Western PMA'd L-100 P2R36
 Part 01-0771421-25

41C#

3188725

Frank

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
DATE				

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 10089



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 3/22/2013
A/C TSN: 2373.1
HOBBS: 2373.1

Airframe Entries

(1) ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY. CHECKED ALL CONTROLS AND LUBED AS NEEDED. REMOVED ALL INSPECTION PLATES. CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91.207 PARAGRAPHS (C) AND (D). AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S... (4) RESEARCH AND COMPILED LIST OF AIRWORTHY DIRECTIVES... (5) AD2012-03-06 NOT APPLICABLE TO THIS AIRCRAFT... (6) REMOVE AND REPLACE ELT BATTERY WITH NEW NEXT DUE 03-2015... (7) REMOVE AND REPLACE LEFT FUEL DRAIN WITH NEW PART # TSO-C76, NO LEAKS FOUND OPERATIONAL CHECK SATISFACTORY... (8) REPLACE RECTIFIER DIODE FOR STANDBY ALTERNATOR PART # 70HF-10... (12) ADJUST MAIN GEAR STRUTS FOR CORRECT EXTENSION AND SERVICE WITH 5606 AND N2

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 3/22/2013

SIGNED:

Work Order: 10089

Frank R Galella, JA: 2764795

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 10078



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 3/7/2013
A/C TSN: 2353.3
HOBBS: 2353.3

Airframe Entries

(1) REPLACE RIGHT LEADING EDGE WITH ORIGINAL HAWKER BEECHCRAFT PARTS. PAINT TO MATCH

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 3/7/2013

SIGNED:

Work Order: 10078

Frank R. Galella, IA: 2764795

Printed by EBis 3 (datcomedia.com)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 10118



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 4/25/2013
A/C TSN: 2373.1
HOBBS: 2373.1

Airframe Entries

(1) REMOVE AND REPLACE TIRE AND TUBE WITH NEW

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 4/25/2013

SIGNED:

Work Order: 10118

Frank R. Galella, IA: 2764795

Printed by EBis 3 (datcomedia.com)

YEAR: ATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
--------------	---------------------------	------------------	-----------------------------	---

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 10245



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

L

DATE: 8/7/2013
A/C TSN: 2417.6
HOBBS: 2417.6

Airframe Entries

(1) TROUBLESHOOT AIR CONDITIONER CHECK FOR LEAKS SERVICE WITH 2.4 R134A, I/A/W MM NO LEAKS FOUND OPERATIONAL CHECK
SATISFACTORY... (2) INSTALLED NEW GASCOLATOR DOOR LOCK I/A/W MM OPERATIONAL CHECK SATISFACTORY... (3) REPAIR FUEL
SHUTOFF VALVE STOP OPERATIONAL CHECK SATISFACTORY

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the
Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed
below.

DATE: 8/7/2013

SIGNED:

Frank R Galella, IA/2764795


Inspector 2

Work Order: 10245

Printed by EBis 3 (datcommedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
DATE				

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 10369



Lincoln Park Aviation

Repair Station No. LKPR101K
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

L

DATE: 11/22/2013
A/C TSN:
HOBBS: 2438.5

Airframe Entries

(1) REMOVED AND REPLACED BOTH LEFT AND RIGHT MAIN LANDING GEAR TIRES WITH NEW. REPACK ALL MAIN WHEEL BEARINGS. CHECK FOR CORRECT AIR PRESSURE. OPERATE LANDING GEAR RETRACTION. OPERATIONAL CHECK SATISFACTORY.... (2) REMOVED AND REPLACED DISC BRAKE PADS WITH NEW.... (3) REBUILT DISC BRAKE CALIPERS. LEFT AND RIGHT MAIN WHEELS USING NEW SEALS P/N MS28775-222. BLEED SYSTEM. REPLACED FLUID. OPERATIONAL CHECK SATISFACTORY.... (5) REMOVED AND REPLACED LIFT DETECTOR WITH NEW. REMOVED P/N. 151-10, S/N:278010. INSTALLED P/N:151-10, S/N:4504735237.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 11/22/2013

SIGNED:

Frank R Galella
Certified Repair Station No. LKPR101K

Work Order: 10369

2764795AP

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 10399



Lincoln Park Aviation
Repair Station No. LKPR101K
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 12/27/2013
A/C TSN:
HOBBS: 2439

Airframe Entries

(1) REMOVED AND REPLACED BATTERY WITH NEW P/N: G-243, S/N: G02783534 I/A/W MM. OPERATIONAL CHECK SATISFACTORY.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 12/27/2013

SIGNED:

Work Order: 10399

Frank R Galella
Certified Repair Station No. LKPR101K

Printed by EBis 3 (datcomedia.com)

ATP2764795

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 10470



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 4/2/2014
A/C TSN: 2462.4
HOBBS: 2462.4

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY. CHECKED ALL CONTROLS AND LUBED AS NEEDED REMOVED ALL INSPECTION PLATES. CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91.207 PARAGRAPHS (C) AND (D). AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S... (4) COMPLIED WITH RESEARCH AD LIST.... (6) INSTALLED NEW TERMINAL END ON WIRES NEAR COWL HORIZON SUPPORT.... (7) TROUBLE SHOT HEATING SYSTEM. REMOVED FIRE WALL INSULATION COVERING PILOT HEAT DUCT.... (8) RE ROUTED RIGHT RUDDER CABLE RIG AND ADJUSTED CABLE TENSION I/A/W BEECH MAINTENANCE MANUAL 27-20-00 PARA 23 INSTRUCTIONS. OPS CHECK OK... (9) RE SECURED FLAP CONTROL SWITCH TO INSTRUMENT PANEL. OPS CHECK OK.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 4/2/2014

SIGNED:

IA#2764795

Work Order: 10470

Frank R Galella, IA: 2764795

Printed by EBis 3 (datcommedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE
DATE			

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 10617



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 8/15/2014
A/C TSN: 2485.2
HOBBS: 2485.2

Airframe Entries

(1) INSTALL AERO SPACE SYSTEMS AND TECHNOLOGIES TKS ICE PROTECTION SYSTEM IN ACCORDANCE WITH STC SA 2239CE. INSTALLATION ACCOMPLISHED USING INSTALLATION INSTRUCTIONS DOCUMENT 4500IMS, REV13 DATED 16 NOVEMBER 2006. GENERAL PRACTICES MANUAL 30-09-46. ALSO USED FOR TKS COUPLING AND TUBING REFERENCE. 337 & WEIGHT AND BALANCE UPDATED TO REFLECT ALL CHANGES POH SUPPLEMENT 4500-FMS ADDED TO AIRCRAFT MANUAL. REV DATE 07 JAN 2007. FUNCTIONAL CHECK AND FLIGHT CHECK OF SYSTEM OK.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 8/15/2014

SIGNED:

Frank R Galella, IA: 2764796

Work Order: 10617

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE: _____
 MODEL: _____
 S/N: _____
 REG. NO: 256DB
 WORK ORDER: 10623



Lincoln Park Aviation

425 Beaverbrook Road
 Lincoln Park, NJ 07035
 Phone: 973-633-0450

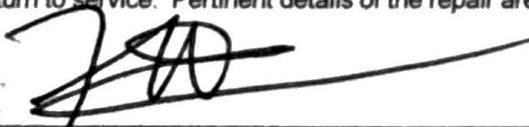
L
 DATE: 8/15/2014
 A/C TSN: 2485.2
 HOBBS: 2485.2

Airframe Entries

(1) REMOVED AND REPLACED FLAP MOTOR WITH NEW P/N: D160-00-3, S/N: APW493, I/A/W M.M. OPERATIONAL CHECK SATISFACTORY.... (2)
 REMOVED AND REPLACED STATIC WICK AND BASE ON RIGHT ELEVATOR WITH NEW.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 8/15/2014

SIGNED: 

Work Order: 10623

Frank R Galella, IA: 2964795

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE
DATE			

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

FAR 91.411 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Altimeter and Static tests required by FAR 91.411 were performed in accordance with and comply to Appendix E of Part 43. Aircraft N# 256P Altimeters are certified for a maximum altitude of 20K feet. The aircraft is returned to service.

Altimeter #1 P/N 066-03064-0055 S/N 28010

Altimeter #1 P/N S/N
Signature Michael Smith Date 4/10/2015 Work Order # A 1168

FAR 91.413 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Transponder tests required by FAR 91.413 were performed in accordance with and comply to Appendix F of Part 43. The aircraft is returned to service.

Transponder #1 P/N 066-01141-0101 S/N 12677
Transponder #1 P/N S/N
Mark Haskett 4/10/2015 A1168
Signature Date Work Order #

Alt. No. 28010		Alt. No. 066-03064-005		Alt. No. 28010		Alt. No. 066-03064-005	
Standart	Altitude	Standart	Altitude	Standart	Altitude	Standart	Altitude
1,000	-1,000	0	0	1,000	-1,000	1,000	-1,000
0	0	500	-500	1,000	-1,000	1,500	-1,500
1,000	-1,000	1,000	-1,000	1,500	-1,500	2,000	-2,000
2,000	-2,000	3,000	-3,000	3,000	-3,000	4,000	-4,000
6,000	-6,000	5,980	-5,980	5,980	-5,980	8,000	-8,000
		2,975	-2,975	2,975	-2,975		

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE	Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)			

MAKE:

MODEL:

S/N:

REG. NO: 256DB

WORK ORDER: 10857



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 4/13/2015
A/C TSN: 2546.4
HOBBS: 2546.4

Airframe Entries

- (1) DRAIN TKS TANK, REMOVE TKS LINES FROM TANK TO MAIN METERING PUMP, DRAIN MAIN METERING PUMP, REMOVE F903 FILTER (MAIN) AND REPLACE WITH NEW. FILL TKS TANK WITH 2 GALLONS. RUN SYSTEM ON HIGH AND PURGE ALL PANELS. TOP OFF TKS TANK.
- REMOVE LINE FROM ALL PROPORTIONING VALVES AND CLEAN VALVES. RECONNECT ALL LINES AND RE PURGE SYSTEM.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 4/13/2015

SIGNED: 

Frank R Galella, IA: 2764795

Work Order: 10857

Printed by EBis 3 (datcommedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 10858



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 4/13/2015
A/C TSN: 2546 4
HOBBS: 2546.4

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY. CHECKED ALL CONTROLS AND LUBED AS NEEDED REMOVED ALL INSPECTION PLATES CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91.207 PARAGRAPHS (C) AND (D). AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S. (4) RESEARCHED AND UPDATED COMPILED AD LIST. (5) COMPLIED WITH AD 2007-08-04 BY INSPECTION OF REQUIRED PANEL PLACARD I/A/W MCCUALEY ASB248. NEXT DUE 2646.4 OR 4/2016. (6) IFR CERTIFICATION DUE, SEE AVIONICS WO# A1168. (7) REMOVED AND REPLACED MAIN LANDING GEAR TIRES WITH NEW P/N: 070-306-0. (8) REMOVED AND REPLACED DISC PADS WITH NEW P/N: 066-10500. (9) TIGHTEN A/C BELT TO PROPER TENSION. (10) REMOVED AND REPLACED REAR NAV LIGHT BULB WITH NEW, P/N: 34-0428070-64. (11) REMOVED AND REPLACED ELT BATTERY WITH NEW, ARTEX P/N: 452-0130, S/N: 365880-053. NEW BATTERY GOOD THROUGH 10-2017. ELT TEST OK. (12) REMOVED OBSTRUCTION FROM CABIN HEATING VENT. (13) REMOVED AND REPLACED PHONE JACK FOR HANDSET COMMUNICATIONS. (14) SWING MAGNETIC COMPASS, INSTALL COMPASS CALIBRATION CARD IN COCK PIT. (15) REPLACED FOUR STATIC WICKS ON TRAILING EDGES OF WINGS AND ELEVATOR. (16) REMOVED AND REPLACED SUCTION PUMP FILTER ASSY WITH NEW P/N: AA2J4-7

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 4/13/2015

SIGNED:

Work Order: 10858

Frank R Galella, I.A: 2764795

Printed by EBis 3 (datcomedia.com)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 11016



Lincoln Park Aviation
Repair Station No. LKPR101K
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 9/30/2015
A/C TSN: 2588.5
HOBBS: 2588.5

Itera
lumber
fic entr

Airframe Entries

(1) READJUSTED UP FLAP LIMIT SWITCH I/A/W M.M. OPERATIONAL CHECK SATISFACTORY.... (4) REMOVED NOSE WHEEL, REPACKED BEARING, REPLACED SEAL WITH NEW, P/N: 154-03200.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 9/30/2015

SIGNED:

Inspector #2

Work Order: 11016

Frank R Galella
Certified Repair Station No. LKPR101K

Printed by EBis 3 (datcomedia.com)
CRS# LKPR101K

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 11127



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 1/11/2016
A/C TSN: 2642
HOBBS: 2642

Airframe Entries

(1) REMOVED DEFECTIVE VACUUM PUMP, P/N: 3216CW, S/N: 60633 AND INSTALLED OVERHAULED PUMP, P/N: AA3216CW, S/N: R10574. OPS CHECK GOOD.... (2) REMOVED AND REPLACED TAIL NAV BULB WITH NEW, P/N: 34-0428070-64.... (3) INSTALLED TWO NEW VG'S ON RIGHT WING.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 1/11/2016

SIGNED:

TA#2764795

Work Order: 11127

Frank R Galella, TA# 2764795

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 11214



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 4/27/2016
A/C TSN. 2668.6
HOBBS: 2668.6

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY. CHECKED ALL CONTROLS AND LUBED AS NEEDED REMOVED ALL INSPECTION PLATES CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91.207 PARAGRAPHS (C) AND (D). AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S ... (4) REMOVED AND REPLACED LEFT MAIN GEAR TIRE WITH NEW, P/N: 070-306-0, S/N: 5215S00378 ... (5) REPLACE PACKING RINGS ON LEFT AND RIGHT BRAKE CALIPERS WITH NEW ... (6) REMOVED AND REPLACED EIGHT BRAKE LININGS ON LEFT AND RIGHT MAIN WHEELS. REPACK ALL BEARINGS.... (7) COMPLIED WITH AD 2007-08-04, INSPECTION PROPELLER BLADES IAW McCauley ASB 248 INSTRUCTIONS.... (9) REPLACE WIRE FOR PANEL LIGHT ON INSTRUMENT PANEL SUB EL PANEL.... (10) TIGHTEN AND SAFETY HARDWARE FOR COWL FLAP DOOR LEFT AND RIGHT SIDES.... (11) ADJUST MAIN LANDING GEAR STRUTS TO CORRECT EXTENSION.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return-to-service. Pertinent details of the repair are on file at this repair station under work order listed below

DATE: 4/27/2016

SIGNED:

Frank R Galella, Jr. 2764795

Inspector #2
IA#2764795
CRS# LKPR101K

Work Order: 11214

Printed by EBis 3 (datcomedia.com)

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE:
MODEL:
/N:
EG. NO: 256DB
ORK ORDER: 11303



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

L
DATE: 8/8/2016
A/C TSN: 2703.4
HOBBS: 2703.4

Airframe Entries

ADJUST LIMIT SWITCHES I/A/W M.M. OPERATIONAL CHECK SATISFACTORY.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

TE: 8/8/2016

SIGNED: 

Frank R. Galella, IA: 2764795

IA#2764795

Work Order: 11303

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE
DATE			

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

FAR 91.411 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Altimeter and Static tests required by FAR 91.411 were performed in accordance with and comply to Appendix E of Part 43. Aircraft N# 2561 altimeters are certified for a maximum altitude of 20K feet. The aircraft is returned to service.

is returned to service.

Altimeter #2 P/N Michael Grunke S/N 3/27/2017 A1247
Signature Date Work Order #

FAR 91.413 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Transponder tests required by FAR 91.413 were performed in accordance with and comply to Appendix F of Part 43. The aircraft is returned to service.

Transponder #1 P/N 066-01141-0101 S/N 12677

Transponder #1 P/N 7 S/N
Michael Brooks 3/27/2017 A1247
Signature Date Work Order #

Altimeter Scale Correction Card

Altimeter S/N: 28010 Part Number 016-0384-006-

Standard Altitude	Altimeter Reading	Standard Altitude	Altimeter Reading
-1,000	-1,010	10,000	9,980
0	0	12,000	11,970
500	500	14,000	13,980
1,000	1,000	16,000	15,970
1,500	1,500	18,000	17,950
2,000	2,000	20,000	19,950
3,000	2,990	22,000	—
4,000	3,990	25,000	—
6,000	5,985	30,000	—
8,000	7,990	35,000	—

Date: 3/27/2017 N256DB

W. H. H. H. A 1247

YEAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE	Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)			

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 11526



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 4/3/2017
A/C TSN: 2782.2
HOBBS: 2782.2

✓

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY. CHECKED ALL CONTROLS AND LUBED AS NEEDED. REMOVED ALL INSPECTION PLATES. CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91.207 PARAGRAPHS (C) AND (D). AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S... (4) RESEARCHED AND UPDATED COMPILED AD & SB LIST... (5) IFR CERTIFICATION DUE, SEE AVIONICS WO# A1247... (6) COMPLIED WITH AD 2007-08-04 BY INSPECTION OF REQUIRED PANEL PLACARD AND INSPECTION AS PER MCCUALEY ASB 248, BLADES AND HUB LIFE LIMITED TO 10,000 HR TOTAL PROP TIME. 2782.2 ACTT NEXT INSPECTION DUE AT 2682.2 ACTT OR 3-2018... (7) INSTALL TWO VORTEX GENERATORS ON RIGHT WING.... (8) REMOVED AND REPLACED ICE LIGHT WITH NEW, P/N: 34-0070371-01 I/A/W M.M. OPERATIONAL CHECK SATISFACTORY.... (9) REMOVED AND REPLACED AIR CONDITIONER FAN MOTOR WITH NEW, P/N 36-380027-35, I/A/W . OPERATIONAL CHECK SATISFACTORY.... (10) REMOVED AND REPLACED LOW PRESSURE SWITCH WITH NEW, P/N. 76575-7. SERVICED AIR CONDITIONER WITH OIL AND 2.4 R1134A I/A/W M.M. OPERATIONAL CHECK SATISFACTORY... (11) REMOVED AND REPLACED GARTER FILTER WITH NEW. OPERATIONAL CHECK SATISFACTORY.... (12) REMOVED AND REPLACED BOTH MAIN SYSTEM AIR FILTERS WITH NEW. OPERATIONAL CHECK SATISFACTORY.... (14) REPLACE CENTRAL TKS FILTER WITH NEW, P/N: 19295. OPS CHECK TKS SYSTEM OK.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 4/3/2017

SIGNED:

Frank R Galella, IA 2764795

Inspector #2

Work Order: 11526

CRS# LKPR101K

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 11541



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

L
DATE: 4/14/2017
A/C TSN: 2782.2
HOBBS: 2782.2

Airframe Entries

(1) REMOVED BROKEN ELT AND MOUNT. INSTALL NEW ARTEX ELT 345 AND MOUNT. INSTALL NEW REMOTE SWITCH. INSTALL NEW WHIP ANTENNA AND CABLE. TESTED ELT. ADVISED OWNER TO REGISTER BEACON WITH NOAA 15 DIGIT HEX: 2DC88 5B70C FFBFF

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 4/14/2017

SIGNED:

Frank R Galella, IA: 2764795

Work Order: 11541

IA#2764795

Printed by EBis 3 (datcomedia.com)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 11576



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

L
DATE: 5/31/2017
A/C TSN: 2802.7
HOBBS: 2802.7

Airframe Entries

(1) REPAIR BROKEN WIRE TO COMPRESSOR CLUTCH I/A/W M.M. OPERATIONAL CHECK SATISFACTORY.... (2) REPLACED LOW PRESSURE SWITCH WITH NEW, P/N: 27647. OPERATIONAL CHECK SATISFACTORY.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 5/31/2017

SIGNED:

Frank R Galella, IA: 2764795

Work Order: 11576

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 11702



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE 9/25/2017
A/C TSN 2852 6
HOBBS. 2852 6

Airframe Entries

(1) REMOVED AND REPLACED AIR CONDITIONING FAN MOTOR WITH NEW, P/N: 36-380027-35 I/A/W MM. OPERATIONAL CHECK
SATISFACTORY.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 9/25/2017

SIGNED:

Frank R. Galella IA#2764795

Work Order: 11702

Printed by EBis 2 (datcomedia.com)

MAKE:
MODEL:
S/N:
REG. NO: 256DB
WORK ORDER: 11728



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 10/19/2017
A/C TSN: 2858.1
HOBBS: 2858.1

Airframe Entries

(1) REMOVED AND REPLACED RIGHT NAV LIGHT WITH NEW, P/N: MS25309-7512, REPAIR GROUND WIRE TO BARREL ON LIGHT FIXTURE.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 10/19/2017

SIGNED:

Frank R. Galella IA#2764795

Inspector #2

Work Order: 11728

Printed by EBis 3 (datcomedia.com)

CRS# LKPR101K

YEAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
-------	---------------------------	-------------------	-----------------------------	--

MAKE
MODEL
S/N
REG. NO.
WORK C



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

1

DATE: 1/3/2018
A/C TSN: 2882.1
HOBBS 2882.1

Airframe Entries

(2) REMOVED AND REPLACED MAIN AIRCRAFT BATTERY WITH NEW, P/N: G-242, S/N: G02942302. ADDED 3 QTS ACID, CHARGED PER GILL M.M.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 1/3/2018

SIGNED

Work Order: 11798

Frank R. Galella, IA 2764795

IA#2764795

Printed by EBis 3 (datcomedia.com)

MAKE: Raytheon
MODEL: A36
S/N: E-3081
REG. NO: 256DB
WORK ORDER: 11880



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 4/16/2018
A/C TSN: 2915
HOBBS 2915

(*number of entries.*)

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY. CHECKED ALL CONTROLS AND LUBED AS NEEDED. REMOVED ALL INSPECTION PLATES. CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91.207 PARAGRAPHS (C) AND (D). AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S... (4) RESEARCHED AND UPDATED COMPILED AD & SB LIST.... (6) REPAIRED ICE LIGHT GROUND. OPERATIONAL CHECK SATISFACTORY.... (7) OVERHAULED BOTH MAIN GEAR BRAKE CALIPERS WITH NEW PACKING RINGS, P/N MS28775-222.... (8) REMOVED AND REPLACED MAIN BRAKE LININGS WITH NEW. REPACK ALL WHEEL BEARINGS.... (9) REMOVED AND REPLACED TOW PIN WITH NEW, P/N 60-820029-1.... (11) REMOVED AND REPLACED ALTERNATOR AIR DOOR SPRING WITH NEW.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 4/16/2018

SIGNED:

Work Order 11880

Frank R Galella, IA-2764795

IA#2764795

Printed by EBis 3 (datcomedia.com)

FAR 91.411 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the

Altimeter and Static tests required by FAR 91.411 were performed in accordance with and comply to Appendix E of Part 43. Aircraft N# 256DB altimeters are certified for a maximum altitude of 20K feet. The aircraft is returned to service. 

is returned to service.
Altimeter #1 P/N 066-03640005 S/N 29548

Altimeter #2 B/N.

S/N 1

Signature

Miss
Date

9/11/2018

Date _____

A1316

Work Order #



MidContinentTM

INSTRUMENTS+AVIONICS

9400 E. 34th St. N.
Wichita, KS 67226

16320 Stagg Street
Van Nuys, CA 91406

Altimeter Scale Correction Card

Altimeter P/N: 5035PB-P57

Serial Number: 29548

REFERENCE ALTITUDE IN FT	ALTIMETER READS
-1,000	-1,000
0	0
500	495
1,000	1,000
1,500	1,500
2,000	2,000
3,000	3,000
4,000	4,000
5,000	4,995
6,000	6,000
8,000	7,995
10,000	9,985
12,000	11,980
14,000	13,985
15,000	14,995
16,000	15,990

Tested By:

3,000
P884

Date: 7/6/2018

MAKE: Raytheon
MODEL: A36
S/N: E-3081
REG. NO: 256DB
WORK ORDER: 11998



Lincoln Park Aviation
Repair Station No. LKPR101K
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 9/12/2018
A/C TSN: 2976 5
HOBBS: 2976.5

Logs

Airframe Entries

(1) REMOVED AND REPLACED ALTIMETER WITH NEW, P/N: 066-0364-0005, S/N: 29548. OPERATIONAL CHECK SATISFACTORY.... (2) COMPLETE IFR CERTIFICATION, SEE AVIONICS WO# A1316.... (3) REPAIRED BROKEN WIRES BETWEEN TRANSPONDER AND ALTIMETER I/A/W MM. OPERATIONAL CHECK SATISFACTORY.... (4) REPAIRED BROKEN WIRES ON PITOT, I/A/W MM. OPERATIONAL CHECK SATISFACTORY.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 9/12/2018

SIGNED: A handwritten signature in black ink.

Frank R Galella
Certified Repair Station No. LKPR101K

Inspector #2

Work Order: 11998

CRS# LKPR101K

Printed by EBis 3 (datcomedia.com)

MAKE: Raytheon
MODEL: A36
S/N: E-3081
REG. NO: 256DB
WORK ORDER: 12013



Lincoln Park Aviation
Repair Station No. LKPR101K
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 10/3/2018
A/C TSN: 2982.5
HOBBS: 2982.5

Airframe Entries

(1) REMOVED TRANSPONDER CONNECTOR, CLEAN CONTACTS REALIGN CONNECTOR, REINSTALL TRANSPONDER I/A/W MM. OPERATIONAL CHECK SATISFACTORY.... (2) INSTALL RPM SENSOR I/A/W JPI INSTRUCTIONS. OPERATIONAL CHECK SATISFACTORY.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 10/3/2018

SIGNED: A handwritten signature in black ink.

Frank R Galella
Certified Repair Station No. LKPR101K

Inspector #2

Work Order: 12013

CRS# LKPR101K

Printed by EBis 3 (datcomedia.com)

MAKE: Raytheon
MODEL: A36
S/N: E-3081
REG NO: 256DB
WORK ORDER: 12079



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 12/19/2018
A/C TSN: 3006.3
HOBBS: 3006.3

Alterations
Number of
cific entries.)

Airframe Entries

(1) REMOVED AND REPLACED PYREX STROBE TUBES ON WING TIPS WITH NEW, P/N: W55-0221-1.... (2) CLEAN BOTH MALE AND FEMALE PINS ON TRANSDUCER TACH M5 I/A/W MM. OPERATIONAL CHECK SATISFACTORY.... (3) COMPLETED OIL AND FILTER CHANGE, INSPECTED OIL FILTER AND FOUND NO CONTAMINATION. ADDED 12 QTS OF 20W50 OIL.... (4) ADJUSTED SAFETY PIN ON PASSENGER DOOR HANDLE. OPERATIONAL CHECK SATISFACTORY.... (5) REMOVED AND REPLACED POSITION LIGHT IN TAIL CONE WITH NEW, P/N: 34-0428070-64.... (6) INSTALL OVERHAULED FLIGHT COMMAND INDICATOR, P/N: 060-0017-01 KI-256, S/N: 16040. INSTALLED NEW PNEUMATIC HOSES HERE REQUIRED.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 12/19/2018

SIGNED:

Frank R Galella, A: 2764795

IA#2764795

Work Order: 12079

Printed by EBis 3 (datcomedia.com)

MAKE: Raytheon
MODEL: A36
S/N: E-3081
REG. NO: 256DB
WORK ORDER: 12125



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 2/18/2019
A/C TSN: 3025.3
HOBBS: 3025.3

Airframe Entries

(1) REMOVED BENDIX KING KT70 TRANSPONDER. INSTALLED AND TESTED APPAREO STRATUS ES ADS-B TRANSPONDER KIT, P/N: 153010-000039, S/N 201150, I/A/W SA#04112CH AND STRATUS ES INSTALLATION INSTRUCTIONS. DOCUMENT NO. 600840-000032 REVISION 2.1 DATED FEBRUARY 20, 2018 AND FAA POLICY NOTICE # n8900.362. INSTALLED STRATUS 3I ADSB IN RECEIVER KIT P/N: 153010-000062, S/N: 600840-000052 REV 1.2 DATED JANUARY 15, 2019. OPS CHECK OK.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 2/18/2019

SIGNED:

Frank R Galella, A: 2764795

IA#2764795

Work Order: 12125

Printed by EBis 3 (datcomedia.com)

YE/

DA
MAKE: Raytheon
MODEL: A36
S/N: E-3081
REG NO: 256DB
WORK ORDER: 12186



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 5/13/2019
A/C TSN 3056 5
HOBBS: 3056 5

ations
ber of
ntries.)

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY. CHECKED ALL CONTROLS AND LUBED AS NEEDED. REMOVED ALL INSPECTION PLATES. CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91.207 PARAGRAPHS (C) AND (D). AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S... (4) RESEARCHED AND UPDATED COMPILED AD & SB LIST.... (5) COMPLIED WITH AD 2007-08-04 BY INSPECTION PANEL PLACARD AND INSPECTION AS PER MCCUALEY ASB248 BLADES AND HUB LIFE LIMITED TO 10,000 HOURS TOTAL PROPELLER TIME 3056 5 HOBBS. NEXT INSPECTION DUE AT 3156.5 HOBBS OR 5/2020... (6) REMOVED AND REPLACED NEW BONDING STRAP I/A/W. OPERATIONAL CHECK SATISFACTORY.... (7) REMOVED AND REPLACED SPRING WITH NEW, P/N: 35-910288-1, I/A/W MM. OPERATIONAL CHECK SATISFACTORY.... (8) REMOVED AND REPLACED TWO VACUUM FILTERS WITH NEW, P/N: B3-5-1. OPERATIONAL CHECK SATISFACTORY.... (9) REMOVED AND REPLACED STANDBY AND INSTRUMENT AIR FILTERS WITH NEW, P/N: AA2J4-7.. (10) REMOVED AND REPLACED BROKEN GREASE FITTING IN NOSE WHEEL STEERING WITH NEW, P/N: 1736. OPERATIONAL CHECK SATISFACTORY.... (11) REMOVED AND REPLACED BOTH MAIN WHEEL BRAKE DISKS WITH NEW, P/N: 164-02505. OPERATIONAL CHECK SATISFACTORY.... (12) REMOVED AND REPLACED WITH TIRES AND TUBES WITH NEW, TIRES P/N: 070-313-0, S/N: 9038S00166 & 9038S0177. TUBE P/N: 302-061-400.... (13) DETAIL AIRCRAFT

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 5/13/2019

SIGNED:

Frank R Galella, IA: 2764795

Work Order: 12186

IA#2764795 Printed by EBis 3 (datcomedia.com)

Iterations

lumber of
fic entries.)

MAKE: Raytheon
MODEL A36
S/N E-3081
REG NO 256DB
WORK ORDER: 12278



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

L
DATE: 9/4/2019
A/C TSN: 3099.3
HOBBS: 3099.3

Airframe Entries

(1) REMOVED AND REPLACED NOSE WHEEL TIRE AND TUBE WITH NEW P/N: 505C61-8 & 302-013-400, I/A/W MM. OPERATIONAL CHECK
SATISFACTORY. RETRACT TEST OK.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 9/4/2019

SIGNED:

Frank R Galella, IA: 2764795

Work Order: 12278

IA#2764795 Printed by EBis 3 (datcomedia.com)

MAKE: Raytheon
MODEL A36
S/N: E-3081
REG NO 256DB
WORK ORDER: 12306



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

L
DATE: 10/16/2019
A/C TSN: 3115
HOBBS: 3115

Airframe Entries

(1) INSTALL D'SHANNON PRODUCTS, LTD 20 GALLON FIBERGLASS AUXILIARY WING TIP TANKS DLB1400, REV. B DATED MAY 14, 2009, IN ACCORDANCE WITH INSTALLATION MANUAL KB-1401-1, REV. A, DATED MAY 14, 2009, OR LATER FAA APPROVED REVISION KIT D5588 INSTALLED. FOR ROUTINE AND PREVENTATIVE MAINTENANCE, PLEASE REFER TO D'SHANNON PRODUCTS, LTD I C A'S DP-ICA-1400 DATED DECEMBER 12, 2012, REV C, TANK S/N: 190816-02 AND 01 INSTALLED. INCLUDED IN THIS INSTALLATION IS AEROSPACE LOGIC FUEL INDICATOR FOR DIGITAL SENDERS, P/N: FL202D, S/N: ASL009960 AERO LED LIGHTS INCORPORATED INTO TIP TANK INSTALLATION USING TAIL LIGHT P/N: 11-1260-24, S/N: 3468309-080. WING TIP NAV LIGHTS WITH STROBE, P/N: 11-1280-B-24-L, S/N: 3511437-035 AND P/N: 11-1280-B-24-R, S/N: 3511438-010 CIES SENDING UNITS P/N: CC2840220901-101/102, S/N: D5L52 & D5R52 INSTALLED AT TANK MANUFACTURING BY D'SHANNON. OPERATIONAL CHECK AND FLIGHT TEST OF TANK INSTALLATION SATISFACTORY. UPDATE AIRCRAFT WIGHT AND BALANCE AND P.O.H. SUPPLEMENT. LABOR, TIP TANKS 45 HOURS, STROBE/LED CONVERSION 8 HOURS & FUEL & SENDERS 11 HOURS.... (2) REPLACED FLEXIBLE UPPER TRUNION BRAKE LINE ON RIGHT SIDE WITH NEW ASSY. BLEED SYSTEM & FILL RESERVOIR.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 10/16/2019

SIGNED:

Frank R Galella, IA: 2764795

Work Order: 12306

IA#2764795 Printed by EBis 3 (datcomedia.com)

MAKE: Raytheon
MODEL A36
S/N E-3081
REG NO 256DB
WORK ORDER: 12435



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 4/27/2020
A/C TSN: 3196 6
TACH 3196 6

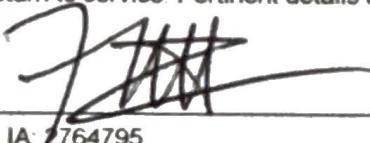
d Alterations
ate Number of
pecific entries.)

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY. CHECKED ALL CONTROLS AND LUBED AS NEEDED. REMOVED ALL INSPECTION PLATES. CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91 207 PARAGRAPHS (C) AND (D). AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S. (4) RESEARCHED AND UPDATED COMPILED AD & SB LIST. (8) REMOVED AND REPLACE AIR CONDITIONER COMPRESSOR PULLEY GUARD WITH NEW, P/N. R36-555048-3. (9) RE BONDED REIF HEATER PAD TO OIL PAN. (11) REPAIR CABIN MAIN DOOR STOP AND LUBRICATE DOOR. (12) REPAIR GROUND WIRE ON GLAIR SHIELD FIXTURE AND REPAIR LENS.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 4/27/2020

SIGNED: 

Work Order: 12435

Frank R. Galella, IA: 2764795

Printed by EBis 3 (datcomedia.com)

MAKE: Raytheon
MODEL A36
S/N. E-3081
REG NO: 256DB
WORK ORDER: 12546



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 8/31/2020
A/C TSN: 3227 9
TACH. 3227.9

Airframe Entries

(2) TOP OFF OXYGEN

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 8/31/2020

SIGNED: 

Work Order: 12546

Frank R. Galella, IA: 2764795

Inspector #2

CRS# LKPR101K

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH	TODAY'S FLIGHT	TOTAL TIME IN
-------	-------------------	-------------------	------------------

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Rating and Certificate Number of

TORNADO ALLEY TURBO INC.

300 AIRPORT RD

ADA, OK 74820

N256DB BONANZA A36 SN: E-3081
CONT IO-550-B SN: 686029

AIRFRAME LOG BOOK ENTRY

29 JUNE 2020

HOBBS: 3205.2



INSTALLED "WHIRLWIND III" TURBO NORMALIZER SYSTEM. INSTALLATION IS COVERED AND APPROVED UNDER ENGINE TECHNOLOGY INC. STC SA5223NM AND STC SE5222NM. THE INSTALLATION WAS COMPLETED USING TORNADO ALLEY TURBO INSTALLATION INSTRUCTIONS ETI-B-01 REV N 7/11/2017 MASTER DRAWING LIST TAT-B-MDL REV S 01/13/2015 AND HAWKER BEECHCRAFT MAINTENANCE MANUALS. REFER TO TORNADO ALLEY TURBO AIRPLANE FLIGHT MANUAL SUPPLEMENT-550 FOR OPERATION AND CONTINUED AIRWORTHINESS. APPLIED AIRPLANE GROSS WEIGHT INCREASE TO 4000 LBS AND INSTALLED NEW LIMITATION AND LOADING PLACARDS PER TURBO SYSTEM STC SA5223NM
INSTALLED O/H FUEL PUMP 35-6550001 S/N GP2133B
INSTALLED PRV VALVE 470930-9004 S/N H-XBN00005
INSTALLED WASTEGATE 470908-0011 S/N H-XBN00004
INSTALLED O/H STARTER ADAPTER 642087A70 S/N 213221
INSTALLED TURBOCHARGER 406610-0029 S/N H-XBL00073
INSTALLED O/H FF IND 6511/F.337 FT-B8.5.1-217 S/N 964AM
INSTALLED O/H MP CONTROLLER 470688-0010 S/N KCN01085
INSTALLED O/H FUEL CONTROLLER FT-B8.5/1-442 S/N E079715A
INSTALLED NEW EXHAUST MANIFOLDS, WASTEGATE MANIFOLD, AND TAIL PIPE.
INSTALLED ALL NEW EXHAUST PORT BASE GASKETS, FLANGE NUTS, TURBOCHARGER GASKET, EXHAUST 4 BOLT FLANGE GASKETS, WASTEGATE GASKETS, WASTEGATE MOUNTING BOLTS, WASHERS, AND NUTS.
INSTALLED TURBOGAMJECTORS KIT GT16B S/N 28880 IAW SE5222NM AND SE09289SC
INSTALLED AND PAINTED NOSE BOWL AIR SCOOP, ENGINE ACCESS PANELS, AND LOUVERS.
INSTALLED NEW WHEEL WELL AND FIREWALL HEAT FIREPROOF MATERIAL.
REPLACED NOSE GEAR TIRE TUBE 097-908-0
RUN-UP, O/H'S TEST FLIGHT AND LEAK CHECK OK. APPROVED FOR RETURN TO SERVICE.
ENGINE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT MAINTENANCE RULES OF THE FEDERAL AVIATION REGULATIONS, ADVISORY CIRCULARS, AND APPROPRIATE MANUFACTURER'S MANUALS

WESLEY JENKINS A&P 3041696 IA

YEAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE
-------	---------------------------	-------------------	-----------------------------

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of
Technician or Repair Facility. (See back pages for other specific entries.)

Altimeter Scale Correction Card

Altimeter S/N: 29548 Part Number: 5035 PB-P57

Standard Altitude	Altimeter Reading	Standard Altitude	Altimeter Reading
-1,000	<u>-1,000</u>	10,000	<u>9,970</u>
0	<u>-5</u>	12,000	<u>11,970</u>
500	<u>495</u>	14,000	<u>13,980</u>
1,000	<u>990</u>	16,000	<u>15,975</u>
1,500	<u>1515</u>	18,000	<u>17,970</u>
2,000	<u>1995</u>	20,000	<u>19,970</u>
3,000	<u>3000</u>	22,000	<u>—</u>
4,000	<u>4000</u>	25,000	<u>—</u>
6,000	<u>5,990</u>	30,000	<u>—</u>
8,000	<u>7,995</u>	35,000	<u>—</u>

Date: 4/21/2020

Tested By: Michael Gault

N256 DB

W.O. #: A 1425

Lincoln Park Aviation CRS# LKPR101K
LPA Form 16

FAR 91.411 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Altimeter and Static tests required by FAR 91.411 were performed in accordance with and comply to Appendix E of Part 43. Aircraft N256 DB Altimeters are certified for a maximum altitude of 20K feet. The aircraft is returned to service.

Altimeter #1 P/N 5035 PB-P57

Altimeter #1 P/N

S/N 29548

S/N

Date 4/21/2021

Work Order #

Michael Gault
Signature

MAKE: Raytheon
MODEL A36
S/N E-3081
REG. NO 256DB
WORK ORDER: 12722



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE 4/22/2021
A/C TSN 3259
TACH: 3259

Alterations
e Number of
specific entries.)

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY CHECKED ALL CONTROLS AND LUBED AS NEEDED REMOVED ALL INSPECTION PLATES CHECKED STRUCTURE AND LUBRICATED AS REQUIRED CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91 207 PARAGRAPHS (C) AND (D) AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S . (4) OVERHAULED LEFT & RIGHT MAIN WHEEL CALIPER WITH NEW PACKING RINGS, P/N MS28775-222 OPS CHECK OK... (5) REMOVED AND REPLACED BRAKE LININGS WITH NEW, P/N 066-10500 REMOVED AND REPLACED RIGHT HAND SHIM WITH NEW, P/N 068-01100 OPS CHECK OK... (6) RESEARCHED AND UPDATED COMPILED AD & SB LIST (7) COMPLETED IFR CERTIFICATION, SEE AVIONICS WO# A1425... (8) REMOVED AND REPLACED NOSE WHEEL SHIMMY DAMPER WITH NEW, P/N SE-1076-1... (9) REMOVED AND REPLACED VACUUM PUMP WITH NEW, P/N: AS3216CW, S/N: 0BE912 NO LEAKS FOUND. OPS CHECK OK. (10) ADJUST FLAP SWITCH I/A/W MM OPS CHECK OK... (11) REMOVED AND REPLACED MAIN BATTERY WITH NEW, P/N: G-242, S/N: G03071354. OPS CHECK OK... (14) REMOVED AND REPLACED HOT STRIP HEATER PAD ON BOTTOM OF OIL PAN.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 4/22/2021

SIGNED: 

Frank R. Galella, IA 2764795

IA#2764795

Work Order: 12722

Printed by EBis 3 (datcomedia.com)

Saint Aviation - 352-427-0285 - jesse@saintaviation.com
A/C: N256DB

Date: 6-3-2021

Removed all flight and engine instruments.. Installed Dynon Skyview system (see Dynon Equipment Installation Record). Replaced GNS530W and installed IFD550. 337's, STC's, ICA's and FMS's added to aircraft records. Weight and balance revision created.


IA # 3347635
Jesse Saint

YI

MAKE: Raytheon
MODEL A36
S/N E-3081
REG. NO. 256DB
WORK ORDER: 12832



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE 9/10/2021
A/C TSN 3322 8
TACH: 3322.8

erations
mber of
(entries.)

Airframe Entries

(3) REMOVE REAR CABIN INTERIOR, LUBRICATE ALL ELEVATOR TRIM PULLEYS, ADJUST TRAVEL AND SET ELEVATOR TRIM CABLE TENSIONS. LUBRICATE LEFT AND RIGHT ELEVATOR ACCUATORS. FUNCTIONAL CHECK OF TRIM SYSTEM OK.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 9/10/2021

SIGNED:

Frank R Galella, IA: 2764795

IA#2764795

Work Order: 12832

Printed by EBis 3 (datcomedia.com)

MAKE: Raytheon
MODEL A36
S/N: E-3081
REG. NO. 256DB
WORK ORDER: 12901



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 12/6/2021
A/C TSN: 3350 9
TACH: 3350 9

Airframe Entries

(3) JACK AIRCRAFT, INFLATED MAIN & NOSE GEAR STRUTS TO PROPER PRESSURE

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 12/6/2021

SIGNED:

Frank R Galella, IA: 2764795

IA#2764795

Work Order: 12901

Printed by EBis 3 (datcomedia.com)

Altimeter Scale Correction Card

Altimeter S/N: 23275Part Number: 503273-000#1

YEAR:

RECORDING
TACH
TIMETODAYS
FLIGHTTOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
 Entries must be endorsed with Name, Rating and Certificate Number of
 Technician or Repair Facility. (See back pages for other specific entries.)

Standard Altitude	Altimeter Reading	Standard Altitude	Altimeter Reading
-1,000	-1000	10,000	10020
0	10	12,000	12020
500	490	14,000	14030
1,000	1020	16,000	16030
1,500	1520	18,000	18020
2,000	2020	20,000	20020
3,000	3010	22,000	-
4,000	4020	25,000	-
6,000	6020	30,000	-
8,000	8020	35,000	-

Date: 5-13-22

Tested By:

W.O. #: A1488Lincoln Park Aviation CRS# LKPR101K
LPA Form 16

Altimeter Scale Correction Card

Altimeter S/N: 12613Part Number: 503296-000

Standard Altitude	Altimeter Reading	Standard Altitude	Altimeter Reading
-1,000	-990	10,000	9980
0	0	12,000	11970
500	980	14,000	13970
1,000	970	16,000	15980
1,500	1490	18,000	17990
2,000	1980	20,000	19990
3,000	2970	22,000	-
4,000	3970	25,000	-
6,000	5970	30,000	-
8,000	7970	35,000	-

Date: 5-13-22

Tested By:

W.O. #: A1488Lincoln Park Aviation CRS# LKPR101K
LPA Form 16

FAR 91.413 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Transponder tests required by FAR 91.413 were performed in accordance with and comply to Appendix F of Part 43. The aircraft is returned to service.

Transponder #1 P/N 153010-000039 S/N 201150

Transponder #1 P/N _____ S/N _____
~~788-#2~~ 5-13-22 A1488

Signature _____ Date _____ Work Order # _____

**TOTAL
TIME IN
SERVICE**

FAR 91.411 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Altimeter and Static tests required by FAR 91.411 were performed in accordance with and comply to Appendix E of Part 43. Aircraft N# 250B altimeters are certified for a maximum altitude of 2000 feet. The aircraft is returned to service.

Altimeter #1 P/N 503273-000 S/N 23275

Altimeter #2 P/N 503296-000 S/N 12613

Signature _____ Date _____ Work Order # _____

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Date and Description of Work done. *See* **Part II**

FAR 91.411 & 91.217 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the ADC and Static tests required by FAR 91.217 & FAR91.411 were performed in accordance with and comply to Appendix E of Part 43. The aircraft N# .ADC is certified to maximum altitude of feet. The aircraft is returned to service.

ADC P/N 7100-02 S/N 5-13-22 A1488
Signature Date Work Order

MAKE: Raytheon
MODEL A36
S/N: E-3081
REG NO 256DB
WORK ORDER 13029



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE 5/19/2022
A/C TSN: 3422.2
TACH: 3422.2

d Alterat
ite Number
pecific entr

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY. CHECKED ALL CONTROLS AND LUBED AS NEEDED. REMOVED ALL INSPECTION PLATES. CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91.207 PARAGRAPHS (C) AND (D). AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S... (4) RETORQUE FLAP CONTROL SWITCH NUT. OPS CHECK OK... (5) REMOVED AND REPLACED BOTH MAIN LANDING GEAR TIRES & TUBES WITH NEW... (6) REMOVED AND REPLACED RIGHT AND LEFT BRAKE LININGS WITH NEW. P/N 066-10500... (7) INSTALLED NEW O-RING SEALS ON RIGHT AND LEFT BRAKE CALIPER ASSY'S. BLEED HYDROLYC BRAKE SYSTEM. OPS CHECK OK... (8) REMOVED AND REPLACED NOSE WHEEL TIRE & TUBE WITH NEW. OPS CHECK OK... (10) RESEARCHED AND UPDATED COMPILED AD LIST... (11) RETORQUE & COTTER PIN LEFT COWL FLAP HINGE BOLTS... (12) REMOVED AND REPLACED LEFT ELEVATOR STATIC WICK WITH NEW... (13) REMOVED CABIN DOOR INTERIOR TRIM. INSTALLED NEW CABIN DOOR LIGHT BULBS. OPS CHECK OK... (14) FABRICATED & INSTALLED ELECTRIC BOOST PUMP DRAIN LINE... (15) ADJUST LANDING GEAR WARNING SWITCH I/A/W CHECK OK... (17) REMOVED AND REPLACED MAIN AIRCRAFT BATTERY WITH NEW, P/N: G-242, S/N: G03118999... (19) BEECH A36 M M INSTRUCTIONS... (20) TROUBLE SHOOT LANDING HEIGHT SYSTEM. COMPLETED IFR CERTIFICATION & #2 ALT CERTIFICATION, SEE AVIONICS WO# A1488... (22) DETAIL AIRCRAFT. RAN NEW POWER WIRE FROM CB THROUGH INTERIOR TO RIGHT WING. OPS CHECK OK... (22) DETAIL AIRCRAFT.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

Removed #2-cylinder ECI P/N: AEC632397, S/N: 91324-03 from engine P/N: IO-550 T, S/N: 686029 and replaced with RAM Aircraft, LP # 027345 *REPAIRED* CMI cylinder P/N: CCL71.4-244-UP, S/N: 74770-25. Installed IAW TCM IO-550 Engine Maintenance and Overhaul Manual M-16 REV.2, Change 1 and M-0 Rev.1, Change 3.

Trained engine oil and obtained sample. Removed oil filter and inspected element for abnormal debris. None found. Replaced oil filter and serviced engine with 10 quarts Aeroshell 100.

Performed satisfactory ops and leak check with no defects noted.

The aircraft and/or component(s) described above was (were) repaired as described above and inspected in accordance with current Federal Aviation Regulations (FAR) and the manufacturer's maintenance manual(s) and was ground tested. Aircraft returned to service with respect to the discrepancies described above.

SIGNED:

A large, handwritten signature in blue ink, appearing to read 'Robert Masterson', is written over the 'SIGNED' line and extends downwards.

DATE: 1-18-2023

Robert Shane Masterson, A&P 3711885

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
DATE				

MAKE: Raytheon
MODEL: A36
S/N: E-3081
REG. NO: 256DB
WORK ORDER: 13318



Lincoln Park Aviation

425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 8/7/2023
A/C TSN: 3540 3
TACH: 3540 3

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR. CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED). CHECKED ELECTRICAL SYSTEM AND BATTERY. CHECKED ALL CONTROLS AND LUBED AS NEEDED. REMOVED ALL INSPECTION PLATES. CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91.207 PARAGRAPHS (C) AND (D). AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S... (4) REMOVED AND REPLACED NAV/STROBE LIGHT WITH NEW, P/N: 11-1206-24, S/N: M24044-013. OPS CHECK OK... (5) RUN SYSTEM, REMOVED AND REPLACED TKS FILTER WITH NEW, P/N: 19295. ALL PANELS WORKING WITH EXCEPTION OF RIGHT OUTER MOST PANEL, WHICH APPEARS TO BE CLOGGED, WILL NEED TO REPLACE.... (6) CLEANED & RESEALED FRONT WINDSCREEN.... (7) REMOVED AND REPLACED #1, #5, #4 CYLINDER ASSY. P/N: SA52006-A239, S/N: 526000018365, 526000018366 & 52600001837. OPS CHECK OK... (9) REPAIRED AND PAINTED NOSE GEAR DOOR.... (10) REMOVED AND REPLACED ELT 345 BATTERY WITH NEW, P/N: A3-06-2880, S/N: 324-010426. ELT EXPIRES 11/2029. INSTALLED NEW REMOTE SWITCH & WIRING. OPS CHECK OK... (11) DETAIL AIRCRAFT.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 8/7/2023

SIGNED:

Work Order: 13318

Frank R Galella, IA 2764795

Printed by EBis 3 (datcommedia.com)

MAKE: Raytheon
MODEL: A36
S/N: E-3081
REG. NO: 256DB
WORK ORDER: 13321



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 8/23/2023
A/C TSN: 3553.3
TACH: 3553.3

Alterations
(e Number of
pecific entries.)

Airframe Entries

(1) INSTALL 90K RESISTOR TO TACH SIGNAL WIRES ON DYNON HDX AS PER DYNON DRAWING 10388-000 REVG NOTE 3. OPS CHECK OK...
(2) COMPRESSION CHECK SATISFACTORY... (3) SUMP TANKS CHECK FOR WATER. INSPECT INDUCTION SYSTEM VISUALLY. INSPECT FUEL LINES, ENGINE COMPONENTS. RUN UP SATISFACTORY.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 8/23/2023

SIGNED:

Frank R Galella, IA: 2764795

IA#2764795
CRS# LKPR101K

Work Order: 13321

Printed by EBis 3 (datcomedia.com)

MAKE: Raytheon
MODEL: A36
S/N: E-3081
REG. NO: 256DB
WORK ORDER: 13356



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 10/6/2023
A/C TSN: 3557.2
TACH: 3557.2

Airframe Entries

(1) REMOVED RIGHT OUTER TKS PANEL, REPLACED INNER VALVE STEM, REINSTALLED PANEL. TESTED SYSTEM.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 10/6/2023

SIGNED:

Frank R Galella, IA: 2764795

IA#2764795

Work Order: 13356

Printed by EBis 3 (datcomedia.com)

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
DATE				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MAKE: BEECHCRAFT

MODEL: A36

REG NO: N256DB

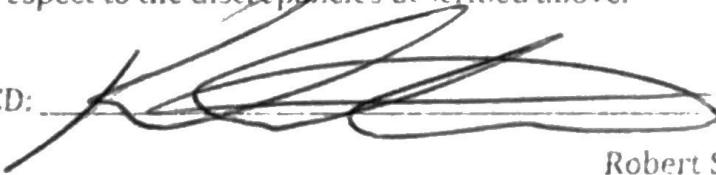
TACH: 3600.8

HOBBS: 3609.0

ENGINE

2633 Lantana Rd.
Lantana, FL 33462
941-360-6877

- Drained oil and obtained sample. Inspected oil filter for abnormal debris. None found. Replaced oil filter and serviced engine with 10 quarts Phillips X/C 20W50. Performed ground run with no defects noted.
- The aircraft and/or component(s) described above was (were) repaired as described above and inspected in accordance with current Federal Aviation Regulations (FAR) and the manufacturer's maintenance manual(s) and was ground tested. Aircraft returned to service with respect to the discrepancies described above.

SIGNED: 

Robert Shane Masterson, A&P 3711885

DATE: 12/13/2023

MAKE: BEECHCRAFT

MODEL: A36

REG NO: N256DB

TACH: 3610.4

HOBBS: 3619.2

AIRFRAME

2633 Lantana Rd.
Lantana, FL 33462
941-360-6877

Installed kit as part of Dynon Avionics Technical Service Bulletin: 104750-000, Beechcraft Series 36 Autopilot Servo Update, Rev A. Performed satisfactory ops check with no defects noted.

- The aircraft and/or component(s) described above was (were) repaired as described above and inspected in accordance with current Federal Aviation Regulations (FAR) and the manufacturer's maintenance manual(s) and was ground tested. Aircraft returned to service with respect to the discrepancies described above.

SIGNED: 

Robert Shane Masterson, A&P 3711885

DATE: 12/28/2023

YEAR:	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
DATE				

MAKE: BEECHCRAFT
MODEL: A36
REG NO: N256DB
TACH: 3639.1
HOBBS: 3649.7

ENGINE

2633 Lantana Rd.
Lantana, FL 33462
941-360-6877

Drained oil and obtained sample. Inspected oil filter for abnormal debris. None found. Replaced oil filter and serviced engine with 10 quarts Phillips X/C 20W50. Performed ground run with no defects noted.

The aircraft and/or component(s) described above was (were) repaired as described above and inspected in accordance with current Federal Aviation Regulations (FAR) and the manufacturer's maintenance manual(s) and was ground tested. Aircraft returned to service with respect to the discrepancies described above.

SIGNED:

DATE: 03/25/2024

Robert Shane Masterson, A&P 3711885

Altimeter Scale

Card

#1 ALT

Altimeter S/N: 23275Part Number: 503273 000

Standard Altitude	Altimeter Reading	Standard Altitude	Altimeter Reading
-1,000	-1000	10,000	10000
0	0	12,000	12000
500	500	14,000	14000
1,000	1000	16,000	16010
1,500	1500	18,000	18010
2,000	2000	20,000	20020
3,000	3000	22,000	22020
4,000	4000	25,000	25020
6,000	6000	30,000	30030
8,000	8000	35,000	—

Date: 7-7-24Tested By: S. H. L.N 256DBW.O. #: A 1560Lincoln Park Aviation CRS# LKPR101K
LPA Form 16Altimeter Scale Correction Card #2 ALTAltimeter S/N: 12613Part Number: 503296 000

Standard Altitude	Altimeter Reading	Standard Altitude	Altimeter Reading
-1,000	-990	10,000	9980
0	-10	12,000	11980
500	490	14,000	13980
1,000	990	16,000	15980
1,500	1490	18,000	17980
2,000	1990	20,000	19980
3,000	2090	22,000	21980
4,000	3980	25,000	24980
6,000	5980	30,000	29980
8,000	7980	35,000	—

Date: 7-7-24Tested By: S. H. L.N 256DBW.O. #: A 1560Lincoln Park Aviation CRS# LKPR101K
LPA Form 16

Description of Inspections, Tests, Repairs and Alterations
 Entries must be endorsed with Name, Rating and Certificate Number of
 Technician or Repair Facility. (See back pages for other specific entries.)

YEAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE
DATE			

FAR 91.411 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Altimeter and Static tests required by FAR 91.411 were performed in accordance with and comply to Appendix E of Part 43. Aircraft N# 25608 feet are certified for a maximum altitude of 304 feet. The aircraft is returned to service.

Altimeter #1 P/N 503273-000 S/N 23275

Altimeter #1 P/N 503296 000 S/N 12613

Scott L. Sod 7-7-24 A 1560
Signature Date Work Order #

FAR 91.411 & 91.217 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the ADC and Static tests required by FAR 91.217 & FAR91.411 were performed in accordance with and comply to Appendix E of Part 43. The aircraft N# 2560 ADC is certified to maximum altitude of 304 feet. The aircraft is returned to service.

ADC P/N 503273 000 S/N 23275

Smith 1 7-7-24 A1560
Signature Date Work Order

FAR 91.413 TESTS AND INSPECTIONS

Lincoln Park Aviation, CRS# LKPR101K certifies that the Transponder tests required by FAR 91.413 were performed in accordance with and comply to Appendix F of Part 43. The aircraft is returned to service.

Transponder #1 P/N 153010 000039 S/N 201/50

Transponder #1 P/N _____ S/N _____

Smith & L 7-7-24 A 1560
Signature Date Work Order #

YEAR:	RECORDING	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	DATE
TACH TIME				

Description of Inspections, Tests, Repairs
Entries must be endorsed with Name, Rating and Certificate of a Technician or Repair Facility. (See back pages for other information.)

MAKE: Raytheon
MODEL: A36
S/N: E-3081
REG NO: 256DB
WORK ORDER: 13564



Lincoln Park Aviation
425 Beaverbrook Road
Lincoln Park, NJ 07035
Phone: 973-633-0450

DATE: 7/11/2024
A/C TSN: 3659.1
TACH: 3659 1

Airframe Entries

(1) 100HR/ANNUAL/AIRFRAME - JACKED AIRCRAFT, REMOVED WHEELS, GREASED BEARINGS AND GEAR CHECKED BRAKES, CHECKED RETRACTION AND EMERGENCY EXTENSION (IF EQUIPPED) CHECKED ELECTRICAL SYSTEM AND BATTERY CHECKED ALL CONTROLS AND LUBED AS NEEDED. REMOVED ALL INSPECTION PLATES. CHECKED STRUCTURE AND LUBRICATED AS REQUIRED. CHECKED COCKPIT BELTS, LIGHTS AND INSTRUMENT OPERATION. INSPECT ELT IN ACCORDANCE WITH FAR 91 207 PARAGRAPHS (C) AND (D) AIRCRAFT CHECKED FOR CONFORMITY TO THE APPROPRIATE TCD'S... (5) COMPLETED IFR CERTIFICATION & #2 ALT STANDBY CERTIFICATION, SEE AVIONICS WO# A1560... (7) REMOVED AND REBUILT LEFT AND RIGHT BRAKE CALIPERS WITH NEW O-RINGS, P/N: MS28775-222 BLEED BRAKE SYSTEM NO LEAKS FOUND. OPS CHECK OK... (8) REMOVED AND REPLACED LEFT AND RIGHT BRAKE LININGS WITH NEW, P/N: 066-10500 OPS CHECK OK... (9) REMOVED AND REPLACED O-RINGS ON LEFT AND RIGHT FUEL CAP ASSY... (10) PERFORMED BATTERY BACKUP TEST. PASS... (11) ADJUSTED CABIN DOOR STOP FOR CORRECT OPERATION. OPS CHECK OK... (12) REMOVED AND REPLACED CABIN DOOR COURTESY LAMPS WITH NEW, P/N: 1864. CLEAN & SECURE LOOSE GROUND. OPS CHECK OK... (13) ADJUSTED NOSE GEAR DOORS FOR CORRECT OPERATION. OPS CHECK OK... (14) REMOVED AND REPLACED FUEL TANK CAPACITY PLACARDS WITH NEW, P/N: 36920054-5... (16) PREP AND REPAINT TOP COWLING.

The Aircraft, Airframe, Aircraft Engine, Propeller or Appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is Approved for return to service. Pertinent details of the repair are on file at this repair station under work order listed below.

DATE: 7/11/2024

SIGNED:

Frank R Galella, IA. 2764795

[Handwritten Signature]
IA#2764795

Work Order: 13564

Printed by EBis 3 (datcomedia.com)

TIME

SERVICE

Technician or Repair Facility

DATTI

Date: 09/10/2025 N256DB Make: BEECH A-36

Vin: E-3081 TACH: 3669.7 TTAF: 3669.7

Perform annual inspection on airframe using the BEECHCRAFT service manual as a guideline for repairs. Jack aircraft and perform landing gear retract and emergency extend procedure. Removed landing gear wheels, clean and pack wheel bearings. Check lube and visually inspect all cables, pulleys, and bell cranks. Check all lighting, visually inspect wing spars, bolts and fastners. check all belts and hoses.

Functional test elt iaw far part 91.207 battery next due 11\2029

Check and service all fluids. Clean cable ends and battery box. Check and comply with ad's and tsb's Ground test run aircraft to check for fuel and oil leaks, check all engine controls and return aircraft to service I certify that this aircraft has been inspected IAW an annual and is airworthy at this time

Ronald Herald ap/ia 3587880



