OCEAN AIRE CRS # OF1R372K ALTIMETER TEST FORM ATS REVISED: 06/30/2010

FAR 43 APPENDIX E ALTIMETER TEST	1	
The state of the s	ALTIMETER P/N: United 5934P-1	ADC P/N: N/A
AIRCRAFT # N 80 4 95	ALTIMETER S/N: H //3)	ADC S/N: N/A
WORK ORDER #_ 5 93	ENCODER S/N: N/A	Ł.
DATE: 1-24-2012	MAX ALTITUDE PER POH: 20,000	

	ERENCE	ALT TOL +/-	AIRCRAFT	ALT REPORTING	FRICTION	CASE LEAK	+/- 100'	ACTUAL
	IMETER ETTING	(IN	SYSTEM TEST	INTEGRATION	TOL +/-	HYSTERISIS, 50%	+/- 75'	-10
31	TING	FEET)	READINGS ACTUAL	TEST * (PRESSURE ONLY)	(IN FEET)	HYSTERISIS, 40%	+/-75'	- 4
1			NOTONE	(FRESSORE ONET)	-			- 2
-100	0	20	-990	Marcola (Spirite) Carlos		AFTER EFFECT	+/- 30'	+3
0		20	770	Ò				
500		20	500			BARO SCALE ERRO	D 1./ 05!	1.07
1000		20	1000	and transplant of	(70) 20	28.1		ACTUAL
1100	SELECTION OF SELEC		1000	1100	(10) 20	28.5	-1727	-1730
1500	AND DESCRIPTION OF THE PERSON	20	1500			29.0	-1340 -863	-1340
1800	CHICAGO CONTRACTOR CON			1800		29.5	-392	-865
2000	CONTRACTOR STATES AND ADDRESS OF THE PARTY O	30	2060		(70) 20	29.92	0	-390
3000		30	3000		(70)20	30.5	531	530
4000		35	4060			30.9	893	900
5000					(70) 20	30.99	974	950
6000		40	6020		Constant Value		1014	1770
6800		Yes.	A STATE OF THE STA	6800		and the second second second		INITIAL
8000		ΘÜ.	8030		(00)	ENSURE FREEDOM F		
12000		80 90	12040		(80) 20	ENTRAPPED MOISTURESTRICTIONS	DRE AND	W
14000	Committee of the Commit	100	14050			SYSTEM LEAK WITH	IN LIMITS	
14800				14800	NECKSET.	FAR 23.1325 OR 25.1		WB -
15000	7135,63				(90) 20	STATIC PORT HEAT		
16000		10	16040			(IF APPLICABLE)		
18000	Control of the Contro	20	18040			(
20000	STATUTE OF THE PROPERTY OF THE PARTY OF THE	30	10020		(100)			l W
22000	DESCRIPTION OF THE PARTY	40	NIA					0)
25000	图 80 BLAN ACROST BURGARDS	55			(120) N/A			
30000	GREAT STATE	60		A PERSONAL PROPERTY AND A SECURITY OF THE PROPERTY AND A SECURITY OF THE PERSON OF THE	(140)	ENSURE NO ALTERA	ATIONS OF	
30800	The state of the s	00	2	NIA	140)	DEFORMATIONS OF		
35000	2	05		TO SELECTION OF THE PARTY OF TH	(160)	SURFACE WOULD A		1,7
40000	AND ADDRESS OF THE PARTY OF	30		THE THE PERSON WAS ASSESSED.	180)	STATIC AIR RELATIC		1 W
45000	CONTRACTOR OF THE STREET	55			100)	OTTO THE NEED THO		
50000	A CENSOR OF REPORT AND PROPERTY.	80			250)			

*PRESSURE ALTITUDE REPORTING MUST BE WITHIN +/- 125' OF A/C ALTIMETER

		INITIAL
	STICKER AFFIXED TO INSTRUMENT	W3
NOTES:	DATE_1-24-2012	SIGNATURE
	TECHNICIAN	Waller Bolly
	SUPERVISOR	1
	INSPECTOR	Vella Belle

	·						
DATE	TOTAL T IN SERV		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER			
49	HOURS	10ths					
2-16-12	3271		Connected wire harness to autopilot head. Performed systems tin 5- Tec supplementall flight menual 89243-1	Secured OBS			
			Kach to alide slope head Gence Humnelrail AP32767	74			
2-22-/2	3173		Replaced I beacon bulb. Cleured socket for same. Replaced unit 150-0015 sn. T09070438, Installed doubler to pilots for handle sweep area, leave Himmuland AP 32767	beacen (losher door panel (interior)			
			for handle sweep area, surge Hommittees HP 32 167	74			
2-27-12	3274	4	Replaced L/H brake pads . Surge Himmelrook AP32	76774			
3-8-12	3281		Replaced landing light bulb. Leage Himmelren AP 3276	774			
	2		CHECKED ADS THEN 3/12/12, SEE AD LIST.				
3/15/12	5722	26	3310 W RIDGE PH	CE.			
	TITO	7	I CERTIFY THAT THIS A CREAT				
			BEEN INSPECTED IN ACCORDANCE: ANNAL INSP	WITH A/AN CTION AND WAS			
			DETERMINED TO BE IN AIRWORTHY	CONDITION.			
			DATE 3 15/12 101 11 10 10 10 10 10 10 10 10 10 10 10	5718 5722 TT			
			SIGNATURI Davrel Ger CERTIFICA A1 345 0	726			



MICHELIN

Stabilimento di Cuneo Piazza Robert Daubrée 12020, Ronchi – Cuneo

CERTIFICATE OF CONFORMANCE CERTIFICATO DI CONFORMITA'

P\N	eg en elleren	Tube size		Production lo	t
Codice	092 - 315 - 0	Dimensione	17.5x6.25+6.00-6	Lotto	46/11
materiale		camera		produzione	

Gentleman, we hereby certify that the parts supplied and referenced by the production lot, are manufactured according to applicable specifications. Substantiating documents regarding the subject parts are on file available for inspection upon request.

Signori, con questo documento noi certifichiamo che i materiali forniti ed identificati col riferimento del lotto di fabbricazione, sono realizzati conformemente alle specifiche richieste. I documenti previsti, relativi ai materiali in oggetto, sono archiviati e disponibili per ispezione su richiesta.

1	Tubes Quality Assurance Manager	Name	Ambrogio	Signature & Firma	Date (Data (d/m/y)
10	Responsabile Garanzia Qualità camere	1	M.		23/11/2011
	Treoponousilo Guidinata				

DATE 2012	TOTAL 1		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGN CERTIFICATE 1
19	HOURS	10ths	SIGNALURI	& NUMBER
3-15	5722	TT	Complied with RASL-001, Vac. pump vane inspectio	A. Found wi
	3285	Tech	Complied with RASL-001, Vac. pump vane inspection limital completed alternator brush inspection, cleaned	Islin rings
		1 1	THE WALL HANGELOW COLLING A TELL MAN IN THE ROLLING	IN TOO R
			three EBWING L'ord mounts, RH side Replaced LIH	broke die
			Installed new central oir Filter Adjust bottom afti	interior pil
			door panel clip from bettern day ement, Bleed both brake	systems. B
			three Eswith L'ord mounts, RH side. Replaced L/H' Installed new central din filter. Adjust bottom aftidoor panel clip han betternengagement. Bleed both brake minor prop nicks. Secured nose wheel bearing pace int 2009 Himmelcock AP 3276774	to wheel h
			2003 Hommelceich 1983276774	
3-21-12	3289		Installed new beacon light socket burge Homeneleach 4/3276	774
4-13-12	3303		Replaced beacon bulb. Georg Himmelweit AP3276774	
5-18-12	3338		Replaced RH tire and Tube. Bleed RIH brake system. swage To	Hommelresch
				AP327677
				20, 700 0, 10 10 10 10

DATE 2012	TOTAL IN SER	VICE	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE. CERTIFICATE TYPE & NUMBER
19	HOURS	10ths		
5-25			Replaced induction air Filter. Kerz Himmelzich AP 3276	774
5-31			Bleed RH brake system. George Wimmeliaci 1193276774	
2012	3386		FARE SHARE LTD. REPLACED LANDING LIGHT 3310 W RIDGE PIKE CHECKED ADS - SEE LIST IN A POTTSTOWN PA 19464 ICERTIFY THAT THIS AIRCRAFT HAS	WITH L.E.D., TOP LOG., TUBING,
			DETERMINED TO BE IN AIRWORTHY CONDITION DATE 6/22/12 TO LAY TIME 3386 TACH (T.T. = 5823)	
			CERTIFICATE # A134150726	



MICHELIN

Stabilimento di Cuneo

Piazza Robert Daubrée 12020, Ronchi - Cuneo

CERTIFICATE OF CONFORMANCE

CERTIFICATO DI CONFORMITA'

P\N		Tube size	•	Production k	ot
Codice	092- 308 - 0	Dimensione	5.00- 5	Lotto	49/09
materiale		camera		produzione	

Completely deflate the tube/tire. (To allow air trapped between tire/tube to escape.)
 Re-inflate the tire/tube to the correct operating pressure.
 Check pressure in 24 hours. Re-inflate to operating pressure (assumes trapped gas escaped). Repeat each day until all gas has escaped and pressure stabilizes.

1 28.1

DATE 2012	TOTAL T IN SERV		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED ST CERTIFICATE & NUMB
19	HOURS	10ths		(6)
6-22	3386	Toch	clw sB RASL-001 Vac pump inspection. Found within	, normal Wa
	5823	TT	range. Replace grammet and seal wires on top R/H corner	r of fireus
		-	Replayed lord mount above Landing lamp Replace	o-ring A
		=	Evel strainer plunger, Adjusted color fresh air c	able Replace
	7.5	11/	Evel strainer plunger, Adjusted colorn fresh air c fustener for bottom cowl LIH center position, &	ouge Himmelier
	=	2 2		AP3276774
American Company	3350		REPLACED MAIN BATTERY WITH NEW 6-25	David Com
26			5/NG02720657.	AP 3450726
2012				4
7-6-12	3406		Replaced nose tire and tube. Balanced same.	Ap3276774
7-174)	2		Installed new R/H broke pads. George Himmelieved AP327	6774
8-20-	2		Installed serviceable mose strut assembly, George Himmeliais	AP3276774
A.				

DATE	TOTAL TI		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
19	HOURS	10ths		G HOMBEN
9-19-12	3486		completed vac-pump inspection for RASL-002, Found Replaced fuel strainer internal filter gasket. Rotated L	within limits,
}			Replaced L/H brake pads. Bleed brakes L/H and R	IH. Repaired
			Replaced L/H brake pads. Bleed brakes L/H and R window stay attachment to window from e on pilots doo beffle seal contact to cowling Move #3 Exlinder. Season	r. Adjusted
CEX	DATE		=	74/00/7
	9/		CHECKED ADS, BLEED BRAKES, SERVICED NOSE ST 1 COMPLIED WITH FAR 91.207D (NEXT DIVE 9/20	PAT PRESSURE
	6	2	INSTAURD NEW BATTERY - DUE NEXT OCT 2014,	Marie Jen 2028 6
H.		75	10-31-12 3534 Toch Straighten and ni	vet RH elevator
	22	OKDA	Trailing edge near inboard side of to have Hummelseich AP3276774	im Tabo
	123	IN STATE	0==- 12-4-12 3560 Tach Service nose STrut 4	ith air.
1	1,0		1 = Longe Hommobiles AP3276774	1
	NOIL	JND		
		= 1		

7	MAINTENANCE RECORD						
DATE	TOTAL TIME IN SERVICE		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER			
19	HOURS	10ths		1 41 5			
2-14-13	3585	Tach	Replaced 2 cowling firewall Lord mounts. CompleseB 97-1 lower aft doorposts inspection. Nouracks f	red with Cessna			
	6022	17	SEB 97-1 lower aft doorposts inspection. Nocracks F	bund. Heplaced			
16			Pilot door stay Complied with Romen Service letter	RASL-002			
			Vac pump inspection. Replaced muffler. Replaced shroud. Removed (pulse lite system) with 337 form Soros venttubes	carb heat			
			shroud. Removed (pulse lite system) with 337 For	M, Installed			
1			Soros venttubes STC SA4005 NM) STC SA8150	SW Form 337			
			Joros venttubes doted 2-14-13 Installed Air Gizmo 496 Panel Dock with Eiled form 337 (NOT REQUIRED PER FSDO 5)	angle adapter,			
	. \		Eiled form 337 (NOT REQUIRED PER FSDO 5)				
7	LCERTIE	Υ ΤΠΑΤ	THIS AIRORAFT HAS Georg Hunnehouch AP	3276774			
	REEN IN	SPECTE	D IN ACCORDANCE WITH A/AN				
		NUAC					
	DETERM	IINED T	BE IN AIRWORTHY CONDITION.	1			
	DATE	2/14/	13/10TAL/11/19 6022				
	SIGNAT	URE	a Parid Com				
	CERTIF	CATE#	A1 3450 726	1			
	CLIKI						
				//			

		MAINTENANCE RECORD	
DATE	TOTAL TIME	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE. CERTIFICATE TYPE & NUMBER
19	HOURS 10ths	12 Contract Parker and LIH	and RIH Tires
5-17-13	3635 KAINED 3	Replaced 12 94 anther turn cowling fasteners. Replaced L/H Beed both bymaker bystems, busy Himmelruck AP32767	74
	BULLS OF STATE OF	+ + Mad secureable starter, Georg fimmelies	A AP3276774
7- 5-13	3669	Installed serviceable starter, Leng Hommelies PN. ERZ-8011 SN 1120500 Total time 53 hours	A
- 00	3//4	Installed new RIH outboard brake pad. George Hims	nelecch AP3276774
7-B-B			
8-2-13	6123	Completed vac pump insp. perRASC-002. Found within ling new muffler SN. 224747. Replaced LIH top and bottom mounts. Replaced baffle seal for cylinders 2 and 4. Secur	n cowling lord ed loose ceiling
		Plucard. Installed serviceable RHH aileron with hew	ushers for
9		new mottler stated battle seal for cylinders 2 and 4. second mounts. Replaced battle seal for cylinders 2 and 4. second mounts. Replace of the seal for cylinders 2 and 4. second Place of the seal of	276774
1		proper releation to	


	-
1	
400	
-0.0	A. Marie

			DI 11 B70-11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	ALITHODIZED CICNATURE
DATE	TOTAL TIME IN SERVICE		HITE WELL CHEDIZ OESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
19	HOURS	10ths	CCERTILY THAY THAY	
Au4			REPLACE BEACONI LIGHTISTUT, COMPLY WITH 91.207D	
2			NEXT DUE AND BOVY SERVICED-CHARGED BATTERY,	
2013				
			FARE SHARE LTD.	
			3310 W. RIDGE PIKE	}
			POTTSTOWN, PA 19464	
			TCERTIFY THAT THIS ATROPACT HAS	
			BEEN INSPECTED IN ACCORDANCE WITH A/AN	
			ANNUAL INSPECTION AND WAS	
			DETERMINED TO BE IN AIRWORTHY CONDITION.	
			DATE AND 2 13 TOTAL MARE 6123	
			SIGNATURE Mild Yem	
			CERTIFICATE # 41 345 0726	*
8-16-13			Installed serviceable interior door letch mechanisim and p for same. Surge Hommerack AP3276774	ush/pull tube
			for same. George Hommelrack AP3276774	·
		~		*
		1		

DATE 2013	TOTAL IN SERV	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
8-27-13		Installed new Artificial Horizon. PN. 5000B-36 51	1, T 101417N
11-8-13	3779	Replaced central qua filter, Replaced L/H ot BD. Replaced Baffle seal on bottom of induction Pressed minor prop picks. Bleed/flush brake syste Vac: pumpissinspection Per RASL 202 Replaced L/H brake bleeder	1 . 10
11/8	3779	L/H broke bleeder - CHECKED AD'S THEN 11/7/13, FARE SHARE LTD. 3310 W. RIDGE PIKE POTTSTOWN, PA 19464 TCERTIFY THAT THIS AIR CRACK	George Hemmoland A \$ 3276774
		BEEN INSPECTED IN ACCORDANCE WITH A/AN INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. DATE 11/8/13/1011/101 6214 CHARLES A 1 345 0 126	

DATE 2013			DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
19	HOURS	10ths		1 12 1
11-29	3790		Installed serviceable flap switch. Merge Himmelier	1 AP3276774
12-10	3792		Installed serviceable #1 OBS PN.066-3056-015N. 831	77
			Installed serviceable # 1 OBS PN.066-3056-013N. 831 Replaced 1 pilot seat stop and screwfor same, Inst and screw for copilot door aft attach point. Many Him	meliaci AP3276774
1			11 1 1 1 1 1 1 1 1 1 1 1 2 2 2 1 7 2	
12-11			Bleed RIH brake system. Leong Himmelrent A 1327677	7
£				
12-23	3795		Installed serviceable starter PN. MZ 4206 SN. 4A000600.	rouge Himmilasof
1-24-14				AP 3276774

DATE	TOTAL I	VIC	Jet East Corporate Aviation, LLC	• TRENTON-MER	CER AIRPORT •	TRENTON, NJ 0862	8 • Phone	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
19	HOURS	1	(21	15) 937-9020 • Fax	(609)-600-1718			a NUMBER
		-1	To the state of th	REG#	N80495	DATE:	2/17/14	
			= COCT	MAKE:	Cessna	W/O #:	14TR26263	
				MODEL:	172M	HM:	3985.4	
			AIRFRAME LOG	S/N:	17266619	TACH:	3810.5	
		$\left - \right $	CERTIFIED KING KT-78 XPDI FOUND WITHIN TOLERANCE			FAR 91.413 AND FA	AR 43 APPX. F,	
			I certify that this aircraft has been repair	ired and inspecte	ed and determined	to be in airworthy	condition and	
		-	return to service. Pertinent details of the	ne inspection are	on file at this age	ncy under the work	number	
			(11),					
1		Ĺ	Signed (for Jet	East Corporate	Aviation, LLC CRS	SJ21R713Y	
							;	
				2				
1								

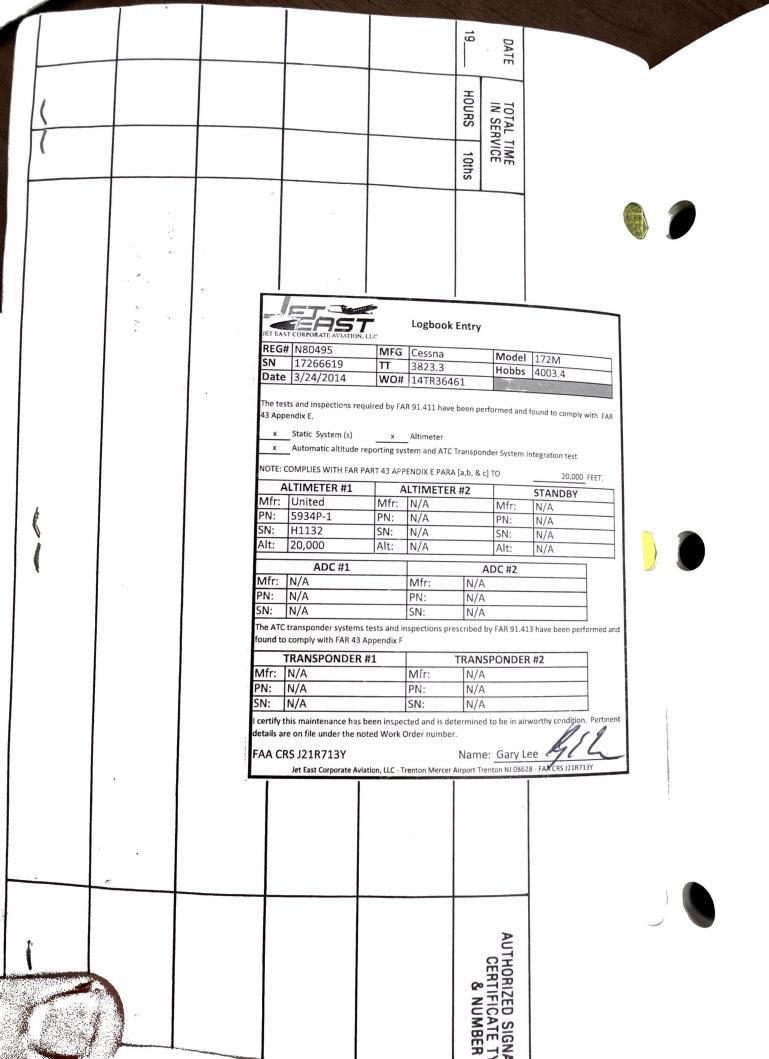

DATE 2014 19	TOTAL T IN SERV		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
19	HOURS	10ths		
4-18	3842	Tach	Installed overhauled starter PN. MZ 4222 SN. H-MI	0170.
			Replaced reguling mount for bottom cowl LIH side	offirewall.
			RUN UD OK GEORGE Hommelrens AP3276774	L
6-16 2014	3870		cleared pitot most of debris and replaced corroll for same. Flush and bleed L/H brake system. Morgo Him	hed hardward
~				111324-11
7-11-14	3878	Fach	Rotate R/H main tire. Replaced L/H inbd. brake brake brakes. Complied with Vac ouns inspection per R	Pad. Flush and bleed ASL-001. Replaced
	6315	TT	Rotate R/H main tire. Replaced L/H inbd. brake brakes. Complied with Vac pump inspection per R 3 Lord coul mounts. Installed new R/H steering pilot instrument panel knee pad. Morge Himmeland	AP3276774

	MAINTENATOL HEOOID								
DATE	1 IN SERVICE		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER					
19	HOURS	10ths		A NOMBER					
			SERVICE AUX FUEL TANK FILTER & OPS V 545 TEM, REPLACE CARGO AREA PLASTIC TRIM (HORIZONAR PIECE), REFURB' PITOT COURR, CHELKED ADS THRU KNOOK JUNE; SEEAD UST IN AFT OF						
			545 TEM, REPLACE CARGO AREA PLASTIC TRIM						
			(HORIZONTA PIECE), REFURB' PITOT COVER, CHELKED						
			ADS THRU KNOOK JUNE , SKEAD LIST IN AFT OF						
			THIS 406.						
			FARE SHARE LTD.						
			3310 W. RIDGE-PIKE						
			POTTSTOWN, PA 19464 I CERTIFY THAT THIS ATRICEMENT HAS						
			BEEN INSPECTED IN ACCORDANCE WITH A/AN						
			ANNIAU INSPECTION AND WAS						
			DETERMINED TO BE IN AIRWORTHY CONDITION.						
			DATE 7/11/14 TOTAL TIME 6315						
			SIGNATURI CHIM						
			CURTIFICATE # 41 345 0726						
			1						
	1	1							



MICHELIN

Stabilimento di Cuneo

Piazza Robert Daubrée 12020, Ronchi - Cuneo

CERTIFICATE OF CONFORMANCE

CERTIFICATO DI CONFORMITA'

P\N T	Tube size		Production lot	
materiale	Dimensione camera	17.5x6.25+6.00-6	Lotto produzione	19/13

Gentleman, we hereby certify that the parts supplied and referenced by the production lot, are manufactured according to applicable specifications. Substantiating documents regarding the subject parts are on file available for inspection upon request.

Signori, con questo documento noi certifichiamo che i materiali forniti ed identificati col riferimento del lotto di fabbricazione, sono realizzati conformemente alle specifiche richieste. I documenti previsti, relativi ai materiali in oggetto, sono archiviati e disponibili per ispezione su richiesta.


	Tubes Quality Assurance Manager	Name	Ambrogio	Signature \ Firma	Date \ Data (d/m/y)
- 1	Responsabile Garanzia Qualità camere	1	M.	-43	14/05/2013

IST_153_PLE_CNO_FOR02 Edizione del 29/04/2009

			AUTHORIZED CIONATURE
DATE 20/4	TOTAL IN SER	VICE	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
19	HOURS	10ths	Crowned FAR 912070
9-2	3924		Replaced ELT. Battery, Next Due Nov16, Performed F.A.R. 91.2070 inspertion, Next INDIVE Sept 15. Steorge Himmelraid Af3276774
			inspection, Next III Die Sept 15. Steam No.
9-5	3924		Changed L/H marmitine. Lunge Himmelracit AP3276774
		- 1	A TOTAL TOTAL STATE OF THE PARTY OF THE PART
9-19	3942		Replaced. R/H, outb. brake pad. Bleed R/H brake system. Seonge Himmelrand AP3276474
1-25			Replaced rollpin to outbol. copilot seat belt lotch. Heroe Himmelwest AP3276774
10-3	3 <i>953</i>		Replaced, R/H main tire and tube. Replaced R/H Nav. bulb. George Himmelreich AP3276774
	1		



			MAINTENANCE RECORD	
DATE 2014	TOTAL T IN SERV		DESCRIPTION OF THE WORK PERFORMED AUTHORIZED CERTIFIC & NU	3549
10-9	3962 Se	WAS	clean and flush battery box. Installed new battery 6-25 SNG02835495 Monge Himmelrus 1 AP3276774	8888
	1 E	CTION AND	10-30-14 serviced nose strut with air Installed 3974 Tach serviceable L/H Bottom MLD strut cuff squrings Replaced R/H door bottom hinge. Din.	
	RIDGI-PIK OWN, PA 19	CORDANCE V	Dressed minor prop nicks. Heerge Hummelreal AP32767	
	3310 W POLTST	26 JEDIN AC	6-2-15 Installed new compass and performed Ewing)
	CERTIEY	BEET INSPI	New SN. A5-12222 0/353,30/21,60/54,90/85,120/116,150/149,180/181,210/212,240/242,270/ 300/296,330/323 Herry Hommelreich AP3276774	





LOGBOOK SUPPLEMENT

COMPLIED WITH THE FOLLOWING MAINTENANCE TASKS:

DESCRIPTION

REMOVED AND REPLACED VACUUM PUMP WITH OVERHAULED UNIT BY RAPCO INC (CRS: NE5R064N ON WO: 164063 DATED: 22/APR/2015) REF AMM CH: 15 ENGINE RUN/OPS NORMAL

REMOVED AND REINSTALLED / REPLACED THE FOLLOWING COMPONENTS AT THIS TIME:

P/N OFF	S/N OFF	P/N ON	S/N ON	DESCRIPTION
RA215CC	A33085	215CC	164063	VACUUM PUMP

Model No: CE-172

Registration No: N80495

Serial No:

17266619

Date:

07/16/2015

Hobbs: 4331.4

Tach:

4071.2

The aircraft/airframe/engine/propeller identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and with respect to the work specified in Work Order 26410 except as otherwise noted is approved for return to service only for the work performed.

Authorized Signature

Jet Aviation, 380 Hanscom Dr. Bedford, Mas

DATE 2015	TOTAL T	/ICE	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
-19	HOURS	10ths	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	re secure nose
7-24	6514	TT	Bled brakes L/H and F/H, Bulance and replace	
	4077	Tach	Bled brakes L/H and P/H. Bulance and replace nose to wheel race, two Himmelanck AP 3276774	
	7			
			FARE SHARE LTD. 3310 W. RIDGE PIKE POTTSTOWN, PA 19464 1 CERTIFY THAT THIS AIRCRAFT 1 LOG.	
			POTTSTOWN, PA 19464 SEE AD UST IN APT OF	
			BEEN INSPECTED IN ACCORDANCE WITH A/AN	
			ANNUAL INSPECTION AND WAS	
			DETERMINED TO BE IN AIRWORTHY CONDITION.	
	*		DATE 7/24/15 TOTAL TIME 6514	
-			SIGNATURE A DIVER COM	
			CERTIFICALI # 4134500726	
7-79 4	4080		Replaced brushes inside alternator Run-up and ops checkery Himmelran 1 AP3276774	KOK.
1 21-15	1		Heorg Hommelren 1 AP3276774	
I				
	1			

DATE 2015	TOTAL T IN SERV		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE
19	HOURS	10ths	A. Y. A.	& NUMBER
8-5-15			Replaced priot L/H seat back recline clevis pin.	George Himmelrich AP3276774
9-18-15	4139		Replaced 1 L/H of bd. brake pad. DELEVABLE HORZ VECONDEVEL VOLTAVA	April 76774
21-01	4150		mount Service buttery box Replaced to RIH co	wling Lord
10-29	4161	1.3	L.L. inspection. Merge Hemmotra	JAP3276714
10-30	4162		Replaced RH Tire. Replaced R/H rotor and pads treat extenior of R/H wheel center section. Bleed brakes.	Lessey Himmslock
P				111-3216114



2015	TOTAL IN SER		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
19	HOURS	10ths		
11-13-15	4/7/	TACH	Replaced LIH main tire. Replaced o-ring To, L/H. brake	George Hommebrews
,	1608	TT	whol culinder and beed system. Installed 3 new	AP 3276774
(' '	Replaced L/H main tire. Replaced o-ring to L/H brake wheel cylinder and deed system. Installed 3 new windshield bumper washers to resensurvisors.	
1			windshield bompet washeld to reseption visors.	
1			CLEANED BILGE AREA & TRATED WITH PENETRANT O COMPUED WITH 91.207D ECT TEST NEXT DIE 11/2016, CHEE	DECESSON INHIBITOR
			CONPLIED WITH 91.207D ECT TEST NEXT DIE 11/2016, CHEL	LAND THEY ITINIS
				ARE LTD.
			18 U 3.0	PIGE PIKE
				10 COM C
			I CERTIFY THAT THIS A	The state of the s
			BEENINSPECTEDINACCO	
			ANNUAL	INSPECTION IND WAS
			DETERMINED TO BE IN ARE	WITH CONDITION.
			11/13/15	TT 4111608
			SIGNATURI Aleria	Elm
			CERTIFICATE # A1340	8726
			ECT BATTERIE DUE NOV 2016	
1				

			-	
DA'		MAINTENANCE RECORD		
2015	TOTAL TIME IN SERVICE	DESCRIPTION OF THE WORK PERFORMED		AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	76 A	Replaced fuse for hobbs meter. Leonge Him	melrecot	AP3276774
2-16-16	Se	coved copilot interior door handle. George Himmelia	EVKI AP3	
	T certify that FAR 43 Appel 20,000FT. The ATC Tran found to comp	Sanderson Aircraft 610-383-1521 2016 Tach:4217.5 Total Time:6654.5 If the altimeter and static system test required by FAR 91.411 have been performed per endix E and was determined to be in airworthy condition. The Altimeter was tested to insponder of aircraft N80495 Has been tested in accordance with FAR 91.413 and body with the requirements of FAR 43 appendix F. Model: KT-78A SER. NO. 3877		



MICHELIN

Stabilimento di Cuneo

Piazza Robert Daubrée 12020, Ronchi - Cuneo

CERTIFICATE OF CONFORMANCE CERTIFICATO DI CONFORMITA

PIN		Tube size	18 ber	Production 1-4	
Codice	092- 500 - 0	Dimensione	17.5x6.25+6.00-6	Production lot	
materiale		camera	17.300.2370.00-6		14/14
		Carriera		produzione	

Gentleman, we hereby certify that the parts supplied and referenced by the production lot, are manufactured according to applicable specifications. Substantiating documents regarding the subject parts are on file available for inspection upon request.

Signori, con questo documento noi certifichiamo che i materiali forniti ed identificati col riferimento del lotto di fabbricazione, sono realizzati conformemente alle specifiche richieste. I documenti previsti, relativi ai materiali in oggetto, sono archiviati e disponibili per ispezione su richiesta.

Tubes Quality Assurance Manager Responsabile Garanzia Qualità camere		Ambrogio M.	Signature \ Firma	Date \ Data (d/m/y) 10/04/2014
---	--	----------------	-------------------	----------------------------------

IST_153_PLE_CNO_FOR02 Edizione del 29/04/2009

DATE	TOTAL T		DESCRIPTION OF THE WORK PERFORMED	CERTIFICATE & NUMBER
19 <u> </u>	HOURS ゲスス1	10ths	Charged battery. George Himmolecek AP 3276774	.01.
5-31-lb	4252		Replaced RIH main time Tube. Replaced 1/1 nav light a for same lens cover. Many Himmelical AP3276774	nd one rivi
6-14-16	43.53		Installed new Rosen Sunvisor P.W. R 1180301-001 onto copilot side of aircruft. Deorge Hommelwol AP3276774	
				Pasa

	MAINTENANCE RECORD							
2016	TOTAL T	VICE	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER				
19	HOURS	10ths		O NOMBER				
G-14-16	4253		PN R1190301-001. George Humnelson AP 3276774					
6-15-16	4253		Charged bottery. Mary Himmelrech AP3276774	1				
				3				
7-8	4269.		Bleed L+R broke systems, Replaced 4 Lord mounts on Torque shimmy dampner attach points. Torque nose gen attach points. Replaced springs in R/H external	Firewall. Torque link door letch				
,			Replaced rivers with hardware in RIH bottom door hing LIH inbol. brake pad Installed loaner carb heat shrow Merry Hummelieux 1 AP3276774	e. Install new				



E TOTAL T	IME ICE	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIG
HOURS	10ths		& NUMBE
		INSPECTED FUEL TANK INTREIOR, REPLACED LH TANK OCTANE "100" STICKER, PERFORMED 91-207D ELT NEXTAGE 12 REPLACED FOND. PRIP SPINNER SUPPORT OF THE NEW, TREATER BATTERY BOX. CID FOR CORROSION, DRESSED PROPELLOR BLAG	MONTHS,
		REPLACED LH STROBE FLASH UNIT POWER SUPPLY PN 152-6 SIND16052993 WITH NEW. CHEKED AD'S 7/6/16.	0007
		FARE SHARE LTD.	
		3310 W. RIDGE PIKE	
		ICERTIFY THAT THIS AIR CRAFT HAS	
		BEEN INSPECTED IN ACCORDANCE WITH A/AN ANNUM INSPECTION AND WAS	
		DETERMINED TO BE IN AIRWORTHY CONDITION.	
		CERTILI A13450726	
	IN SERV	HOURS 10ths	DESCRIPTION OF THE WORK PERFORMED HOURS 10ths INSPECTED FACE TANK INTERIOR, REPLACED LH TANK OCTANE 100% STICKER, PERGUAMED 91.207D ELT NEXT BAR 12 REPLACED FAND PROPERTY OF THE NEW TREATER BATTERY BOX LID FOR CORROSON, DRESSED PROPERTY ON 152-6 SIN J16052993 WITH NEW. CHECKED ADS 7/6/16. FARE SHARE LTD. 3310 W. RIDGE PIKE POTTSTOWN. PA 19464 I CERTIFY THAT THIS AIR COAPT HAS DEED INSPECTED IN ACCORDANCE WITH A/AN ANAM INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. DATE 7/8/16 TOTAL TIME 4269 SIGNATURE DATE OF TOTAL TIME ATTENTED OF TOTAL TIME

	iILL Battery of ttery installe	BATTERY TO NY BREACH authorized to all obligation	will be actual to the of commence of commence of the of commence of the of commence of the of any battery on which the and operating the of any batteries of a situation of any affected the perated beyon the manufacture of the manufactur attery is of a situation of a situation of the manufactur attery is of a situation of the manufactur attery of a situation of the manufactur attery of the manufactur attery of the manufactur attery of a situation of the manufactur attery attention of the manufactur a	
	Battery only. y installed in original	OPERATE OF THE o give any or liability		
2016	TOTAL IN SER	RVICE	DESCRIPTION OF THE WORK PERFORMED	CERTIFICATE TYPE
9-13-16	4313	10ths	Replaced the following interior plastic in the rear be moulding - Baggage K0515012-24, Moulding K0500210-13 headlinen K0515015-1, beorge Hommelouit AP3276	ggage gred 5, Baggage 774
			FARE SHAKE LED. STON RIDGE PIKE POLISIONN PA 19461	
9-16-16			Replaced lord mount for top coul R/H side. Many Himmelran	
11-2-16	4541		Installed new G-25 Battery 3N.602940575 Decryc Hummelreich AP 3276774	
1/23			INSTACLED LOANER/ SPARE RH WHEEL of TILE ASSE	rBCY.
2016			David Gan 4/3450126	

			MAINTENANCE RECORD	
DATE 2016	TOTAL IN SERV		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
12-16-16	4365		Installed 2 new firewall bottom cowling Lord mounts. DELEKTIVED TO BETT VIBRORITIES CONDITION	AP 3276774
2-16-16			bye check R/H center wheel hub for crocks and replace socket halt Removed Toran, disconnected power source, and instrument panel. Merce Hammeland AP 3276774	
1-20-17	4397		Replaced LIH autiboard, Arthor pad, George Hummelwich A	P3276774
		`		

t apply if is been use oyed; or if t aircraft many do not nly to ba to mainter we been (we have (we have (we have (subject to repaired, of TBP has, he has been MAINTENANCE RECORD

ed above y respon the repla

eplacment of the original ston.

IVE REMED
EMENT AS :
RANTIES E
THOUT LIM
OF MERCH
RPOSE IN
Y INCIDENT
T OF ANY C
ILLURE OF AI
IG OUT OF
IN. No perso
me any addi

hange any transibility with

			MAINTENANCE RECORD	AUTHORIZED SIGNATURE.
				CERTIFICATE TYPE & NUMBER
DATE	TOTAL T IN SERV	IICE	DESCRIPTION OF THE WORK PERFORMED	
19	HOURS	10ths	DRAINS, REMOVED LOANER	
DEC	4365		CLEARED CLOGGED BELLY DRAINS, REMOVED LOANER R-MAIN WHERE TIRE ASSY REINSTALLED ORIGINAL AFTER HARDWARE REPLACEMENT, PURGED BRAKE RUND, OKKIND BUT PER 91.207D AFTER NEW BATTERY IN:	me
21/2			HARDWARE REPLACEMENT, PURCEED AFTER NEW BATTERY IN:	BOOK.
2016			R-MAIN WHERE THE ASSIF RECED BRAKE RELID ; HARDWARE REPLACEMENT, PURGED BRAKE RELID ; CHELKED BUT PER 91.207D AFTER NEW BATTERY IN: CHELKED AD'S - SEE LIST IN AFT SELTION OF LOG	Dec 2
			FARE SHARE LID.	5
			3310 W RIDGE PIKE POTTSTOWN, PA 19464	
			ICERTIFY THAT THIS AIRCRAPT HAS	
			BEEN INSPECTED IN ACCORDANCE WERL AVAN ANNUAC INSPECTION AND WAS	
			DETERMINED TO BE IN AIRWORTHY CONDITION.	1
			SIGNATURE DAUG GENERAL TIME (0802)	
			CERTIFICATION A1-34050726	
				11 1100
2-24-17			Shorten and reuttach cabin air vent cable. Near Dressed prop nick. APS	of Hummelruck
			Vressed prop nick. HTS.	4/6//4
			, ,	

MAINTEN	ANCE	RECORD

			MAINTENANGE	
	,		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED ST CERTIFICATE & NUM
DATE	TOTAL I	VICE	DESCRIPTION 5.7	1
19	HOURS	10ths	Instelled serviceable rear window. George Hummelroich AP37	10//4
3-6-17	4405		Installed 1	>
3/20/17	4409		REMOVED ACTERNATUR SIN H-MOZII9Z & INSTALLED HARTERUNIO1244 OIH HARTERU WO M94573D. HARIO101244 OIH HARTERU WO M94573D.	2
7			HIRIOIAIZAG OIH HARTZKU WO MITTER AP34507ZU ANTIGEROUND RING 600D, David Gen AP34507ZU	į
3-29-17	4410		CHATONTH WARRANTY. CHAMBER IN BATTERY and inoplaced retainer washen onto Changed in battery and inoplaced retainer washen onto Soften couling fastener strongs Ammeleration A P 3276774	i i
			Bottom country 147 11/1/	ned fuel
5-10-17	4439		changed battery. Repaired L/H . P. 1ead shielded and, wine. Eleu changed battery. Repaired L/H . P. 1ead shielded and, wine. Eleu changed battery and replaced gasket PN 0756009-8 in same. Hence Hummeland P32767741	
1-17		*	Replaced L/H main Tire. Dungs Vimmeltein AP327671	74

<u></u>				
DATE 2016	TOTAL T	VICE	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE. CERTIFICATE TYPE & NUMBER
19	HOURS	10ths		
June 16	4464		FARF SHARF LTD. SHOW MINOR PIKE POTINIONA PA 19464 ICERTIFY THAT THIS ARCLANT INS SEE AD UST IN APT	
			BEEN INSPICTED IN ACCORDANCE WHITE AAN SECTION THIS BOOK,	
	1	1	ANNUAL INSPECTION AND WAS CHEEKED ADS THEN	
	1	1	DETERMINED TO BE IN AIRWORTHY CONDITION. 500 9.	
	1 ' 1	1	DATE 6/14/17 TOTAL MME 6901	
			SIGNATURE Devid Jan	
	1	1 '	SIGNATURE / VIVO	'
	1	1 /	CERTIFICATE # 3450726 IA	'
	1	1/		
6-16-17	4464	Toch	Replaced flop chofe buttons. Replaced 2 rivnuts for Boot attachmen t. Bled brakes. Replaced L/H interior door able unit. Steparilled crack to 1/H Ldg strut fairings. Fastener on bottom cowling. (14 turn) Large Himmelson's A.	I'll starion
- 1	6901	ITT	Det attachnen t. Bled brakes Rentaged LIH interior dans	LIM Specification
ľ	6101	(II)	0001 all 1011	panel with xivice
		-	able univ. > repairilled crack to L/H Lda strut tairing	Roplaced
	1	1	Fastener on hattom cowling (14 turn) Home Home Spenish A	03276774
1	, ,	1	The state of the s	//
1		1	1	
				*0.
1				



			MAINTENANCE RECORD	
DATE 2017	TOTAL T IN SERV		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
7-11			Replaced R/H tire. Replaced R/H brake pads. Bleed R/H brake system. George Hommeland # P327	
	4557	Toch	Replaced tail now bulb Replaced Central airfil brake systems. Service and charge battery, Replaced shoulder rivet bushings. George Hommelruit 1	ter Bleed both ced sept belt
			FARE SHARE LT 3310 W. RIDGE PIKE POTTSTOWN, PA 194	D.
			BEEN INSPECTED IN ACCORDANCE W ANNUAL INSPECTED TO BE IN AIRWORTHY OF	TION AND WAS
			DATE 9/8/17 TOTAL HMI SIGNATURE NAME SIM CERTIFICATI # A13450726	6994

7				
1017 10	HOURS	10ths	DESCRIPTION OF	& NUMBER
9-22			Replaced L/H brake pads. Bleed L/H brake system serge Himmelreion Ap 3276774	1.17
10-6			Rotated R/H main + Tire Replaced and balanced naser ? Red overhead light bulb. Leong Himmelteich Ap 327677	
10-24	4611		Replaced fuel senders L/H sn. 172788 R/H sn. 171590. Qty. check. Adjusted rosen visors pivot post tension. Form	
11-30	4645		Installed new v-pump RAP 215CC SA 56291. Installed no garlock seal. Run up and leak check ok. surge Himmelien	1AP3276774
				\$.
				*

_ 3







AUTHORIZED SIGNATURE.

CERTIFICATE TYPE & NUMBER

AIRFRAME

DATE

19___

TOTA

IN S

HOURS

MAKE: Cessna MODEL: C172M N80495 S/N 17266619 A/C TT: 4656.5 TSN: 7093

DATE: 12-10-17

	lubricate flight controls.	
2.	Serviced brake reservoir's	

3: Replaced RH Side Out board MLG brake shoe.

4: Adjusted LH MLG Bearing pre-load.

5: CAP Checked battery serviced with distilled water.

6: C/W AD 2011-10-09 Seat and track insp. C/W AD 76-07-12 Bendix switch AD by ops check.

7: Verified all AD's are up to date. Using AD Tool box

C/W ELT test IAW Part 91.207b

I certify this aircraft has been given an annual inspection IAW Cessna 100 hr inspection check list

and has been determined to be in airworthy condition.

Fly Elite 1149 Glasgow St Pottstown, Pa 19464

Steven Holliday

A&P 3478638 IA


						90.00
3-2-18	4648	Talk	Replaced	R/H main tire, Replaced tail now &	1,000	4 Himmelzece 1 14 P 32 76 774
3-26-16	4711		Replaced clean soc	2 bottom cowling studs. Replaced ho KeT for same. Heving Himmelrand AP 32	665 met 176774	er fuse and

		MAINTENANCE RECORD	
DATE	TOTAL TIME IN SERVICE	DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
1			
	AIRFRAME		3o n
		ODEL: C172M N80495 S/N 17266619 A/C TIME: 4749.5	
	DATE: 06-20-18		
	1. lubricate flight o	ontrols. —	
_	2. Serviced brake r	eservoir's.	
	3: Replaced LH inb	oard & outboard seat rails P/N MC0511243-4 IAW Cessna MM	
	5: Cleaned Inspect	ed and repacked all wheel bearings.	4
	6. Installed new ba	ttery P/N G-25 IAW Cessna MM. — C/M AD 76 07 12 Rendix switch AD by ops check.	
	7: C/W AD 2011-1	0-09 Seat and track insp. C/W AD 76-07-12 Bendix switch AD by ops check.	
	8: Verified all AD's		
	C/W ELT test IAW F	t has been given an 100hr inspection IAW CESSNA 100 hr inspection check list —	
	rectify this aircrai	mined to be in airworthy condition.	1.00
	and has been deter	Calle Sent	
	Fly Elite	Colin Senavitis	
	1149 Glasgow St	A&P 4065283 —	
	Pottstown, Pa 1946	34	







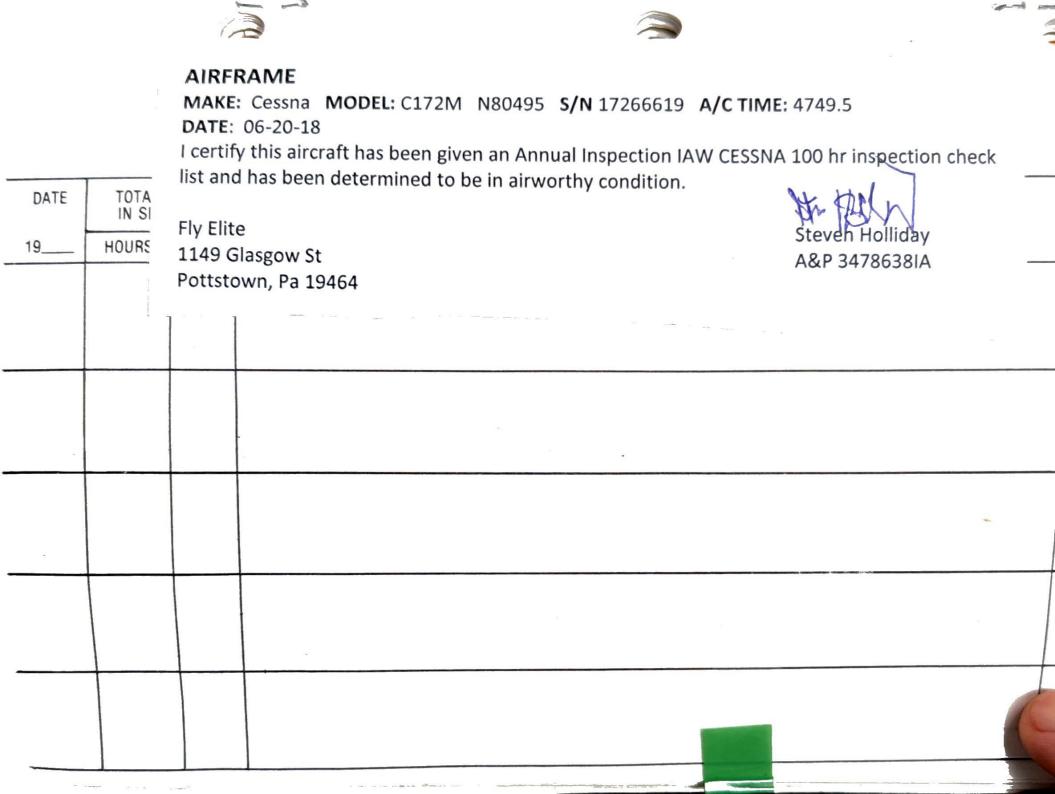

			MAIN L	MANUE RECORD	
DATE 19	TOTAL TIME IN SERVICE		DESCRIPTION OF	THE WORK PERFORMED	AUTHORIZED SIGNATURE, TYPE R
		111- 0	18600 Edison Avenue Chesterfield, MO 63005 (636) 778-4400	*	
	Airframe Date: 10/01 Registratio Model: Ces	n: N80495	Tach: 4871.6 S/N: 17266619	Hobbs: 5388.7	
	The aircraft discrepanci	Opened in Complied dimension Complied No defect Researcher Removed Reinstalle	onal inspections. No defects noted at the desired AD 76-07-12 amendment 39-30 at some noted at this time. The defects have all the defects at the defect and replaced L/H fresh air SCAT tubed inspection panels. Bove was inspected and repaired in according to the operator. The aircraft is noted.	024 dated August 30, 1977, "Bendix ignition switch" by ft 9/16/2019 – 9/29/19. See AD log under separate cover for	r details.

DATE	TOTAL T IN SERV		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATUR CERTIFICATE TYPE & NUMBER
19	HOURS	10ths		
Aprij 14 202	0		Model # KT 78 A Serial # 5877 Aircraft N 80 495 Date: A p 1 1 4 2020 Transponder system tested in accordance with part 43, Appendix "F" & Appendix "E", Subpart (c) for compliance with FAR 91.413. Signature: Market Mark Order # 11065 MUELLER AVIONICS, INC. CRS # QYVR0441	
			Model # 59349-1 Serial # # 1137 Aircraft N 80 495 Date: Apply 14 2020 Altimeter, Altitude Reporter & Static System tested in accordance with Part 43, Appendix "E" for compliance with FAR 91.411 Altimeter Tested to Work Order # 1100 Signature: MUELLER AVIONICS, INC. CRS # QYVRO44J	

DATE TOTAL TIME IN SERVICE 19 HOURS 10ths	
19 HOURS 10ths	
.	
	1
	1

04/28/2020. N80495 Cessna 172M

Tach: 4872.5. SN: 17266619

Complied with an annual inspection in accordance with FAR43 appendix D. Replaced brake pads with new pn: RA066-30026. Resealed brake calipers. Replaced rudder Cap with new pn: K0531006-112. Replaced rudder butt Cover with new pn: GF0531006-80-791. Replaced dorsal Fin tip with new pn: 28-16-80A. Replaced dorsal fairing with new pn:K0531012-2. Replaced left strobe tube assembly pn: WEA427. Replaced cabin door hinge pins with new pn: 035-CDHP-KT-1. Replaced the following cabin interior Trim pieces 2each shoulder harness tray pn: 20-14-80A. Aft side window trims pn: 059-P0515027-3/4. Replaced ELT battery pn: BP1020 exp date-Jun 22. Complied with FAR 91.20(d). Complied with AD2011-10-09 inspect seat tracks Next due April 2021. Complied with AD76-07-12 functionality Checked Ben is switch. Installed uAvionix tailbeacon ADS-B Pn: 11-17246 in accordance with installations manual UAV-1002514-001 RevB.

I certify that this aircraft was inspected in accordance with an Annual inspection and has been determined to be in airworthy Condition.

Ronald L Hill Jr.

Rowshuz

A&P3528686 IA

AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER



SSID: deanon-7863 Pass: Dalumange





