

**AIRCRAFT LOG**  
**AF5-1**





**SHERWIN-WILLIAMS.**  
Aerospace Coatings

Base Coat Colors:

STERLING SILVER

CM0855660

CORSO RED

SU279

Use compatible primer and clear per  
AMM and SW product data sheets

North America 1.888.888.5593

International 316.733.7576

[www.swaerospace.com](http://www.swaerospace.com)

415 E. Commerce Street

Andover, KS (USA) 67002

# Aircraft Log

## TABLE OF CONTENTS

TC #A00009CH


SECTION SEQUENCE	DESCRIPTION OF SECTION	PAGE NUMBER
1st SECTION	AIRCRAFT DESCRIPTION	i
2nd SECTION	INSTALLED EQUIPMENT	1
3rd SECTION	MAJOR ALTERATIONS	3
4th SECTION	LIFE LIMITED PARTS OR OVERHAUL REQUIREMENTS	5
5th SECTION	AIRWORTHINESS DIRECTIVE OR FACTORY BULLETIN COMPLIANCE RECORD	9
6th SECTION	ALTIMETER & STATIC SYSTEM CHECKS (F.A.R. 91.411)	17
7th SECTION	RADIO AND ELECTRONIC CHECKS	19
8th SECTION	MAINTENANCE RECORD (F.A.R. 43.9)	29
9th SECTION	INSPECTION RECORD (F.A.R. 43.11-91.409)	43

Aero Products Corporation


Copyright 1975 All Rights Reserved


# INSTALLED EQUIPMENT

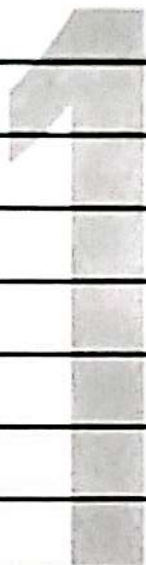

ITEM	MANUFACTURER	MODEL	SERIAL NO.
ENGINE	Continental Aerospace Technologies Inc.	TS10550K	R 1042190 L
ENGINE			R L
PROPELLER	Hartzell Propeller Inc.	PHC-23P1F-1W	NJ2489B
PROPELLER			
ENGINE			
ENGINE			
PROPELLER			
PROPELLER			
ENGINE			
ENGINE			
PROPELLER			
PROPELLER			
ENGINE			
ENGINE			
PROPELLER			
PROPELLER			





Date	Total Time		Time Since Last Overhaul		Engine Service and Maintenance Record
	Hours	Min	Hours	Min	
Record maintenance actions including engine part removal and installation and compliance with inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins					
Carried forward <span style="float: right;">Engine - page 2 of 2</span>					
<div style="text-align: right;">wo: GA2146</div> <div style="text-align: center;">  <p>Glencoe Aviation - 6253 Airport Industrial Blvd - GONZALES, LA 70737 - 225-460-3636</p> </div> <p>Gasket, Installed (6) P/N 640612 - WASHER: NOZZLE, ENGINE, RUBBER, .500DX.311D, Installed (2) P/N 633958-5 - Seal, Installed (6) P/N 633958-3 - SEAL- COMPRESSION, Installed (12) P/N 630979-9 - SEAL, O-RING, Installed (6) P/N 628556 - Washer .311dx.030d, Installed (18) P/N ms35338-44 - lock washer, Installed (18) P/N 20522 - Washer.</p> <p>6. Completed engine magneto timing check to 22 degrees in accordance with engine data plate and Continental M-0 6-4.9.1.2 with satisfactory results no adjustments needed at this time.</p> <p>7. I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND HAS BEEN DETERMINED TO BE IN AIRWORTHY CONDITION AT THIS TIME.</p> <p>With respect to the work performed, this engine is approved for return to service. Details of work performed are on file with Glencoe Aviation under work order: GA2146.</p> <p>Dayne Bounds A/P IA 2782783 <i>[Signature]</i></p>					

Date	Total Time		Time Since Last Overhaul		Engine Service and Maintenance Record
	Hours	Min	Hours	Min	
Record maintenance actions including engine part removal and installation and compliance with inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins					
Carried forward <span style="float: right;">Engine - page 1 of 1</span>					
<div style="text-align: right;">wo: GA2200</div> <div style="text-align: center;">  <p>Glencoe Aviation - 6253 Airport Industrial Blvd - GONZALES, LA 70737 - 225-460-3636</p> </div> <p>NS2MK Flight: 118.7 CONTINENTAL TSIO-550-K2B, S/N: 1042190 March 20, 2023 Hobos: 95.7</p> <ol style="list-style-type: none"> <li>Removed and installed cylinders # 1 and #3 to perform CONTINENTAL MANDATORY SERVICE BULLETIN 23-01A Crankshaft counterweight inspection. After Removal of cylinders no defects as described in the service bulletin were found. Re-installed cylinders with installation kit Part # . Cylinders were torqued as per Continental MM and all associated equipment was installed as per Cirrus MM.</li> <li>Draned oil with sample taken and removed filter. Cut and inspected filter for metal with none found at this time. Installed and safetied new filter. Serviced engine with 7qts of Piston Engine oil. Cleaned engine and ground run satisfactory with no discrepancies at this time. All work accomplished in accordance with Continental Manual M-0 6-4.8 and Cirrus SR22T AMM 05-12. Installed P/N AA:8108-2 - OIL FILTER. Installed P/N CA-001-NP - Oil sample. Installed (8) P/N 20w50 - Phillips Oil.</li> <li>Removed and replaced EGT Probe Part # 24585-001 as per Cirrus AMM SR22T Installed P/N 24585-001 - EGT PROBE. Installed P/N FRT - Freight.</li> </ol> <p>With respect to the work performed, this engine is approved for return to service. Details of work performed are on file with Glencoe Aviation under work order: GA2200.</p> <p>Theo Mills A/P 3572974 <i>[Signature]</i></p>					

Date	Total Time		Time Since Last Overhaul		Engine Service and Maintenance Record
	Hours	Min	Hours	Min	
Record maintenance actions including engine part removal and installation and compliance with inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins					
Carried forward <span style="float: right;">Airframe - page 1 of 1</span>					
<div style="text-align: right;">wo: GA2346</div> <div style="text-align: center;">  <p>Glencoe Aviation - 6253 Airport Industrial Blvd - GONZALES, LA 70737 - 225-460-3636</p> </div> <p>NS2MK Flight: 109.1 CIRRUS DESIGN CORP, SR22T, S/N: 2468 August 15, 2023 Hobos: 134.9</p> <p>Complied with Cirrus SB2X-42-23 Garmin Software N9 Update. Ops check completed with no discrepancies noted at this time.</p> <p>With respect to the work performed, this airframe is approved for return to service. Details of work performed are on file with Glencoe Aviation under work order: GA2346.</p> <p>Theo Mills IA 03572974 <i>[Signature]</i></p>					
Carried forward <span style="float: right;">Airframe - page 1 of 1</span>					
<div style="text-align: right;">wo: GA2559</div> <div style="text-align: center;">  <p>Glencoe Aviation - 6253 Airport Industrial Blvd - GONZALES, LA 70737 - 225-460-3636</p> </div> <p>NS2MK Flight: 112.1 CIRRUS DESIGN CORP, SR22T, S/N: 2468 September 14, 2023 Hobos: 135.3</p> <p>Removed MFD &amp; glare shield to access ECS Display panel. Checked all connections to the harness. Removed old ECS display panel Part # 22101-001 S/N ECC03109 and replaced with new Part 22101-001 S/N ECC04502 Performed operational check on system and operates normally. Re installed MFD &amp; glare shield.</p> <p>With respect to the work performed, this airframe is approved for return to service. Details of work performed are on file with Glencoe Aviation under work order: GA2559.</p> <p>SYLVIAN HULL A/P 4205807 <i>[Signature]</i></p>					