

HARTZELL

PROPELLER LOGBOOK



N230WA

Hartzell PHC-I3YF-1RF

S/N: FP 8159B

Propeller Logbook

PROPELLER MODEL PHC-I3yF-1RF

PROPELLER S/N FP 8159B

LOGBOOK # 1

PROPELLER MAINTENANCE RECORD

Position ONE

PITCH RANGE

Propeller Model PHC-J3yF-1RF

High/Feather _____

Propeller S/N FP8159B

Start Lock _____

Blade Design F7392-1

Low _____

Blade S/N's

Reverse _____

No. 1 L32294

No. 2 L32294

Aircraft Manufacturer CIRRUS DESIGN CORP.

No. 3 L32287

Aircraft Model SR-20

No. 4 _____

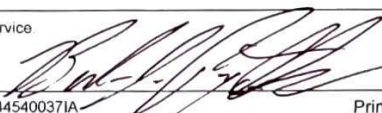

S/N 2229

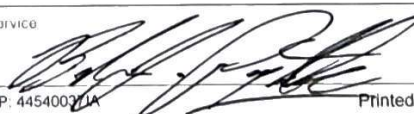
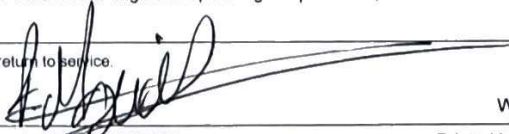
No. 5 _____


Registration N230WA

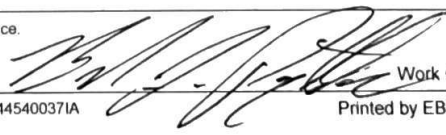
No. 6 _____


Spinner Assembly Part No. _____

Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	PROP MODEL: PHC-J3YF-1RF/F7392-1 PROP S/N FP8159B REG NO N230WA WORK ORDER 07548-08-2013	US Flight Aircraft Maintenance 1 Wallingford Rd Hangar 5 & 6 Danbury, CT 06810 USA Phone: 914-288-8088	DATE: 07 August, 2013 A/C TSN 139.8 PROP TT 139.8 FLIGHTTIME: 102.6
	Prop Entries (3) C/W CIRRUS AIRCRAFT 100HR/ANNUAL INSPECTION OF PROPELLER.... Propeller inspected in accordance with Hartzell 100 hr inspection checklist and the scope and detail of FAR-43 APP-D as guides. I certify this Propeller was inspected in accordance with an ANNUAL INSPECTION and determined to be in an airworthy condition. I certify that this propeller has been approved for return to service.		
	DATE: 07 August, 2013	SIGNED: 	Work Order: 07548-08-2013 Printed by EBis 3 (datcomedia.com)
	Date: <u>10/8/13</u>	<u>N 230WA</u>	Tach: <u>174.6</u>
	Dynamically balance propeller using MicroVib computer dynamic balance equipment. Referenced MicroVib aircraft analyzer user manual 1012 Dated Dec 1997. The relative vibration was reduced from <u>.246</u> in/sec down to <u>.035</u> in/sec. This aircraft is airworthy regarding the work performed. A&P 3645577 		

	PROP MODEL: PHC-J3YF-1RF/F7392-1 PROP S/N FP8159B REG NO N230WA WORK ORDER 07607-10-2013	US Flight Aircraft Maintenance 1 Wallingford Rd Hangar 5 & 6 Danbury, CT 06810 USA Phone: 914-288-8088	DATE: 24 October, 2013 A/C TSN 273.4 PROP TT 273.4 FLIGHTTIME: 204.9
	Prop Entries (3) C/W CIRRUS AIRCRAFT 100HR INSPECTION OF PROPELLER... Propeller inspected in accordance with Hartzell 100 hr inspection checklist and the scope and detail of FAR-43 APP-D as guides. I certify this Propeller was inspected in accordance with an 100 HR INSPECTION and determined to be in an airworthy condition. I certify that this propeller has been approved for return to service.		
	DATE: 24 October, 2013	SIGNED: 	Work Order: 07607-10-2013 Printed by EBis 3 (datcomedia.com)
	PROP MODEL: PHC-J3YF-1RF/F7392-1 PROP S/N FP8159B REG NO N230WA WORK ORDER 07608-10-2013	US Flight Aircraft Maintenance 1 Wallingford Rd Hangar 5 & 6 Danbury, CT 06810 USA Phone: 914-288-8088	DATE: 30 October, 2013 A/C TSN: 275.9 PROP TT: 275.9 FLIGHTTIME: 206.4
	Prop Entries (1) STATIC RPM 2560@ FULL THROTTLE... Removed Engine cowls, Removed forward left baffle, removed Governor PN# 15524-001, SN# 130072. Installed Governor PN# 15524-001, SN# 130383. Installed forward left baffle and secured tanis wires. Performed Governor Adjustment 61-20 Pg 3 Para 3 Run engine to operating temperatures, Performed satisfactory ground functional checks I certify that this propeller has been approved for return to service.		
	DATE: 30 October, 2013	SIGNED: 	Work Order: 07608-10-2013 Printed by EBis 3 (datcomedia.com)

Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	PROP MODEL: PHC-J3YF-1RF/F7392-1 PROP S/N: FP8159B REG. NO. N230WA WORK ORDER: 07627-11-2013		US Flight Aircraft Maintenance 1 Wallingford Rd Hangar 5 & 6 Danbury, CT 06810 USA Phone: 914-288-8088
			DATE: 23 November, 2013 A/C TSN: 301 PROP TT: 301 FLIGHTTIME: 225.4
	Log Entries		
	1 RPM EXCEEDING LIMIT ON TAKEOFF (2750)... Adjusted govener screw 1 turn in to decrease rpm.		
	The work performed has been approved for return to service.		
	DATE: 23 November, 2013	SIGNED: 	Work Order: 07627-11-2013 Printed by EBis 3 (datcomedia.com)
		Bernard Paquette, A&P: 445400371A	

	PROP MODEL: PHC-J3YF-1RF/F7392-1 PROP S/N: FP8159B REG. NO. N230WA WORK ORDER: 07682-03-2014	US Flight Aircraft Maintenance 1 Wallingford Rd Hangar 5 & 6 Danbury, CT 06810 USA Phone: 914-288-8088	DATE: 06 March, 2014 A/C TSN: 403.2 PROP TT: 403.2 FLIGHTTIME: 300.6
	Prop Entries		
	(3) C/W CIRRUS AIRCRAFT 100HR INSPECTION OF PROPELLER.... Propeller inspected in accordance with Hartzell 100 hr inspection checklist and the scope and detail of FAR-43 APP-D as guides.		
	I certify this Propeller was inspected in accordance with an 100 HR INSPECTION and determined to be in an airworthy condition.		
	I certify that this propeller has been approved for return to service.		
	DATE: 06 March, 2014	SIGNED: 	Work Order: 07682-03-2014 Printed by EBis 3 (datcomedia.com)
		Bernard Paquette, A&P: 445400371A	

	PROP MODEL: PHC-J3YF-1RF/F7392-1 PROP S/N: FP8159B REG. NO. N230WA WORK ORDER: 07737-06-2014	US Flight Aircraft Maintenance 1 Wallingford Rd Hangar 5 & 6 Danbury, CT 06810 USA Phone: 914-288-8088	DATE: 19 June, 2014 A/C TSN: 538.9 PROP TT: 538.9 FLIGHTTIME: 401.4
	Prop Entries		
	3 C/W CIRRUS AIRCRAFT 100HR/ANNUAL INSPECTION OF PROPELLER.... Propeller inspected in accordance with Hartzell 100 hr inspection checklist and the scope and detail of FAR-43 APP-D as guides. AD,s checked thru Biweekly 2014-12/13		
	I certify this Propeller was inspected in accordance with an ANNUAL INSPECTION and determined to be in an airworthy condition.		
	I certify that this propeller has been approved for return to service.		
	DATE: 19 June, 2014	SIGNED: 	Work Order: 07737-06-2014 Printed by EBis 3 (datcomedia.com)
		SCOTT SPLETZER, IA: 3402681	

Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair and Inspections
------	----------------------	------------	---

PROP MODEL:
PHC-J3YF-1RF/F7392-1
PROP S/N: FP8159B
REG. NO: N230WA
WORK ORDER: 07826-10-2014

US Flight Aircraft Maintenance

1 Wallingford Rd
Hangar 5 & 6
Danbury, CT 06810 USA
Phone: 914-288-8088

DATE: 10 October, 2014
A/C TSN: 671.8
PROP TT: 671.8
FLIGHTTIME: 500.7

Prop Entries

3 C/W CIRRUS AIRCRAFT 100HR/ANNUAL INSPECTION OF PROPELLER.... Propeller inspected in accordance with Hartzell 100 hr inspection checklist and the scope and detail of FAR-43 APP-D as guides.

AD,s checked thru Biweekly 2014-10

I certify this PROPELLER was inspected in accordance with an ANNUAL INSPECTION and determined to be in an airworthy condition.

I certify that this propeller has been approved for return to service.

DATE: 10 October, 2014

SIGNED:

Bernard Paquette, IA: 44540037IA

Work Order: 07826-10-2014

Printed by EBis 3 (datcomedia.com)

PROP MODEL:
PHC-J3YF-1RF/F7392-1
PROP S/N: FP8159B
REG. NO: N230WA
WORK ORDER:
07939-06-2015

US Flight Aircraft Maintenance

1 Wallingford Rd
Hangar 5
Danbury, CT 06810 USA
Phone: 914-288-8088

DATE: 17 June, 2015
A/C TSN: 810.4
PROP TT: 810.4
FLIGHTTIME: 600.4

Prop Entries

(3) C/W CIRRUS AIRCRAFT 100HR/ANNUAL INSPECTION OF PROPELLER.... Propeller inspected in accordance with Hartzell 100 hr inspection checklist and the scope and detail of FAR-43 APP-D as guides.

Greased Hub with Aeroshell-6

AD,s checked thru Biweekly 2015-6

I certify this PROPELLER was inspected in accordance with an ANNUAL INSPECTION and determined to be in an airworthy condition.

I certify that this propeller has been approved for return to service.

DATE: 17 June, 2015


SIGNED:

Bernard Paquette, IA: 44540037IA

Work Order: 07939-06-2015

Printed by EBis 3 (datcomedia.com)

Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
			<p>PROP MODEL: PHC-J3YF-1RF/F7392-1 PROP S/N: FP8159B REG. NO: N230WA WORK ORDER: 08013-09-2015</p> <p>US Flight Aircraft Maintenance 1 Wallingford Rd Hangar 5 Danbury, CT 06810 USA Phone: 914-288-8088</p> <p>DATE: 01 October, 2015 A/C TSN: 930.4 PROP TT: 690.5 FLIGHTTIME: 690.5</p> <p>Prop Entries</p> <p>3 C/W CIRRUS AIRCRAFT 100HR/ANNUAL INSPECTION OF PROPELLER.... Propeller inspected in accordance with Hartzell 100 hr inspection checklist and the scope and detail of FAR-43 APP-D as guides.</p> <p>Greased Hub with Aeroshell-6</p> <p>AD,s checked thru Biweekly 2015-6</p> <p>I certify this PROPELLER was inspected in accordance with an ANNUAL INSPECTION and determined to be in an airworthy condition.</p> <p>I certify that this propeller has been approved for return to service.</p> <p>DATE: 01 October, 2015 SIGNED:  Bernard Paquette, IA: 44540037IA Work Order: 08013-09-2015 Printed by EBis 3 (datcomedia.com)</p>

			<p>PROP MODEL: PHC-J3YF-1RF/F7392-1 PROP S/N: FP8159B REG. NO: N230WA WORK ORDER: 08051-12-2015</p> <p>US Flight Aircraft Maintenance 1 Wallingford Rd Hangar 5 Danbury, CT 06810 USA Phone: 914-288-8088</p> <p>DATE: 05 January, 2016 A/C TSN: 1066.2 PROP TT: 787.9 FLIGHTTIME: 787.9</p> <p>Prop Entries</p> <p>3 C/W CIRRUS AIRCRAFT 100HR/ANNUAL INSPECTION OF PROPELLER.... Propeller inspected in accordance with Hartzell 100 hr inspection checklist and the scope and detail of FAR-43 APP-D as guides.</p> <p>Greased Hub with Aeroshell-6</p> <p>AD,s checked thru Biweekly 2016-1</p> <p>I certify this PROPELLER was inspected in accordance with an ANNUAL INSPECTION and determined to be in an airworthy condition.</p> <p>I certify that this propeller has been approved for return to service.</p> <p>DATE: 05 January, 2016 SIGNED:  Bernard Paquette, IA: 44540037IA Work Order: 08051-12-2015 Printed by EBis 3 (datcomedia.com)</p>

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		
PROP MODEL PHC-J3YF-1RF/F7392-1 PROP S/N FP8159B REG NO N230WA WORK ORDER 08101-04-2016				US Flight Aircraft Maintenance 1 Wallingford Rd Hangar 5 Danbury, CT 06810 USA Phone 914-288-8088
				DATE: 04 May, 2016 A/C TSN: 1156.6 PROP TT: 853.2 FLIGHTTIME: 853.2
Prop Entries				
3	C/W CIRRUS AIRCRAFT 100HR/ANNUAL INSPECTION OF PROPELLER.... Propeller inspected in accordance with Hartzell 100 hr inspection checklist and the scope and detail of FAR-43 APP-D as guides.			
	Greased Hub with Aeroshell-6			
	AD,s checked thru Biweekly 2016-5			
	I certify this PROPELLER was inspected in accordance with an ANNUAL INSPECTION and determined to be in an airworthy condition.			
I certify that this propeller has been approved for return to service.				
DATE: 04 May, 2016		SIGNED: 		Work Order: 08101-04-2016
		Bernard Paquette, IA. 44540037IA		Printed by EBis 3 (datcomedia.com)

PROP MODEL PHC-J3YF-1RF/F7392-1 PROP S/N FP8159B REG NO N230WA WORK ORDER 08165-08-2016				US Flight Aircraft Maintenance 1 Wallingford Rd Hangar 5 Danbury, CT 06810 USA Phone 914-288-8088
				DATE: 16 August, 2016 A/C TSN: 1290.4 PROP TT: 954.2 FLIGHTTIME: 952.4
Prop Entries				
3	C/W CIRRUS AIRCRAFT 100HR/ANNUAL INSPECTION ON PROPELLER.... Propeller inspected in accordance with Hartzell 100 hr inspection checklist and the scope and detail of FAR-43 APP-D as guides.			
	Greased Hub with Aeroshell-6			
	AD,s checked thru Biweekly 2016-8			
	I certify this PROPELLER was inspected in accordance with an ANNUAL INSPECTION and determined to be in an airworthy condition.			
Technicians Who Worked On The Items Listed Above: Bernard Paquette				
I certify that this propeller has been approved for return to service.				
DATE: 16 August, 2016		SIGNED: 		Work Order: 08165-08-2016
		Bernard Paquette, IA. 44540037IA		Printed by EBis 3 (datcomedia.com)

Date	Propeller TSN TSO		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
------	----------------------	--	------------	---

PROP MODEL
PHC-J3YF-1RF/F7392-1
PROP S/N FP8159B
REG NO N230WA
WORK ORDER 08234-01-2017



US Flight Aircraft Maintenance

1 Wallingford Rd
Hangar 5
Danbury, CT 06810 USA
Phone: 914-288-8088

DATE: 03 March, 2017
A/C TSN 1426 7
PROP TT: 1051.9
FLIGHTTIME 1051.9

Prop Entries

3 C/W 100HR/ANNUAL INSPECTION ON PROPELLER.... C/W 100HR/Annual on Propeller inspected using FAR-43 Appendix D as a guide.
AD's checked thru 2-21-2017

I certify this PROPELLER has been inspected in accordance with an ANNUAL inspection and has determined to be in airworthy condition.

I certify that this propeller has been approved for return to service.

DATE: 03 March, 2017


SIGNED:


Bernard Paquette, IA: 44540037IA

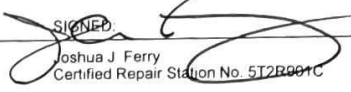
Work Order: 08234-01-2017


Printed by EBis 3 (datcomedia.com)

				<p>Make: Hartzell Model: PHC-J3YF-1RF 1501 Narcissa Road Blue Bell, Pa 19422 (215) 646-0400 S/N: 1007857</p>	
				<p>Date: 12/08/2017 N230WA Hobbs: 1587.8 Flight: 1174.8 Prop.TTSS: 1174.8</p>	
				<p>Engine Entry: Performed an annual inspection IAW FAR 43 Appendix D. using Cirrus MM Chapter 5-20 as a guide. No applicable AD's due at this time. Dressed leading edges. Details of this work are on file at this facility under work order #10157. END.</p>	
				<p>I certify that this propeller has been inspected IAW an annual inspection and was determined to be in airworthy condition.</p>	
				<p>Milan Jovanovic A&P3164117IA</p>	

Date			Registration: N230WA Model: Hartzell PHC-J3YF-1 S/N: FP8159B Flight Hobbs: 1272.0 W/O#: W18-3224 Date: 06-07-2018	S, ions.
	Culpeper Regional Airport 12539 Beverly Ford Road Brandy Station, VA 22714 540-825-9711			
	→ Complied with Annual Inspection using Cirrus SR20 MM 05-20 as a guide meeting the requirements of 14 CFR Part 43 Appendix D. → Inspected hub assembly and blades. → Dressed blades as needed. → Serviced in accordance with Hartzell POM 61-00-15.			
	I certify that this PROPELLER has been inspected in accordance with an Annual Inspection and was determined to be in airworthy condition.			
	Signature: <u>Martin Dodson</u> A&P/IA 3664335 Martin Dodson			

			Registration: N230WA Model: Hartzell PHC-J3YF-1 S/N: FP8159B Hobbs: 1718.6 Flight Hobbs: 1272.0 W/O#: W18-3224 Date: 06-07-2018	
	Culpeper Regional Airport 12539 Beverly Ford Road Brandy Station, VA 22714 540-825-9711			
	→ Complied with Annual Inspection using Cirrus SR20 MM 05-20 as a guide meeting the requirements of 14 CFR Part 43 Appendix D. → Inspected hub assembly and blades. → Dressed blades as needed. → Serviced in accordance with Hartzell POM 61-00-15.			
	I certify that this PROPELLER has been inspected in accordance with an Annual Inspection and was determined to be in airworthy condition.			
	Signature: <u>Martin Dodson</u> A&P/IA 3664335 Martin Dodson			

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		
				<p>ADVANCED Fly Advanced</p> <p>PROP MODEL: PHC J3YF-1RF PROP S/N: FP8159B REG NO: N230WA WORK ORDER: 6466-04-2019</p> <p>Repair Station No: 5T2R901C 530 Airport Rd Littitz, PA 17543 Phone: 717-735-5179</p> <p>DATE: 6/24/2019 A/C TSN: 1408 9 PROP TT: 1408 9 HOBS: 1898 2</p> <p>Prop Entries</p> <p>Annual Propeller Inspection completed IAW FAR 91.409 and the requirements outlined in FAR 43 App. D with reference to the Cirrus AMM check list ch 5-20. Cleaned and dressed blades. Serviced hub. All ADs current through 2019-13. Adjusted aircraft RPM for proper takeoff and cruise RPM.</p> <p>I certify that this PROPELLER has been inspected IAW an Annual Inspection and was found to be in Airworthy condition.</p> <p>DATE: 6/24/2019</p> <p>SIGNED:  Joshua J. Ferry Certified Repair Station No. 5T2R901C</p> <p>Work Order: 6466-04-2019 Printed by EBis 3 (datcomedia.com)</p>

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		
				<p>ADVANCED Fly Advanced</p> <p>PROP MODEL: PHC J3YF-1RF PROP S/N: FP8159B REG NO: N230WA WORK ORDER: 7325-06-2020</p> <p>Repair Station No: 5T2R901C 530 Airport Rd Littitz, PA 17543 Phone: 717-735-5179</p> <p>DATE: 7/2/2020 A/C TSN: 1515 9 PROP TT: 1515 9 HOBS: 2050 7</p> <p>Prop Entries</p> <p>Annual Propeller Inspection completed IAW FAR 91.409 and the requirements outlined in FAR 43 App. D with reference to the Cirrus AMM check list ch 5-20. Cleaned and dressed blades. Serviced hub. All ADs current through 2020-01.</p> <p>I certify that this PROPELLER has been inspected IAW an Annual Inspection and was found to be in Airworthy condition.</p> <p>DATE: 7/2/2020</p> <p>SIGNED:  Joshua J. Ferry Certified Repair Station No. 5T2R901C</p> <p>Work Order: 7325-06-2020 Printed by EBis 3 (datcomedia.com)</p>



PROPELLER LIMITED WARRANTY

Date	Propeller TSN	TSO	A/C Hrs	S

AIRCRA
506 Charlotte Rc

WORK ORDER: 4399P
MODEL NUMBER: PHC-J3YF-1RF
SERIAL NUMBER: FP8159B

DATE: 8/17/2021

PROPELLER S/N FP
PROPELLER M/N
Propeller overhauled in accorda
with SL-61-366 this propeller us
maintenance of this propeller is
AD Compliance:
No AD's apply to this propeller at this time

Hartzell Propellers overhauled by Aircraft Propeller Works, Inc. have a 2-year or 1000 ho
warranty on Parts and Labor involved in the Overhaul Only. Propeller Repairs have a
year or 500 hour warranty on Parts and Labor involved in the Repair Only.

McCauley Threadless Propellers overhauled by Aircraft Propeller Works, Inc. have a 2-ye
or 1000 hour warranty on Parts and Labor involved in the Overhaul Only. Propeller Repai
have a 1-year or 500 hour warranty on Parts and Labor involved in the Repair Only.

McCauley Threaded Propellers overhauled by Aircraft Propeller Works, Inc. have a 1-ye
or 500 hour warranty on Parts and Labor involved in the Overhaul Only. Propeller Repai
have a 1-year or 500 hour warranty on Parts and Labor involved in the Repair Only.

*Warranty does not cover; misuse, accidents, neglect, normal wear and tear, corrosion,
loss of business, loss of income, travel, lodging and food expenses, removal and
installation of propeller, unauthorized changes and shipping.*

PERTINENT DE

INSTALLER MUST CONFIRM ELIG

506 Charlotte Road, Auburndale, FL 33823
863-875-4800 - office@aircraftpropellerworksinc.com
CRS# 4TZR125D



PROPELLER LIMITED WARRANTY

AI
506 Chal

WORK ORDER: 4400G
MODEL NUMBER: C290D3R/T23
SERIAL NUMBER: 130383

DATE: 8/17/2021

GOVERNOR S/N
GOVERNOR M/N
Propeller governor o
installation in accor
Unknown TT50 :0.0

Governors have a 1-year or 500 hour warranty on parts and labor involved in the
overhaul only. Governor Repairs have a 1-year or 500 hour warranty on Parts and
Labor involved in the Repair Only.


*Warranty does not cover; misuse, accidents, neglect, normal wear and tear, corrosion,
loss of business, loss of income, travel, lodging and food expenses, removal and
installation of propeller, unauthorized changes and shipping.*

PEF


INSTALLER MUST CC

506 Charlotte Road, Auburndale, FL 33823
863-875-4800 - office@aircraftpropellerworksinc.com
CRS# 4TZR125D


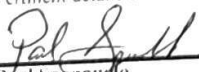
AUTHENTIQUE / G

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		
				AIRCRAFT PROPELLER WORKS, INC 506 Charlotte Road, Auburndale, FL 33823 CRS# 4TZR125D PROPELLER S/N <u>FP8159B</u> WORK PERFORMED <u>Overhauled</u> PROPELLER M/N _____ <u>PHC-J3YF-1RF</u> <u>F7392-1</u> Propeller overhauled in accordance with Hartzell manuals 159, 202A, 113B and 133C. In compliance with SL-61-366 this propeller uses NYCO GN3058 grease, the use of any other grease during the maintenance of this propeller is prohibited. TTSN: Unknown TSO: 00.0 AD Compliance: No AD's apply to this propeller at this time. PERTINENT DETAILS ON FILE UNDER WORK ORDER: <u>4399P</u>  DATE: <u>8/17/2021</u> INSTALLER MUST CONFIRM ELIGIBILITY WITH APPLICABLE TECHNICAL DATA AND INSTALL I/A/W FAR 43.5

Just inform
ils d'impression
impression.

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		
				AIRCRAFT PROPELLER WORKS, INC 506 Charlotte Road, Auburndale, FL 33823 CRS# 4TZR125D GOVERNOR S/N <u>130383</u> WORK PERFORMED <u>Overhauled</u> GOVERNOR M/N _____ <u>C290D3R/T23</u> Propeller governor overhauled in accordance with McCauley manual 780401. Governor eligible for installation in accordance with AD 2020-19-06 Part (g). Approved for return to service. TTSN: Unknown TTSO :0.00 PERTINENT DETAILS ON FILE UNDER WORK ORDER: <u>4400G</u>  DATE: <u>8/17/2021</u> INSTALLER MUST CONFIRM ELIGIBILITY WITH APPLICABLE TECHNICAL DATA AND INSTALL I/A/W FAR 43.9

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		
				<p>PROF MODEL PHC-J3YF-1RF PROP S/N FP8159B REG NO 230WA WORK ORDER 12153-06-2021</p> <p></p> <p>Flightline Group, Inc. 3256 Capital Circle SW Tallahassee, Florida 32310 Phone: 850-576-3515</p> <p>DATE: 9/1/2021 A/C TSN: 1618.1 PROP TT: 1618.1 TSPOH: 0 HOBBS: 1618.1</p> <p>Prop Entries</p> <p>C/W Propeller Annual Inspection... Removed Propeller governor for overhaul (P/N C290D3-R/T23, S/N 130383) by Aircraft Propeller Works W/O # 4400G. Installed same propeller governor after overhauled. Ref. Cirrus SR20 MM 61-20.... C/W 6 year Overhaul of Hartzell Propeller Removed P/N PHC-J3YF-1RF. S/N: FP8159B. Sent propeller for overhaul at Aircraft Propeller INC. W/O 4399P. Re-installed same propeller. Ref Hartzell MM 115N. Ground ops check, good no leaks four d.</p> <hr/> <p>The aircraft, engine, propeller or appliance identified above has been inspected per current FAA regulations in accordance with an annual inspection, referencing the Annual Inspection Guide as set forth in the latest revision of the Cirrus SR20 Maintenance Manual and found to be in an airworthy condition. This release in no way certifies future airworthiness.</p> <p>DATE: 9/1/2021 SIGNED:  Work Order: 12153-06-2021</p> <p>Matthew W. Suber, IA. 3764687 Printed by EBis 3 (datamedia.com)</p>

				<p></p> <p>4141 Jerry Maygarden Rd Pensacola, FL 32504 850-433-6116</p> <p>11/17/2022 N230WA - Cirrus SR20 S/N: 2229 HOBBS: 2202.4 AFTT: 2202.4 Prop: Hartzell: PHC-J3YF-1RF S/N: FP8159B PTT: 2202.4 PTSMOH: 0</p> <p>1-Removed propeller spinner and inspected - no defects noted 2-Inspected spinner bulkhead - no defects noted 3-Inspected propeller - no defects noted 4-Lubricated prop with Aeroshell #5 5-Reinstalled propeller spinner</p> <p>I certify this PROPELLER was inspected IAW a <u>100 HOUR INSPECTION</u> as per FAR 43 app D and has been determined to be in airworthy condition. Pertinent details of this maintenance action can be found under <u>W/O 27022-1</u></p> <p> Paul Spagnuolo 3510174 A&P</p>