



PROPELLER MAINTENANCE RECORDS

Log No. 1

Aircraft Registration No. N249WS/N6300B

Propeller Manufacturer Hartzell

Hub Model _____

Blade Design No. _____

Hub Serial No. _____

Blade Serial No's.

1. _____

2. _____

3. _____

4. _____

Pitch Range:

High _____ Low _____

Feather _____ Reverse _____

Governor Manufacturer _____

Model No. _____

Serial No. _____

Date installed on aircraft _____

Time Between Overhauls (TBO) _____ Hours

If used on multi-engine aircraft:

☐ Right

☐ Left

☐ Front

☐ Rear

(All applicable information must be filled in)



AEROTECH PUBLICATIONS INC.

www.adlog.com

PROP MODEL:
PHC-J3YF-1MF
PROP S/N: JC127B
REG. NO: 249WS
WORK ORDER: 9997

AIR WEST
AIRCRAFT ENGINES

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070
Phone: (650) 593-8403

DATE: 1/5/2004
A/C TSN: 406.10
PROP TT: 406.10
HOBBS: 406.10

Prop Entries

Completed ANNUAL Inspection IAW Cirrus Design SR-20 manual 12137-001 & Air West Aircraft Engines Scope & Detail.

The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulations and were found airworthy for return to service.

DATE: 1/5/2004

SIGNED:

DUPLICATE

Work Order: 9997

Printed by EBis 3 (datcomedia.com)

SUB-TOTALS this page

TOTALS-Carry forward to next page

DATE

TOTAL
TIME
IN
SERVICETOTAL
TIME
SINCE
OVERHAULTACH OR
RECORDING
METER
TIMEDESCRIPTION OF WORK PERFORMED—
SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK**Syracuse Executive Air Service, Inc.**

Propeller

Reg #: N6300B
AC S/N: 1157
PROP M/N: PHC-J3YF-1MFMake: Cirrus
ACTT: 602.8
PROP S/N: 0Model: SR20
Hobbs: 602.8
TSO:Tach: 0.0
TSN: 602.8

Complied with annual inspection per FAR 91.409(a)1 and checklist

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with repair station.

Signature:

COPY

Date: 12/23/2004

Work Order: 4278

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
211 Tuskegee Road
Syracuse, NY 13211

EXEC-AIR

PROP MODEL:
PROP S/N:
REG. NO. N6300B
WORK ORDER: 192**Advanced Aircraft Services LP**500 Airport Rd. Suite D
Lititz, PA 17543
Phone: 717-735-5179DATE: 2/8/2007
A/C TSN: 1067.5
PROP TT: 1067.5
HOBBS: 1067.5**Prop Entries**

Completed an Annual Inspection using the Cirrus AMM check list ch. 5-20.... Removed prop from aircraft and sent to Sensenich propeller services for repair (See yellow tag) Reinstalled prop, torqued prop nuts to specs and rigged governors low pitch stop. All AD's current thru 07-02.-END-

I certify that this PROPELLER has been inspected IAW an Annual Inspection and was found to be in Airworthy condition.

DATE: 2/8/2007

SIGNED:

Richard A. Barnhart II, IA 3124994

Work Order: 192

Printed by EBis 3 (datcomedia.com)

Syracuse Executive Air Service, Inc.

Prop

Reg #: N6300B
AC S/N: 1157
M/N: PHC-J3YF-1MFMake: Cirrus Design
ACTT: 1208.0
S/N:Model: SR-20
Hobbs: 1208.0
TSO: N/ATach: N/A
TSN: 1208.0Complied with Annual Inspection IAW FAR 91.409(a)1
Lubed propAll work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with repair station.

Signature:

COPY

Date: 01/26/2008

Work Order: 5871

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
211 Tuskegee Road
Syracuse, NY 13211

EXEC-AIR

SUB-TOTALS this page

TOTALS-Carry forward to next page

TOTALS brought forward from previous page

Syracuse Executive Air Service, Inc.

Reg #: N6300B

Make: Cirrus Design

Model: SR-20

Prop

AC S/N: 1157

ACTT: 1262.4

Hobbs: 1262.4

Tach: N/A

M/N: PHC-J3YF-1MF

S/N:

TSO: N/A

TSN: 1262.4

Complied with Annual Inspection IAW FAR 91.409(a)1

Lubed prop

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with repair station.

Signature:

COPY

Date: 06/12/2008

Work Order: 6027

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
211 Tuskegee Road
Syracuse, NY 13211

EXEC-AIR**Syracuse Executive Air Service, Inc.**

Prop

Reg #: N6300B

Make: Cirrus Design

Model: SR-20

Tach: N/A

AC S/N: 1157

ACTT: 1352.6

Hobbs: 1352.6

TSN: 1352.6

M/N: PHC-J3YF-1MF

S/N:

TSO: N/A

Complied with Annual Inspection IAW FAR 91.409(a)1

Prop removed, overhauled by EAST COAST PROPELLER SERVICE, and reinstalled.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with repair station.

Signature:

COPY

Date: 03/06/2009

Work Order: 6291

For: Syracuse Executive Air Service, Inc. - CRSBJFR481C
211 Tuskegee Road
Syracuse, NY 13211

— overhaul —

EXEC-AIR

FINGERLAKES FLYING SERVICE 2727 MARTIN ROAD
SENECA FALLS, N.Y. 13148 585-764-7068

12-23-10 TACH 1524.80

PROPELLER REMOVED AND REINSTALLED DUE TO ALTERNATOR BELT REPLACEMENT-NEW O RING AND LOCK NUTS USED DURING REINSTALLATION - NUTS TORQUED TO 65FT/LBS-PROP GREASED WITH AEROSHELL #6 GREASE-BLADES DRESSED AND BACKS PAINTED - ANNUAL INSPECTION COMPLIED WITH AND FOUND TO BE IN AN AIRWORTHY CONDITION - OPERATIONAL CHECK SATISFACTORY.

DON McANN

AP91445379IA

PROP MODEL:
PHC-J3YF-1MF
PROP S/N: JC127B
REG. NO: N6300B
WORK ORDER:
2007-11-2011

Advanced Aircraft Services

530 Airport Rd.
Lititz, PA 17543
Phone: 717-735-5179

DATE: 12/19/2011
A/C TSN: 1575
PROP TT: 1575
HOBBS: 1575

Prop Entries

Cirrus Propeller Annual Inspection completed using the Cirrus AMI check list ch. 5-20. Cleaned and dressed blades.
Serviced hub. All ADs current through 2011-26. Ops check good.

I certify that this PROPELLER has been inspected IAW an Annual Inspection and was found to be in Airworthy condition.

DATE: 12/19/2011

SIGNED:

Work Order: 2007-11-2011

Richard A. Barnhart II, IA: 3124994AP

Printed by EBIS 3 (datcomedia.com)

SUB-TOTALS this page

TOTALS brought forward from previous page

N6300B Hobbs; 1641.6 SPOH; 289.0 TT; 1641.6

PROPELLER

Inspect propeller IAW Cirrus Inspection Procedures and AMM Chapter 5.

The aircraft and/or component identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service. Pertinent details of the repair are on file at this station under

Service Order No. 80332 Dated: 1-9-13

[Signature]
FAA Approved Repair Station No. B2ER144J
Boshart Enterprises and Aircraft Services, Inc.
Genesee County Airport Batavia, N.Y. 14020

I CERTIFY THAT THIS Propeller HAS BEEN INSPECTED
IN ACCORDANCE WITH Annual TYPE INSPECTION
AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.

A.D. SUMMARY TO 12-26 CHECKED.

OPERATIONAL CHECK SATISFACTORY.

SIGNATURE: [Signature]

FOR REPAIR STATION B2ER144J

TOTAL TIME: 1641.6 TACH: 1641.6 HOBBS

DATE OF INSPECTION: 1/9/13

N6300B Hobbs; 1786.6 Propeller TT; 1786.6 SMOH; 434.0

PROPELLER

Dress propeller blades, inspect spinner, aft bulkhead and hub assembly.
Lubricate propeller with Aeroshell #6 grease.

The aircraft and/or component identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service. Pertinent details of the repair are on file at this station under

Service Order No. 60612 Dated: 2/5/14

[Signature]
FAA Approved Repair Station No. B2ER144J
Boshart Enterprises and Aircraft Services, Inc.
Genesee County Airport Batavia, N.Y. 14020

I CERTIFY THAT THIS Propeller HAS BEEN INSPECTED
IN ACCORDANCE WITH AN ANNUAL TYPE INSPECTION
AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.

A.D. SUMMARY TO 2014-02 CHECKED.

OPERATIONAL CHECK SATISFACTORY.

SIGNATURE: [Signature]

FOR REPAIR STATION B2ER144J

TOTAL TIME: 1786.6 TACH: 1786.6 SMOH 434.0

DATE OF INSPECTION: 2/5/14

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED — SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page

N6300B Hobbs: 1852.6 Propeller TT; 1786.7 SPOH; 500.0 PROPELLER

Dress propeller blades. Inspect spinner, aft bulkhead, and hub assemblies. Lubricate propeller hub with Aeroshell # 6 grease.

The aircraft and/or component identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service. Pertinent details of the repair are on file at this station under **Service Order No. 61028 Dated: 3-5-15**

James K. Mervish
FAA Approved Repair Station No. B2ER144J
Boshart Enterprises and Aircraft Services, Inc.
Genesee County Airport Batavia, N.Y. 14020

I CERTIFY THAT THIS Propeller HAS BEEN INSPECTED
IN ACCORDANCE WITH AN ANNUAL TYPE INSPECTION
AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.
A.D. SUMMARY TO 2015-04 CHECKED.
OPERATIONAL CHECK SATISFACTORY.

SIGNATURE: *James K. Mervish*
FOR REPAIR STATION B2ER144J
TOTAL TIME: SPOH 500.0 TACH: 1852.6
DATE OF INSPECTION: 3/5/15

N6300B Hobbs; 2076.1 Propeller TT; 2076.1 PROPELLER

Dress propeller blades. Inspect spinner, aft bulk head, and hub assembly. Grease propeller with Aeroshell #6 grease.

The aircraft and/or component identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service. Pertinent details of the repair are on file at this station under **Service Order No. 61855 Dated: 3/10/17**

John C. Colaluca
FAA Approved Repair Station No. B2ER144J
Boshart Enterprises and Aircraft Services, Inc.
Genesee County Airport Batavia, N.Y. 14020



TECHNAIR™
Aircraft Maintenance
A BBA Aviation company

330 Aviation Way
Frederick, MD 21701
301-662-8156
CRS LC1R291K

Date: 11/08/2018; Aircraft: N6300B; Hobbs: 2335.60
Shop Order #: S05-18-63335

PROP LOG ENTRY:

Dressed all blades as needed. I certify that this prop has been inspected in accordance with a SAVVY SR2X guide for oil changes and associated service items and has been approved for return to service.

C. John Colaluca
C. John Colaluca for Signature Technicair CRS LC1R291K

SUB-TOTALS this page

TOTALS-Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING
				TOTALS brought forward from previous page

PROP MODEL:
PHC-J3YF-1MF
PROP S/N: JC127B
REG. NO: N6300B
WORK ORDER:
6413-03-2019

ADVANCED Fly Advanced

Repair Station No. 5T2R901C
530 Airport Rd.
Lititz, PA 17543
Phone: 717-735-5179

DATE: 4/5/2019
A/C TSN: 2372.8
PROP TT: 2372.8
TSPOH: 1020.2
HOBBS: 2372.8

Prop Entries

Annual Propeller Inspection completed IAW FAR 91.409 and the requirements outlined in FAR 43 App. D. with reference to the Cirrus AMM check list ch 5-20. Cleaned and dressed blades. Serviced hub. All ADs current through 2019-07.

I certify that this PROPELLER has been inspected IAW an Annual Inspection and was found to be in Airworthy condition.

DATE: 4/5/2019

SIGNED: 

Joshua J. Ferry
Certified Repair Station No. 5T2R901C

Work Order: 6413-03-2019

Printed by EBis 3 (datcomedia.com)

PROP MODEL:
PHC-J3YF-1MF
PROP S/N: JC127B
REG. NO: N6300B
WORK ORDER:
7092-02-2020

ADVANCED Fly Advanced

Repair Station No. 5T2R901C
530 Airport Rd.
Lititz, PA 17543
Phone: 717-735-5179

DATE: 5/5/2020
A/C TSN: 2538.7
PROP TT: 2538.7
TSPOH: 1186.1
HOBBS: 2538.7

Prop Entries

Annual Propeller Inspection completed IAW FAR 91.409 and the requirements outlined in FAR 43 App. D. with reference to the Cirrus AMM check list ch 5-20. Cleaned and dressed blades. Serviced hub. All ADs current through 2020-09.

I certify that this PROPELLER has been inspected IAW an Annual Inspection and was found to be in Airworthy condition.

DATE: 5/5/2020

SIGNED: 

Joshua J. Ferry
Certified Repair Station No. 5T2R901C

Work Order: 7092-02-2020

Printed by EBis 3 (datcomedia.com)

PROP MODEL:
PHC-J3YF-1MF
PROP S/N: JC127B
REG. NO: N6300B
WORK ORDER:
7936-03-2021

ADVANCED Fly Advanced

Repair Station No. 5T2R901C
530 Airport Rd.
Lititz, PA 17543
Phone: 717-735-5179

DATE: 6/11/2021
A/C TSN: 2593.2
PROP TT: 2593.2
TSPOH: 1240.6
HOBBS: 2593.2

Prop Entries

Annual Propeller Inspection completed IAW FAR 91.409 and the requirements outlined in FAR 43 App. D. with reference to the Cirrus AMM check list ch 5-20. Cleaned and dressed blades. Serviced hub. All ADs current through 2021-12

I certify that this PROPELLER has been inspected IAW an Annual Inspection and was found to be in Airworthy condition.

DATE: 6/11/2021

SIGNED: 

Joshua J. Ferry
Certified Repair Station No. 5T2R901C

Work Order: 7936-03-2021

Printed by EBis 3 (datcomedia.com)

PROP MODEL:
PHC-J3YF-1MF
PROP S/N: JC127B
REG. NO: N6300B
WORK ORDER:
8168-06-2021

ADVANCED Fly Advanced

Repair Station No. 5T2R901C
530 Airport Rd.
Lititz, PA 17543
Phone: 717-735-5179

DATE: 6/15/2021
A/C TSN: 2594.1
PROP TT: 2594.1
TSPOH: 1241.5
HOBBS: 2594.1

Prop Entries

Complied with RPM adjustment of the propeller governor for proper takeoff RPM IAW Cirrus AMM 61-20

Maintenance Release

The aircraft and/or component(s) on N6300B was repaired and inspected in accordance with the current rules and regulations of Title 14 of the Code of Federal Regulations, was found Airworthy and was returned to service.

DATE: 6/15/2021

SIGNED: 

Joshua J. Ferry
Certified Repair Station No. 5T2R901C

Work Order: 8168-06-2021

Printed by EBis 3 (datcomedia.com)

PROP MODEL:
 PHY-J3YF-1MF
 PROP S/N: JC127B
 REG. NO: N6300B
 WORK ORDER:
 4494-11-2021


 DeltaFox Aviation
 Repair Station No. 897R016D
 10771 James Payne Court
 Manassas, VA 20110
 Phone: 703.438.8450

DATE: 12/14/2021
 A/C TSN: 2628.5
 PROP TT: 2628.5
 TSPOH:
 HOBBS: 2628.5

4/H 3/09 - 1281.1

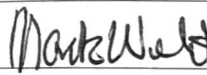
Prop Entries

- Blended small nicks in props IAW Hartzell propeller owners manual 61-00-15

I certify that the above stated maintenance was performed in accordance with the current regulations of the FAA and the aircraft / engine / component identified above is presently airworthy and approved for return to service.

DATE: 12/14/2021
 SIGNED: 
 Gudmundur J. Thorleifsson
 Certified Repair Station No. 897R016D

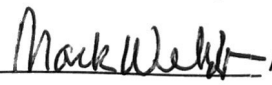
Work Order: 4494-11-2021
 Printed by EBis 3 (datcomedia.com)

N6300B	DATE 1/23/2023
PROP MODEL: PHY-J3YF-1MF S/N JC127B	ACTION 2633.7
	PROP TT 2633.7
PROPELLER REMOVED AND REINSTALLED/TORQ'D	TSPOH 1286.9
AFTER ENGINE OVERHAUL. NEW ALTERNATOR	HOBBS 2633.7
BELT INSTALLED P/N 655627-1	
DRESS PROP BLADES. AD'S CHECKED THRU 07-26-09	
I CERTIFY THIS PROPELLER HAS BEEN INSPECTED IN ACCORDANCE WITH AN <u>ANNUAL</u> INSPECTION & FOUND TO BE IN AIRWORTHY CONDITION AEROPLANE MAINTENANCE, SALISBURY, MD.  A-P 4596642 FA.	
— 0 —	



Work Completed: Checked condition of blades. No defects
AD'S CHECKED THRU 07-26-09

I certify that I have inspected the propeller IAW an Annual Inspection and have determined it to be in airworthy condition.

Mark R Webb  A&P 4596642 IA

Date: 2/1/2024

Aircraft Reg: 6300B

Model: SR20

Serial Number: 1157

TACH/HOBBS: 2705.9

TTAF: 2705.9

SUB-TOTALS this page