

HARTZELL


PROPELLER LOGBOOK

PROPELLER MODEL PHC-334F-1RF

PROPELLER S/N FP6641B

LOGBOOK # 1

Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
------	----------------------	------------	---

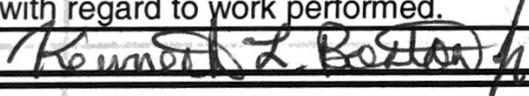Propeller LogBook Entry		TAC Air Aircraft Maintenance 1725 E. International Drive, Raleigh NC 27623 Raleigh Durham International Airport Phone: (919) 840-4440 Fax: (919) 840-4441						Authorized Cirrus Service Center	
		Work Order No.	Date	"N" Number	Aircraft Make	Model			Serial No.
		RDU-1822	7/10/08	N984PG	Cirrus	SR20	1959	136.7	103.6
Performed Cirrus Maintenance 100 Hour Interval Items. Lubricated propeller hub.									
I certify that the work described above was performed satisfactorily and in accordance with approved/acceptable data and that this article is approved for return to service with regard to work performed.									
Authorized Signature: 						Kenneth L. Boston, Jr., A&P 3115714			

Propeller LogBook Entry		TAC Air Aircraft Maintenance 1725 E. International Drive, Raleigh NC 27623 Raleigh Durham International Airport Phone: (919) 840-4440 Fax: (919) 840-4441						Authorized Cirrus Service Center	
		Work Order No.	Date	"N" Number	Aircraft Make	Model			Serial No.
		RDU-2570	10-31-08	N984PG	Cirrus	SR20	1959	259.3	194.8
Performed 100 Hour Inspection IAW Cirrus AMM 5-20. Lubricated propeller.									
I certify that the work described above was performed satisfactorily and in accordance with approved/acceptable data and that this article is approved for return to service with regard to work performed.									
Authorized Signature: 						Jon A. Delamarter, A&P 3035359			

Prop
LogBook
Entry



TAC Air Aircraft Maintenance
1725 E. International Drive, Raleigh NC 27623
Raleigh Durham International Airport
Phone: (919) 840-4440 Fax: (919) 840-4441



Authorized
Cirrus Service
Center

Work Order No.	Date	"N" Number	Aircraft Make	Model	Serial No.	Hobbs Time	FH/TT
RDU003785	5-15-09	N984PG	Cirrus	SR20	1959	374.6	303.4

Hartzell, PHC-J3YF-1RF, s/nFP6641B. Cirrus Maintenance Program Annual Inspection, Calendar times start over. Next 50hr inspection due FH:353.4. Serviced prop hub with Aeroshell #6 grease. I certify this Propeller has been inspected IAW a 100hr/Annual inspection using Cirrus SR20 MM (Chapter 5-20) 100hr inspection checklist as revised and was determined to be in airworthy condition and approved for return to service.

I certify the entry identified above was repaired and inspected in accordance with current FAA Regulations and for the work performed only and was found airworthy and is approved for return to service. Pertinent details of this repair are on file at this facility.

Authorized Signature:

Otis D. Hudson, Jr. A&P246826452IA

Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
------	----------------------	------------	---

LEADING EDGE 

AVIATION SERVICES, INC.

Tampa, FL



AUTHORIZED SERVICE CENTER

Date: 11/06/2009; Aircraft: N984PG; Type: CIRRUS; S/N: 1959; Hobbs: 528.80; Total Time: 456.20; Prop - Type: PHC-J3YF-1RF, S/N: FP6641B, Time: 456.20, SMOH: 456.20

- Complied with Cirrus Maintenance 100 hour interval items.
- Inspected Propeller for cracks, leaks, and abrasions.
- Dressed leading edges of blades and lubed hub.
- Verified AD compliance through Bi-weekly issue 2009-21.

The above work was performed in accordance with current regulations of the Federal Aviation Administration and is approved for return to service pertaining to work performed.

Taylor Harper  A&P 3438147

6582 Eureka Springs Rd. Tampa, FL 33610
Tampa Executive Airport (KTPX) 813 626 1515

TAC Air

TAC Air Aircraft Maintenance
1725 E. International Drive, Raleigh NC 27623
Raleigh Durham International Airport
Phone: (919) 840-4440 Fax: (919) 840-4441



**Authorized
Cirrus Service
Center**

Work Order No.	Date	"N" Number	Aircraft Make	Model	Serial No.	Hobbs Time	FH/TT
RDU006025	5-20-10	N984PG	Cirrus	SR20	1959	631.5	558.9

Hartzell, PHC-J3YF-1RF, s/nFP6641B. Cirrus Maintenance Program Annual Inspection, (Program ends 6/10 or 600hrs TT). Next 50hr inspection due FH:608.9. Serviced prop hub with Aeroshell #6 grease. I certify this Propeller has been inspected IAW a 100hr/Annual inspection using Cirrus SR20 MM (Chapter 5-20) 100hr inspection checklist as revised and was determined to be in airworthy condition and approved for return to service.

I certify the entry identified above was repaired and inspected in accordance with current FAA Regulations and for the work performed only and was found airworthy and is approved for return to service. Pertinent details of this repair are on file at this facility.

Authorized Signature: Otis D. Hudson, Jr. Otis D. Hudson, Jr. A&P3490004 IA

Performed an annual inspection on the propeller at 716.0 hours on 4/27/11 I.A.W. FAR Part 43, appendix D. Serviced the propeller I.A.W. Hartzell Propeller General Service and Maintenance Manual. Dressed the leading edges and painted the backs of each blade. All AD's reviewed and complied with. I certify that this propeller has been inspected I.A.W. an annual inspection and has been determined to be in airworthy condition.

Don Idler A&P601187493IA Don Idler



Make: CIRRUS DESIG

Model: SR20

Reg. No.: N984PG

Order No.: 2602

Completed: 10/19/11 00:00

S/N: 1959

Tach Time: 849.50

TTAF:

Propeller Log

Type: HartzellF73921

S/N: K71328

Dressed nicks from propeller blade. END

E. Wayd Loney A&P3554600

N984PG
929.1 TT

PROPELLER

Hartzell PHC-J3YF FP6641B
22 April 2012

Inspected Propeller I.A.W. Cirrus SR-22 100hr/Annual
Inspection Checklist. I certify that this Propeller engine
has been inspected in accordance with a annual inspection
and was determined to be airworthy I.A.W. FAR 43

Appendix D.-end

-end

~~Edward W. Pettie~~ 3069438A3, P I.A.

N984PG Propeller PHC-534F-1RF SN:FP6641B
Hobbs: 1160.4 Flight: 1087.8 23 June 2013

Inspected Propeller I.A.W. FAR 43.13 appendix D using
Cirrus SR20 inspection checklist as a guide:

I certify that this propeller has been inspected
in accordance with a annual inspection and was determined to
be airworthy, -end

Edward W. Pettee

[Signature] 3069938 A & PIA.

Recurring AD Status:

None Recurring

SEE AD COMPLIANCE RECORD FOR ADDITIONAL INFORMATION

Dynamic Mechanic LLC. □ Rockingham County / Shiloh Airport KSIF □
Stoneville, NC

Make: CIRRUS DESIG

Model: SR20

Reg. No.: N984PG

Order No.: 49

Completed: 07/01/14

S/N: 1959

Hobbs Time: 1279.40

TTAF: 1279.40

Propeller Log

Type: PHC534F1RF

S/N: FP6641B

I certify that this propeller has been inspected in accordance with a annual
inspection and was determined to in airworthy condition.-end

Edward W. Pettee 3069938 A&PIA

3439

Burling



TACH	DESCRIPTION OF WORK PERFORMED	SIGNATURE
	<p>Overhauled (1) propeller m/n PHC-JBYF-1RF s/n FP6641B. c/w S/B 118F, 136I, s/I 61-61Y, 245, s/I 152A, AD Note (07-26-09). Greased, painted and balanced. Bld. Dwg.# F7392-1 #1) K71328 #2) K71321 #3) K71323. H & H Propeller Service, Inc. 3439 S. Aviation Dr. Burlington, NC 27215 1-800-334-6437 FAA Repair Station PS42451M</p>	



Dynamic Mechanic LLC. ▫ Rockingham County / Shiloh Airport KSIF ▫
Stoneville, NC
Make: CIRRUS DESIG Model: SR20 Reg. No.: N984PG
Order No.: 95 Completed: 08/14/15
S/N: 1959 Tach Time: 1456.60 TTAF: 1456.60
Propeller Log Type: PHC534F1RF S/N: FP6641B

Propeller removed and reinstalled after overhaul by H&H Triad under work order #20915. I certify that this propeller has been inspected in accordance with a annual inspection and was determined to be in airworthy condition.-end

Edward W. Pettee 3069938 A&PIA

Dynamic Mechanic LLC. ▫ Rockingham County / Shiloh Airport KSIF ▫
Stoneville, NC
Make: CIRRUS DESIG Model: SR20 Reg. No.: N984PG
Order No.: 134 Completed: 08/25/16
S/N: 1959 Tach Time: 1648.20 TTAF: 1648.20
Propeller Log Type: PHC534F1RF S/N: FP6641B

I certify that this propeller has been inspected in accordance with a annual inspection and was determined to be in airworthy condition.-end
Edward W. Pettee 3069938 A&PIA

Dynamic Mechanic LLC. ▫ Rockingham County / Shiloh Airport KSIF ▫
Stoneville, NC
Make: CIRRUS DESIG Model: SR20 Reg. No.: N984PG
Order No.: 172 Completed: 09/09/17
S/N: 1959 Tach Time: 1851.60 TTAF: 1851.60
Propeller Log Type: PHC534F1RF S/N: FP6641B

I certify that this propeller has been inspected in accordance with a annual inspection and was determined to be in airworthy condition.-end
Edward W. Pettee 3069938 A&PIA

N984PG Phillipsburg Airport LLC
PROP LOG

DATE 08/01/2018
MAKE Cirrus
Model SR20

Hobbs 1965.0
TACH 1892.4
S/N 1954

- 1.C/W ANNUAL INSPECTION I/A/W FAR 43 APENDDIX D, Using Cirrus AMM as a guide.
- 2. lube prop per Hartzell maintenance manual .

I certify that this aircraft has been inspected in accordance with (annual) inspection and was determined to be in airworthy condition.
I/A 40062798 Phil Scadden



ion of all
ocumen


N984PG Phillipsburg Airport LLC
PROP LOG

DATE 10/15/2019
MAKE Cirrus
Model SR20

Hobbs 2046.8
TACH 1971.1
S/N 1954

- 1.C/W ANNUAL INSPECTION I/A/W FAR 43 APENDDIX D, Using Cirrus AMM as a guide.
- 2. lube prop per Hartzell maintenance manual .

I certify that this aircraft has been inspected in accordance with (annual) inspection and was determined to be in airworthy condition.
A/P 279621209I/A Richard Booze

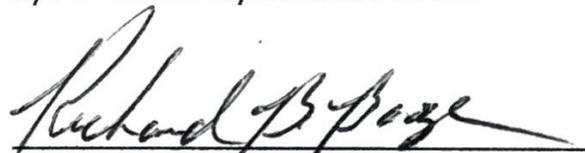

PROP MODEL
PHC-J3YF-1RF
PROP S/N FP6641B
REG NO N984PG
WORK ORDER
6740-08-2019

ADVANCED Fly Advanced

Repair Station No 5T2R901C
530 Airport Rd.
Litz, PA 17543
Phone: 717-735-5179

DATE 2/10/2021
A/C TSN 1989 1
PROP TT 1989 1
TSPOH 532 5
HOBBS 2064 9

Prop Entries

Annual Propeller Inspection completed IAW FAR 91 409 and the requirements outlined in FAR 43 App D with reference to the Cirrus AMM check list ch 5-20 Cleaned and dressed blades Serviced hub All ADs current through 2021-04 Removed and re-installed propeller after engine repair, propeller installed with new o-ring

I certify that this PROPELLER has been inspected IAW an Annual Inspection and was found to be in Airworthy condition.

DATE 2/10/2021

SIGNED:



Joshua J. Ferry
Certified Repair Station No 5T2R901C

Work Order: 6740-08-2019

Printed by EBis 3 (datcomedia.com)

PROP MODEL: PHC-J3YF-1RF
PROP S/N FP6641B
REG NO: N984PG
WORK ORDER 1560



Advanced Leesburg

1005 Sycolin Road Suite 106
Leesburg, VA 20175
Phone: 703-443-4739

DATE: 4/12/2022
A/C TSN 2034 2
PROP TT 2034.2
TSPOH 577.6
TACH 2034.2

Prop Entries

Performed Annual inspection of propeller IAW FAR 43 Appendix D, inspected spinner, blades, hub, and mounting; no defects noted at this time. Dressed and cleaned prop as needed. ADs searched on ATP through 04/01/2022.

I certify this Propeller has been inspected IAW with an Annual Inspection and was found to be in Airworthy Condition.

Maintenance Release

The aircraft and/or component(s) on N984PG was repaired and inspected in accordance with current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of this maintenance are on file at our facility under the above work/service order number as applicable.

DATE: 4/12/2022

SIGNED:



Dustin Heffner, IA: 3784018

Work Order: 1560

Printed by EBis 3 (datcomedia.com)

wo: WO_4573

Propeller - page 1 of 1



Heck Air LLC - 1389 General Aviation Dr. - Melbourne, FL 32935 - 3212559155

N984PG

February 12, 2024

Flight: 2101.9

SINCE OVERHAUL
(Flight): 645.3

Hobbs: 2242.0

Complied with conditional inspection on this propeller. In accordance with Cirrus SR20 Airplane Maintenance Manual (CHAPTER 5-20: SCHEDULED MAINTENANCE).

I certify that this Propeller has been inspected on 02/12/2024 in accordance with the scope and detail of Appendix D to Part 43 and found to be in a condition safe for flight.

Jack Mabb A&P 4936656

A handwritten signature in blue ink, appearing to read "JM", written over a horizontal line.

Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
------	----------------------	------------	---



1500 Perimeter Rd Hangar C,
West Palm Beach, FL 33406
PH: (561)615-4033 FX: (561)615-3897

02/19/2025

N984PG SR20 S/N 1959 HOBBS 2393.3

BSA WO # 25-1214

PROPELLER PHC-J3YF-1RF SN FP6641B

COMPLIED WITH A CONDITIONAL INSPECTION ON THIS PROPELLER IN ACCORDANCE WITH CIRRUS SR20 AIRCRAFT MAINTENANCE
MANUAL CHAPTER 05-20 SCHEDULED MAINTENANCE.

I CERTIFY THAT THIS PROPELLER HAS BEEN INSPECTED ON 2-18-2025 IN ACCORDANCE WITH THE SCOPE AND DETAIL OF PART 43
APPENDIX D AND FOUND TO BE IN A SAFE CONDITION FOR FLIGHT.

This aircraft is approved for return to service for the work performed.

Date: 02/19/2025

STEVEN WARD, AP 212922616

wo: WO_8224

Propeller · page 1 of 1



Heck Air LLC · 1389 General Aviation Dr. · Melbourne, FL 32935 · 3212559155

N984PG

October 14, 2025

FLIGHT: 2222.3

HOBBS: 2434.2

Performed Annual Inspection IAW Cirrus SR20 AMM 12137-001. Serviced with Aeroshell 6. Researched AD's through this date. I certify that this Propeller has been inspected IAW an Annual Inspection and was determined to be in airworthy condition at this time.

Phillip Scrivner A&P IA 2724196

A handwritten signature in black ink, appearing to read "Phillip Scrivner".