

N284DP

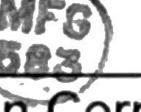
AIRCRAFT LOG
AF5-1

LIFE LIMITED PARTS OR OVERHAUL REQUIREMENTS

Life Limited Parts SR20

PART NAME	PART NUMBER		EXPIRES
CAPS Rocket Motor	29500-005	S/N: 4938	07/2032
CAPS Parachute	25337-005	S/N: 001416	04/2032
CAPS Reefing Line Cutters	26707-001	S/N: 20387 S/N: 20491	03/2028
ELT Battery Pack	452-6504-1		07/2028
EMA Controller, AAIR	20902-001	S/N: A07APR22-48	04/2029
CO Detector	24660-002	S/N: 113919	06/2029
Pilot Seat Inflator Assembly	20902-005	S/N: Z7DH047D0703	06/2032
Co-Pilot Seat Inflator Assembly	20902-005	S/N: Z7EH046D0335	06/2032

AIRWORTHINESS DIRECTIVE/FACTORY BULLETIN COMPLIANCE RECORD

BULL. BER	ITEM AFFECTED	DATE & HRS. AT COMP.	METHOD OF COMPLIANCE	TYPE OF A.D. 1 TIME/RECUR.	NEXT COMP. DATE/HRS./CYCLE	AUTHORIZED SIGNATURE CERTIFICATE NO.
		<u>8 AUG 22</u> 2.3				<p>All Airworthiness Directives have been reviewed through bi-weekly issue <u>2022-16</u>.</p> <p>At this time, there are no Airworthiness Directives which are applicable to this aircraft, aircraft engine, propeller or its accessories.</p>
		<u>10 AUG 22</u> 2.3				<p>All mandatory Service Bulletins that apply to Cirrus Design Corporation Model SR <u>20</u> S/N <u>8760</u> have been verified to be incorporated and/or not applicable at this time.</p> <p>CDC  on <u>10 AUG 2022</u>. Cirrus Design Corporation Duluth, MN USA PC# 338CE</p>

ALTIMETER & STATIC SYSTEM CHECKS

F.A.R. 91.411

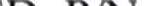
I certify that the altimeter, static system, transponder, and altitude reporter test required by FAR's 91.411,91.413,& 91.217 have been performed and found within the limits of FAR 43 appendices E&F and AC 43-6D.

TESTED TO 18,000 **FEET ON** 16/JUN/2022

Transponder: Mfg Garmin P/N 36745-002
Model: GTX-345 S/N 3EH042673

**ADAHRS: Model GSU 75 P/N 36741-001
S/N 3KY008222**

ADAHRS: Model GSU 75 P/N 36741-001
S/N 3KY008229

Altimeter: Mfg UNITED P/N 12731-003
S/N 521929 

CDC Quality Assurance  on 16/JUN/2022

Cirrus Design Corporation Duluth, MN USA

PC# 338CE

ALTIMETER & STATIC SYSTEM CHECKS

F.A.R. 91.411

Achievement Aviation of Ohio

CRS 9FDR993C

Facility Address:
747 Airport Dr
Lima, OH 45804

December 12, 2023 N284DP Cirrus SR20

I certify that the altimeter and static system tests required by 14 CFR part 91, § 91.411 and transponder tests, including data correspondence, required by § 91.413, have been performed and found to comply with 14 CFR part 43, appendices E and F.

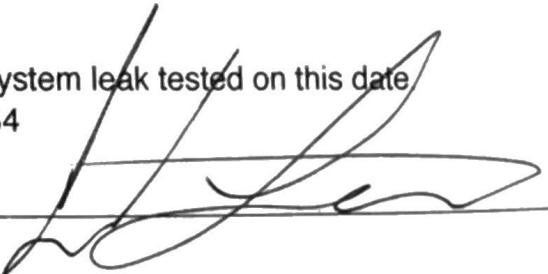
Altimeter Make: United	Model: 12731-003	Serial No. 521929
Altimeter Make: Garmin	Model: GSU 75	Serial No. 3KY008222
Encoder Make: Garmin	Model: GSU 75	Serial No. 3KY008229
Transponder Make: Garmin	Model: GTX 345	Serial No. 3EH042673

The altimeters were tested to 20,000 feet on this date.

The transponder was tested on this date.

Encoder data correspondence was tested to 20,000 feet on this date. Static system leak tested on this date.

Details of the inspection are on file at the repair station under work order B084

December 12, 2023 Certified Repair Station 9FDR993C Signature: 

INSPECTION RECORD

F.A.R. 43.11-91.409

DATE	AIRCRAFT TIME IN SERVICE	KIND OF INSPECTION-STATUS & DISCREPANCY LIST SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE
5 Aug 2022	2.3	 CIRRUS AIRCRAFT
		Production Flight Test accomplished in accordance with Cirrus Procedure #90500.
		Name: Chad Friedrich Title: Production Flight Test Pilot
		Signature:  Date: 5 Aug 2022
10 Aug 2022	2.7	I find that the aircraft meets the requirements for the certification requested and have issued an U.S. Standard Airworthiness Certificate dated 10 AUG 2022. The next inspection is due 31 AUG 2023.
		
		Abram K. Pauna ODA-834662-CE

MAKE: Cirrus
MODEL S20
S/N 8870
REG NO N284DP
WORK ORDER
33678-01-2023



First Flight Aviation

10600 Springboro Pike
Miamisburg, Ohio 45342 USA
Phone 937-885-5580

DATE 1/19/2023
A/C TSN 374
FLIGHTTIME 374

Airframe Entries

(2) Removed and charged battery. Cirrus field service pushed gateway module software update for parasitic battery 1 drain. Ground run ops check good.

Maintenance Release

The aircraft and/or component(s) on N284DP was repaired and inspected in accordance with current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service with respect to the work performed. Pertinent details of the repair are on file at this repair station under Work Order No 33678-01-2023.

DATE: 1/19/2023

SIGNED:

Warren, Josh, A&P 3823176

Work Order: 33678-01-2023

Printed by EBis 3 (datcomedia.com)

118-08-2023 (08-28-2023)

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO.: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

Page 1 / 1

W/O #: 118-08-2023
DATE: 08-28-2023
A/C TT: 106.4
A/C Tach: 106.4

Airframe Entries

- Installed new Concorde Battery P/N RG24-15M, S/N 41318191

I certify this aircraft has been inspected IAW FAR regulations and is certified for return to service.

DATE: 08-28-2023

SIGNED:

Tim Kerns
FAA Cert A&P 3390695 IA

WORK ORDER: 118-08-2023
Printed by EBIS (EBISCloud.com)

124-08-2023 (09-01-2023)

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO.: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

Page 1 / 1
W/O #: 124-08-2023
DATE: 09-01-2023
A/C TT: 180.5
A/C Tach: 180.5

Airframe Entries

- Performed Annual inspection IAW Cirrus SR20 MM and inspection checklist....
- ELT test and inspect IAW FAR 91.207(d) No discrepancies noted. Next battery replacement due 07/31/2028....
- Installed 4ea new L/H and R/H Bemnger Brake linings P/N 31392-105. ...
- Researched and compiled with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 09-01-2023

SIGNED:

Tim Kerns
FAA Cert A&P 3390695 IA

WORK ORDER: 124-08-2023
Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO.: N284DP

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 167-10-2023
 DATE: 10-06-2023
 A/C TT: 275.9
 A/C Tach: 275.9

Airframe Entries

- Performed 100 hour inspection IAW Cirrus MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due 7/31/2028.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 10-06-2023

SIGNED: 

WORK ORDER: 167-10-2023

Tim Kerns
 FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)

176-10-2023 (10-16-2023)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO.: N284DP

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 176-10-2023
 DATE: 10-16-2023
 A/C TT: 310.0
 A/C Tach: 310.0

Airframe Entries

- Installed new L/H & R/H main Michelin 15-6.00-6 tires P/N 025-501-0, S/N 3169T00171. See Form 1 dated 6/22/2023. Installed 2ea new R/H Beringer brake linings P/N PQT-010.

I certify this aircraft has been inspected IAW FAR regulations and is certified for return to service.

DATE: 10-16-2023

SIGNED: 

WORK ORDER: 176-10-2023

195-11-2023 (11-03-2023)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO.: N284DP

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

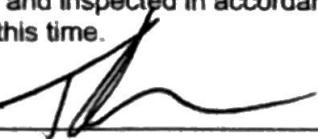
W/O #: 195-11-2023
 DATE: 11-03-2023
 A/C TT: 371.3
 A/C Tach: 371.3

Airframe Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due 07/31/2028.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 11-03-2023

SIGNED: 

WORK ORDER: 195-11-2023

Tim Kerns
 FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO.: N284DP

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 238-12-2023
 DATE: 12-14-2023
 A/C TT: 471.4
 A/C Tach: 471.4

Airframe Entries

- Performed 100 hour inspection IAW Cirrus MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due JUL 2028.... • Installed new Nose Michelin 5.00-5-6 ply tire P/N 025-309-0. Rotated main tires.... • Installed new Benner Brake Rotors P/N 31392-108 and linings P/N 31392-105.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 12-14-2023

SIGNED: 

WORK ORDER: 238-12-2023

Tim Kerns
 FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)

299-02-2024 (03-22-2024)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO.: N284DP

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

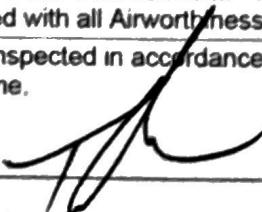
W/O #: 299-02-2024
 DATE: 03-22-2024
 A/C TT: 566.8
 A/C Tach: 566.8

Airframe Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due 07/31/2028.... • Installed new #2 batteries P/N 50979-001. Next due Mar 2026.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 03-22-2024

SIGNED: 

WORK ORDER: 299-02-2024

Tim Kerns
 FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)

272-01-2024 (01-17-2024)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO.: N284DP

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 272-01-2024
 DATE: 01-17-2024
 A/C TT: 520.8
 A/C Tach: 520.8

Airframe Entries

- Inspected Alternator IAW Hartzell Plane Power ICA. No discrepancies noted.

DATE: 01-17-2024

SIGNED: 

WORK ORDER: 272-01-2024

Alvin Minzler
 FAA Cert A&P 3099793

Printed by EBIS (EBISCloud.com)

411-05-2024 (05-02-2024)

MAKE Cirrus
MODEL SR20
S/N 8760
REG NO N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O # 411-05-2024
DATE 05-02-2024
A/C TT 621 4
A/C Tach 621 4

Page 1 / 1

Airframe Entries

- Installed serviceable Concorde battery P/N RG24-15M and two new #2 batteries. Next due May 2026

DATE 05-02-2024

SIGNED
Tim Kems
FAA Cert A&P 3390695 IA

WORK ORDER 411-05-2024
Printed by EBIS (EBISCloud.com)

Page 1 / 1

VICE

429-05-2024 (05-17-2024)

MAKE Cirrus
MODEL SR20
S/N 8760
REG NO N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O # 429-05-2024
DATE 05-17-2024
A/C TT 662 2
A/C Tach 662 2

Airframe Entries

- Performed 100 hour inspection IAW MM and inspection checklist ... • ELT test and inspect IAW FAR 91 207(d)
No discrepancies noted. Next battery replacement due 07/31/2028 ... • Installed new L/H & R/H main Michelin 15-
6 00-6 tire P/N 025-501-0 See 8130-3 forms dated 6/21/2023 and 6/23/2023. Installed 2 pairs of 2ea new
Benger brake linings P/N PQT-010. ... • Researched and complied with all Airworthiness Directives. See
compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was
determined to be in airworthy condition at this time

DATE 05-17-2024

SIGNED
Tim Kems
FAA Cert A&P 3390695 IA

WORK ORDER 429-05-2024
Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 411-05-2024
DATE: 05-02-2024
A/C TT: 621.4
A/C Tach: 621.4

Airframe Entries

- Installed serviceable Concorde battery P/N RG24-15M and two new #2 batteries. Next due May 2026.

DATE: 05-02-2024

SIGNED:


Tim Kerns
FAA Cert A&P 3390695 IA

WORK ORDER: 411-05-2024

Printed by EBIS (EBISCloud.com)

429-05-2024 (05-17-2024)

Page 1 / 1

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 429-05-2024
DATE: 05-17-2024
A/C TT: 662.2
A/C Tach: 662.2

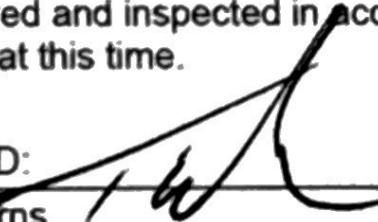
Airframe Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due 07/31/2028.... • Installed new L/H & R/H main Michelin 15-6.00-6 tire P/N 025-501-0. See 8130-3 forms dated 6/21/2023 and 6/23/2023...Installed 2 pairs of 2ea new Beringer brake linings P/N PQT-010.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 05-17-2024

SIGNED:


Tim Kerns
FAA Cert A&P 3390695 IA

WORK ORDER: 429-05-2024

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 476-06-2024
DATE: 06-18-2024
A/C TT: 761.0
A/C Tach: 761.0

Airframe Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due 07/31/2028.... • Installed new R/H main Michelin 15-6.00-6 tire P/N 025-501-0 S/N 3110T00219. See Form One dated 4/23/2023. Installed 4ea new Beringer brake pads P/N 31392-105.... • C/W AD 84-26-02 by installation on new Donaldson paper induction air filter P/N P198290. Next due in 500 hours.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 06-18-2024

SIGNED:

Alvin Minzler
FAA Cert A&P 3099793

WORK ORDER: 476-06-2024

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 540-07-2024
DATE: 07-23-2024
A/C TT: 860.2
A/C Tach: 860.2

Airframe Entries

- Performed ANNUAL inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due July 2028. ... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 07-23-2024

SIGNED:

Tim Kerns
FAA Cert A&P 3390695 IA

WORK ORDER: 540-07-2024

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

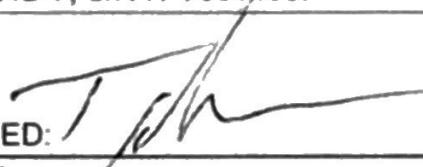
Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 570-08-2024
DATE: 08-08-2024
A/C TT: 907.8
A/C Tach: 907.8

Airframe Entries

- Installed new Alternator P/N ES10024B-7, S/N H-Y061438.

DATE: 08-08-2024

SIGNED: 

WORK ORDER: 570-08-2024

Tim Kerns
FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 599-08-2024
DATE: 08-22-2024
A/C TT: 960.1
A/C Tach: 960.1

Airframe Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d).
No discrepancies noted. Next battery replacement due 07/31/2028.... • Installed new L/H & R/H main Michelin 15-6.00-6 tires P/N 025-501-0, S/N 4078T00036 and S/N 4078T00006. See Form Ones dated 3/19/24. ... • Installed 2 ea new Beringer brake dics P/N 31392-108. Installed 4 ea new Beringer brake pads P/N PQT-010(A).... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 08-22-2024

SIGNED: 

WORK ORDER: 599-08-2024

Tim Kerns
FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 662-09-2024
DATE: 10-15-2024
A/C TT: 1052.1
A/C Tach: 1052.1

Airframe Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due July 2028. • Installed new intake air filter P/N P10-6150.... • C/W Throttle lever inspection airworthiness concern sheet by dye pen inspection. • C/W SB2X-25-30R1 crew seat break over pin adjustment by checking measurement of break over pin to lower seat frame.... • C/W SB2X-95-30 special purpose equipment by visual inspection.... • C/W SA23-06R2 by inspection of seat belt buckle IAW AmSafe SL 7041.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 10-15-2024

SIGNED:

Alvin Minzler
FAA Cert 3099793 A&P

WORK ORDER: 662-09-2024

Printed by EBIS (EBISCloud.com)

818-01-2025 (01-13-2025)

Page 1 / 1

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 818-01-2025
DATE: 01-13-2025
A/C TT: 1151.6
A/C Tach: 1151.6

Airframe Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due 31/2028. • C/W AD 84-26-02 Donaldson Air Filter by install of new filter P/N P198290.... • C/W AD 2024-24-11 by visual inspection, next due in 110 hours.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 01-13-2025

SIGNED:

Alvin Minzler
FAA Cert 3099793 A&P

WORK ORDER: 818-01-2025

Printed by EBIS (EBISCloud.com)

DATE
MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 834-01-2025
DATE: 02-03-2025
A/C TT: 1166.7
A/C Tach: 1166.7

Airframe Entries

- Repaired & painted tail and rudder at Fuselage Station WL325 and WL165. All work performed per Cirrus MM Ch. 51-70. See 337 dated 3/3/2025.

DATE: 02-03-2025

SIGNED:

Tim Kerns
FAA Cert A&P 3390695 IA

WORK ORDER: 834-01-2025

Printed by EBIS (EBISCloud.com)

977-04-2025 (04-16-2025)

Page 1 / 1

DATE
MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 977-04-2025
DATE: 04-16-2025
A/C TT: 1252.0
A/C Tach: 1252.0

Airframe Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due 07/31/2028.... • Installed new Cirrus CHT #3 sensor P/N 24584-001.... • Installed new L/H & R/H main Michelin 15-6.00-6 tires P/N 025-501-0, S/N 4163T00008 & 4158T00029. See Form Ones dated 6/13/24.... • Installed 2ea new L/H & R/H Beringer brake discs P/N 31392-108 & 4ea new Beringer brake pads P/N 31392-105. ... • C/W AD 2024-24-11 IAW SB2X-76-05, next due in 110 hours.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 04-16-2025

SIGNED:

Tim Kerns
FAA Cert A&P 3390695 IA

WORK ORDER: 977-04-2025

Printed by EBIS (EBISCloud.com)

IR SERVICE

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 1068-06-2025
 DATE: 06-05-2025
 A/C TT: 1351.4
 A/C Tach: 1351.4

Airframe Entries

- Performed 100 hour inspection IAW Cirrus MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due 07/31/2028.... • Installed new Forward engine baffle bracket assy P/N 31066-001.... • Installed new Cirrus Welmont Muffler, Heat exchanger P/N 21878-001.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 06-05-2025

SIGNED:

WORK ORDER: 1068-06-2025

Tim Kems
 FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 1197-07-2025
 DATE: 07-29-2025
 A/C TT: 1448.7
 A/C Tach: 1448.7

Airframe Entries

- Performed ANNUAL inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). ELT battery is inoperative. "Aircraft engaged in training operations is conducted entirely within a 50-nautical mile radius of the airport from which such local flight operations began." Aircraft is placarded "ELT not installed" IAW FAR 91.207 (f)(10)(i).... • Installed new Donaldson induction air filter P/N P198290.... • C/W AD 2024-24-11 by dye pen per SB2X-76-05 para A-F. No cracks found in upper power lever, next due in 110 hours.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 07-29-2025

SIGNED:

WORK ORDER: 1197-07-2025

Tim Kems
 FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 1216-08-2025
DATE: 08-05-2025
A/C TT: 1451.8
A/C Tach: 1451.8

DATE

CRAFT FOR SERVICE

Airframe Entries

- Installed new Artx ELT 1000 battery pack replacement kit P/N 8302, S/N 1022793-005. Next battery replacement due OCT 2031.

DATE 08-05-2025

SIGNED:



WORK ORDER: 1216-08-2025

Michael Stevens
FAA Cert 5029481 A&P

Printed by EBIS (EBISCloud.com)

ACR ELECTRONICS, Inc.
Artx Products - CAGE Code 18560
Fort Lauderdale, FL 33312
LOG BOOK ENTRY 1216-08-2025
E.L.T. BATTERY
REPLACEMENT DATE 10/2031



MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 1068-06-2025
 DATE: 06-05-2025
 A/C TT: 1351.4
 A/C Tach: 1351.4

Airframe Entries

- Performed 100 hour inspection IAW Cirrus MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). No discrepancies noted. Next battery replacement due 07/31/2028.... • Installed new Forward engine baffle bracket assy P/N 31066-001.... • Installed new Cirrus Weldmont Muffler, Heat exchanger P/N 21878-001.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 06-05-2025

SIGNED:

WORK ORDER: 1068-06-2025

Tim Kerns
 FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 1197-07-2025
 DATE: 07-29-2025
 A/C TT: 1448.7
 A/C Tach: 1448.7

Airframe Entries

- Performed ANNUAL inspection IAW MM and inspection checklist.... • ELT test and inspect IAW FAR 91.207(d). ELT battery is inoperative. "Aircraft engaged in training operations is conducted entirely within a 50-nautical mile radius of the airport from which such local flight operations began." Aircraft is placarded "ELT not installed" IAW FAR 91.207 (f)(10)(i).... • Installed new Donaldson induction air filter P/N P198290.... • C/W AD 2024-24-11 by dye pen per SB2X-76-05 para A-F. No cracks found in upper power lever, next due in 110 hours.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 07-29-2025

SIGNED:

WORK ORDER: 1197-07-2025

Tim Kerns
 FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)