

N284DP

N284DP

Airframe TT: 1448.7 1451.8

Engines TT: 1448.7 1451.8

Prop TT: 396.6

ENGINE LOG BOOK



Engine Log & Maintenance Record

LOG #: 1

RECORD OF CIRRUS DESIGN CORP SR20 8760
(MAKE) (MODEL) (SERIAL)

AIRCRAFT REGISTRATION NUMBER: N284DP

FROM August 2022 TO _____ 20____

DETAILING TIME FROM _____ TO _____
(HOURS) (HOURS)

If used on a multi-engine aircraft: Right Left Front Rear

New Reciprocating Engine Certificate

This is to certify that the engine as described hereinafter has been manufactured and ground operation tested as prescribed by Lycoming specification and Federal Aviation Regulations. All applicable Federal Aviation Airworthiness Directives applicable Lycoming Service Publications have been complied with at time of manufacture. Refer to enclosed Form ET001 for applicable accessory part numbers and serial numbers.

LYCOMING

Part Number	ENPL-RT11143
Serial Number	L-1834-80E
Engine Model	IO-390-C3B6
Work Order	KM799674
Total Time	0

Charles Hess 5/3/22
Authorized Representative Date

Production Certificate #3

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO.: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 167-10-2023
 DATE: 10-06-2023
 A/C Tach: 275.9
 ENG TT: 275.9

Engine Entries

- Performed 100 hour inspection IAW Cirrus MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis.... • Compressions [#1 (79/80), #2 (78/80), #3 (76/80), #4 (77/80)].... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 10-06-2023

SIGNED:


 Tim Kerns
 FAA Cert A&P 3390695 IA

WORK ORDER: 167-10-2023

Printed by EBIS (EBISCloud.com)

183-10-2023 (10-24-2023)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO.: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 183-10-2023
 DATE: 10-24-2023
 A/C Tach: 330.8
 ENG TT: 330.8

Engine Entries

- Performed 50 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Researched and complied with all Airworthiness Directives. See compliance list.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 10-24-2023

SIGNED:


 Tim Kerns
 FAA Cert A&P 3390695 IA

WORK ORDER: 183-10-2023

Printed by EBIS (EBISCloud.com)

195-11-2023 (11-03-2023)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO.: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 195-11-2023
 DATE: 11-03-2023
 A/C Tach: 371.3
 ENG TT: 371.3

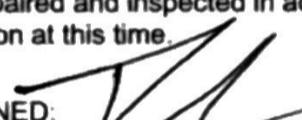
Engine Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Compressions [#1 (79/80), #2 (79/80), #3 (79/80), #4 (79/80)].... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 11-03-2023

SIGNED:


 Tim Kerns
 FAA Cert A&P 3390695 IA

WORK ORDER: 195-11-2023

Printed by EBIS (EBISCloud.com)

214-11-2023 (11-16-2023)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO.: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 214-11-2023
 DATE: 11-16-2023
 A/C Tach: 419.3
 ENG TT: 419.3

Engine Entries

- Performed 50 hour inspection IAW Cirrus MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Researched and complied with all Airworthiness Directives. See compliance list.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 11-16-2023

SIGNED:


 Tim Kerns
 FAA Cert A&P 3390695 IA

WORK ORDER: 214-11-2023

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus
MODEL: SR20
S/N 8760
REG NO: N284DP
ENGINE MAKE: LYCOMING
ENGINE MODEL: IO-390-
C3B6
ENGINE SN: L-1834-80E

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 238-12-2023
DATE: 12-14-2023
A/C Tach 471.4
ENG TT 471.4

Engine Entries

- Performed 100 hour inspection IAW Cirrus MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis.... • Compressions [#1 (79/80), #2 (78/80), #3 (78/80), #4 (78/80)]... • Installed L/H magneto P/N 4345, S/N L-09400, overhauled by Kelly Aerospace. See 8130-3 form dated 9/22/2023. Installed R/H magneto P/N 4370, S/N 12120867 after 500 hour inspection by Professional Aircraft Accessories, see 8130-3 form dated 10/16/2023... • Installed 8ea new Spark Plugs P/N UREB37E.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 12-14-2023

SIGNED:


 Tim Kems
FAA Cert A&P 3390695 IA

WORK ORDER: 238-12-2023

Printed by EBIS (EBISCloud.com)

272-01-2024 (01-17-2024)

Page 1 / 1

MAKE: Cirrus
MODEL: SR20
S/N 8760
REG. NO.: N284DP
ENGINE MAKE: LYCOMING
ENGINE MODEL: IO-390-
C3B6
ENGINE SN: L-1834-80E

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 272-01-2024
DATE: 01-17-2024
A/C Tach 520.8
ENG TT: 520.8

Engine Entries

- Performed 50 hour inspection IAW Cirrus MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48108-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Researched and complied with all Airworthiness Directives. See Compliance List.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 01-17-2024

SIGNED:


 Tim Kems
FAA Cert A&P 3390695 IA

WORK ORDER: 272-01-2024

Printed by EBIS (EBISCloud.com)

299-02-2024 (03-22-2024)

Page 1 / 1

MAKE: Cirrus
MODEL: SR20
S/N 8760
REG NO: N284DP
ENGINE MAKE: LYCOMING
ENGINE MODEL: IO-390-
C3B6
ENGINE SN: L-1834-80E

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 299-02-2024
DATE: 03-22-2024
A/C Tach 566.8
ENG TT: 566.8

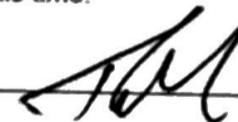
Engine Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis.... • Installed #3 cylinder repaired by G&N Aircraft. See work order 024/75808 dated 3/14/2024.... • Compressions [#1 (68/80), #2 (74/80), #3 (80/80), #4 (70/80)]... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 03-22-2024

SIGNED:


 Tim Kems
FAA Cert A&P 3390695 IA

WORK ORDER: 299-02-2024

Printed by EBIS (EBISCloud.com)

402-04-2024 (04-26-2024)

Page 1 / 1

MAKE: Cirrus
MODEL: SR20
S/N 8760
REG NO: N284DP
ENGINE MAKE: LYCOMING
ENGINE MODEL: IO-390-
C3B6
ENGINE SN: L-1834-80E

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 402-04-2024
DATE: 04-26-2024
A/C Tach: 610.4
ENG TT: 610.4

Engine Entries

- Performed 50 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 7 qts 20w50 oil and AA48108-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample... • Researched and complied with all Airworthiness Directives. See compliance list.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 04-26-2024

SIGNED:


 Tim Kems
FAA Cert A&P 3390695 IA

Page 1 / 1

411-05-2024 (05-02-2024)

MAKE Cirrus
MODEL SR20
S/N 8760
REG NO N284DP
ENGINE MAKE LYCOMING
ENGINE MODEL IO-390-
C3B6
ENGINE SN L-1834-80E

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

Page 1 / 1

W/O # 411-05-2024
DATE 05-02-2024
A/C Tach 621.4
ENG TT 621.4 || #

Date	Time Run (Hours)
 BROUGHT FORWARD	

Engine Entries

- Installed magnetos after 500 hour inspection by Professional Aircraft Accessories P/N 4370, S/N 93050152 and P/N 4345, S/N 22010443 See 8130-3 forms dated 1/16/24 and 1/15/24 Cleaned spark plugs

DATE 05-02-2024

SIGNED

Tim Kerns
FAA Cert A&P 3390695 IA

WORK ORDER 411-05-2024
Printed by EBIS (EBISCloud.com)

Nature	Licence #

Page 1 / 1

429-05-2024 (05-17-2024)

MAKE Cirrus
MODEL SR20
S/N 8760
REG NO N284DP
ENGINE MAKE LYCOMING
ENGINE MODEL IO-390-
C3B6
ENGINE SN L-1834-80E

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O # 429-05-2024
DATE 05-17-2024
A/C Tach 662.2
ENG TT 662.2

Engine Entries

- Performed 100 hour inspection IAW MM and inspection checklist. • Changed oil, cut open filter, no discrepancies noted. Serviced with 7 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis. • Compressions [#1 (64/80), #2 (74/80), #3 (73/80), #4 (78/80)] • C/W AD 15-19-07 by visual inspection, no discrepancies noted. Next due in 110 hours. • Researched and complied with all Airworthiness Directives. See compliance records

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE 05-17-2024

SIGNED

Tim Kerns
FAA Cert A&P 3390695 IA

WORK ORDER 429-05-2024
Printed by EBIS (EBISCloud.com)

Page 1 / 1

446-05-2024 (05-30-2024)

MAKE Cirrus
MODEL SR20
S/N 8760
REG NO N284DP
ENGINE MAKE LYCOMING
ENGINE MODEL IO-390-
C3B6
ENGINE SN L-1834-80E

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O # 446-05-2024
DATE 05-30-2024
A/C Tach 702.8
ENG TT 702.8

Engine Entries

- Performed 50 hour inspection IAW MM and inspection checklist. • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample. • Researched and complied with all Airworthiness Directives. See compliance list.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE 05-30-2024

SIGNED

Alvin Minzler
FAA Cert A&P 3099793

WORK ORDER 446-05-2024
Printed by EBIS (EBISCloud.com)

Page 1 / 1

476-06-2024 (06-18-2024)

MAKE Cirrus
MODEL SR20
S/N 8760
REG NO. N284DP
ENGINE MAKE LYCOMING
ENGINE MODEL IO-390-
C3B6
ENGINE SN: L-1834-80E

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O # 476-06-2024
DATE 06-18-2024
A/C Tach 761.0
ENG TT 761.0

Engine Entries

- Performed 100 hour inspection IAW MM and inspection checklist. • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis. • Compressions [#1 (74/80), #2 (78/80), #3 (78/80), #4 (78/80)] • C/W AD 15-19-07 by visual inspection, no discrepancies noted. Next due in 110 hours. • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with an ANNUAL/100 hour inspection and was determined to be in airworthy condition at this time.

DATE 06-18-2024

SIGNED

Alvin Minzler
FAA Cert A&P 3099793

WORK ORDER 476-06-2024
Printed by EBIS (EBISCloud.com)

Page 1 / 1

Page Total: _____**Brought Forward:** _____

All repair data must bear the endorsement of a certified mechanic, and his/her rating and certificate number MUST be shown.

504-07-2024 (07-01-2024)

MAKE: Cirrus
 MODEL: SR20
 S/N 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 504-07-2024
 DATE: 07-01-2024
 A/C Tach: 799.1
 ENG TT: 799.1

Tim
(H)

GHT FOI

Engine Entries

- Performed 50 hour inspection IAW Cirrus MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 7 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Researched and complied with all Airworthiness Directives. See Compliance List.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 07-01-2024

SIGNED:

Alvin Minzler
 FAA Cert A&P 3099793

WORK ORDER 504-07-2024

Printed by EBIS (EBISCloud.com)

540-07-2024 (07-23-2024)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 540-07-2024
 DATE: 07-23-2024
 A/C Tach: 860.2
 ENG TT: 860.2

Engine Entries

- Performed ANNUAL inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis.... • Compressions [#1 (70/80), #2 (77/80), #3 (76/80), #4 (78/80)]... • C/W AD 15-19-07 by visual inspection, no discrepancies noted. Next due in 110 hours.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 07-23-2024

SIGNED:

Tim Kerns
 FAA Cert A&P 3390695 IA

WORK ORDER 540-07-2024

Printed by EBIS (EBISCloud.com)

570-08-2024 (08-08-2024)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 570-08-2024
 DATE: 08-08-2024
 A/C Tach: 907.8
 ENG TT: 907.8

Engine Entries

- Performed 50 hour inspection IAW Cirrus MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 6 qts 20w50 oil and AA48108-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Researched and complied with all Airworthiness Directives. See Compliance List.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 08-08-2024

SIGNED:

Tim Kerns
 FAA Cert A&P 3390695 IA

WORK ORDER 570-08-2024

Printed by EBIS (EBISCloud.com)

599-08-2024 (08-22-2024)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 599-08-2024
 DATE: 08-22-2024
 A/C Tach: 960.1
 ENG TT: 960.1

Engine Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis.... • Installed new #3 Lycoming cylinder 16A30180-02, S/N 533764820-1. See 8130-3 form dated 7/5/24.... • Compressions [#1 (78/80), #2 (78/80), #3 (78/80), #4 (78/80)]... • C/W AD 15-19-07 by visual inspection, no discrepancies noted. Next due in 110 hours.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been

Total:

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 624-08-2024
 DATE: 08-30-2024
 A/C Tach: 1009.0
 ENG TT: 1009.0

Date	Time (Ho)

Engine Entries

- Performed 50 hour inspection IAW Diamond MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Researched and complied with all Airworthiness Directives. See Compliance List.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 08-30-2024

SIGNED:

Lee Myers
 FAA Cert 4583781

WORK ORDER: 624-08-2024

Printed by EBIS (EBISCloud.com)

662-09-2024 (10-15-2024)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 662-09-2024
 DATE: 10-15-2024
 A/C Tach: 1052.1
 ENG TT: 1052.1

Engine Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis.... • Compressions [#1 (77/80), #2 (70/80), #3 (78/80), #4 (76/80)]... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 10-15-2024

SIGNED:

Alvin Minzler
 FAA Cert 3099793 A&P

WORK ORDER: 662-09-2024

Printed by EBIS (EBISCloud.com)

735-11-2024 (11-08-2024)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 735-11-2024
 DATE: 11-08-2024
 A/C Tach: 1099.2
 ENG TT: 1099.2

Engine Entries

- Performed 50 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Researched and complied with all Airworthiness Directives. See compliance list.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 11-08-2024

SIGNED:

Tim Kerns
 FAA Cert A&P 3390695 IA

WORK ORDER: 735-11-2024

Printed by EBIS (EBISCloud.com)

818-01-2025 (01-13-2025)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 818-01-2025
 DATE: 01-13-2025
 A/C Tach: 1151.6
 ENG TT: 1151.6

Engine Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis.... • Compressions [#1 (78/80), #2 (78/80), #3 (76/80), #4 (76/80)]... • Installed and torqued 8ea new Tempest spark plugs P/N UREB37E. ... • Installed magnetos after 500 hour inspection by Professional Aircraft Accessories P/N 4370, S/N 05010003 and P/N 4345, S/N 23090277. See 8130-3 forms dated 12/17/24 and 9/10/24.... • C/W AD 15-19-07 by visual inspection, no discrepancies noted. Next due in 110 hours.... • AD 2024-21-02 does not apply per Table 1 to paragraph (c).... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 01-13-2025

SIGNED:

Alvin Minzler
 FAA Cert 3099793 A&P

WORK ORDER: 818-01-2025

Printed by EBIS (EBISCloud.com)

certificate number

Page Tot:

Brought I

Total

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 920-03-2025
 DATE 03-14-2025
 A/C Tach 1202.4
 ENG TT 1202.4

Engine Entries

- Performed 50 hour inspection IAW MM and inspection checklist. ... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Researched and complied with all Airworthiness Directives. See compliance list.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 03-14-2025

SIGNED:

WORK ORDER: 920-03-2025

Lee Myers
 FAA Cert 4583781 A&P

Printed by EBIS (EBISCloud.com)

977-04-2025 (04-16-2025)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 977-04-2025
 DATE: 04-16-2025
 A/C Tach: 1252.0
 ENG TT: 1252.0

Engine Entries

- Performed 100 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis.... • Compressions [#1 (78/80), #2 (76/80), #3 (68/80), #4 (76/80)]... • C/W AD 15-19-07 by visual inspection, no discrepancies noted. Next due in 110 hours.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 04-16-2025

SIGNED:

WORK ORDER: 977-04-2025

Tim Kerns
 FAA Cert A&P 3390695 IA

Printed by EBIS (EBISCloud.com)

1024-05-2025 (05-09-2025)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 1024-05-2025
 DATE: 05-09-2025
 A/C Tach: 1301.4
 ENG TT: 1301.4

Engine Entries

- Performed 50 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Researched and complied with all Airworthiness Directives. See compliance list.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 05-09-2025

SIGNED:

WORK ORDER: 1024-05-2025

Dominic Kerns
 FAA Cert 4512993 A&P

Printed by EBIS (EBISCloud.com)

1068-06-2025 (06-05-2025)

Page 1 / 1

MAKE: Cirrus
 MODEL: SR20
 S/N: 8760
 REG. NO: N284DP
 ENGINE MAKE: LYCOMING
 ENGINE MODEL: IO-390-
 C3B6
 ENGINE SN: L-1834-80E

Midwest Corporate Air
 3100 State Route 47 West
 Bellefontaine, OH 43311

W/O #: 1068-06-2025
 DATE: 06-05-2025
 A/C Tach: 1351.4
 ENG TT: 1351.4

Engine Entries

- Performed 100 hour inspection IAW Cirrus MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis.... • Compressions [#1 (78/80), #2 (72/80), #3 (77/80), #4 (76/80)]... • C/W AD 15-19-07 by visual inspection, no discrepancies noted. Next due in 110 hours.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

WORK ORDER: 1068-06-2025

1108-06-2025 (06-23-2025)

Page 1 / 1

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP
ENGINE MAKE: LYCOMING
ENGINE MODEL: IO-390-
C3B6
ENGINE SN: L-1834-80E

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 1108-06-2025
DATE: 06-23-2025
A/C Tach: 1402.8
ENG TT: 1402.8

Engine Entries

- Performed 50 hour inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample.... • Researched and complied with all Airworthiness Directives. See compliance list.

I certify that this aircraft has been repaired and inspected in accordance with a 50 hour inspection and was determined to be in airworthy condition at this time.

DATE: 06-23-2025

SIGNED:

Alvin Minzler
FAA Cert 3099793 A&P

WORK ORDER: 1108-06-2025

Printed by EBIS (EBISCloud.com)

1197-07-2025 (07-29-2025)

Page 1 / 1

MAKE: Cirrus
MODEL: SR20
S/N: 8760
REG. NO: N284DP
ENGINE MAKE: LYCOMING
ENGINE MODEL: IO-390-
C3B6
ENGINE SN: L-1834-80E

Midwest Corporate Air
3100 State Route 47 West
Bellefontaine, OH 43311

W/O #: 1197-07-2025
DATE: 07-29-2025
A/C Tach: 1448.7
ENG TT: 1448.7

Engine Entries

- Performed ANNUAL inspection IAW MM and inspection checklist.... • Changed oil, cut open filter, no discrepancies noted. Serviced with 8 qts 20w50 oil and AA48110-2 filter. Washed engine, leak checked. Sent out Blackstone oil sample for analysis.... • Compressions [#1 (78/80), #2 (78/80), #3 (72/80), #4 (78/80)]... • C/W AD 15-19-07 by visual inspection, no discrepancies noted. Next due in 110 hours.... • Researched and complied with all Airworthiness Directives. See compliance records.

I certify that this aircraft has been repaired and inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition at this time.

DATE: 07-29-2025

SIGNED:

Tim Kerns
FAA Cert A&P 3390695 IA

WORK ORDER: 1197-07-2025

Printed by EBIS (EBISCloud.com)