



# Continental Motors

## Engine Component Information Sheet

Printed: 02/19/2025

Serial: 1048636

Assembled: / /

Spec: I0550N7B

Shipped: / /

New/Rebuilt: (NEW)

Packed: / /

FEB 19 2025

Customer Name:

Shipping Address:

Component	Serial Number	Component	Serial Number
CAMSHAFT	542412-9	OIL COOLER	0970
CRANKSHAFT	N24AL277	CYLINDER-1	AC24LD552
CRANKCASE	R25BA013	CYLINDER - 2	AC24KB419
CONNROD	AE24HT122CP	CYLINDER - 3	AC25AA045
CONNROD	AE24HT105CP	CYLINDER - 4	AC24LD129
CONNROD	AE24HT101CP	CYLINDER - 5	AC25AA067
CONNROD	AE24HT110CP	CYLINDER - 6	AC25AA087
CONNROD	AE24HT910CP	NOZZLE - 1	1234
CONNROD	AE24HT083CP	NOZZLE - 2	2234
L MAGNETO	D25BA109	NOZZLE - 3	3239
R MAGNETO	D24LA394	NOZZLE - 4	4236
FUEL PUMP	B25AA136	NOZZLE - 5	5236
MANIFOLD VALVE	C25BA070	NOZZLE - 6	6229
METERING UNIT	A25BA045		
STARTER	H-H-162413		
STARTER ADAPTER	H-Y110226		



**Pack Inspection Stamp**

All of the information provided herein is subject to verification by the user. Continental Motors, Inc. makes no representation or warranty concerning the accuracy or completeness of the information and assumes no responsibility with respect thereto.

Date	Total Time		Time Since Last Overhaul		Engine Service and Maintenance Record
	Hours	Min	Hours	Min	
					Record maintenance actions including engine part removal and installation and compliance with inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins

**Aviation Maintenance Professionals**

4500 Tailwind Dr, Ft Pierce, FL 34946 772.200.0144 Aviationpros@gmail.com

MAKE: CIRRUS MODEL: SR-22 S/N: 0518 N1360C ENGINE  
DATE: 3/11/2025 TACH: 3481.1

- Installed this engine model IO-550-N, S/N 1048636 on aircraft N1360C on this date IAW mmm.
- Serviced with Phillips 20W50 Type M IAW Continental mm requirements chapter 3-1.1, table 3-2 & 3-3.
- Adjusted fuel flow and idle IAW SID97-3 procedures.
- Complied with 100 hour inspection checklist.
- Ran engine, no leaks noted.

I certify that this Engine has been inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition.

SIGNED Joseph Yezeck  
Joseph Yezeck AP3130427

MFG: Cirrus Model: SR22 S/N: 0518 Reg: N1360C WO: 2025-027	OZ A&P, LLC 170 Airport Road Adel, GA 31620	Cook County Airport ozy.aptech@gmail.com www.oz-ap.com	Date: 13 MAR 2025 Hobbs: 3484.9 TSMOH: 3.8
Eng MFG: Cont Motor Model: IO-550-N7B Eng S/N: 1048636			

Troubleshoot EGT system. Secured engine to airframe ground connector. Installed grommet, sealed aft electrical connectors, and baffles open end holes. Secured cylinders interbaffles. Secured spark plug leads. Installed new clamps on electrical wire bundles at top engine compartment. Secured alternator wires to avoid chafing by installing a new clamp. Installed safety wire at oil drain plug and installed missing screws at left side of engine baffles. Work was performed IAW Cirrus SR22 SM and Continental Motor SM.

Oswaldo Rodriguez A&P 3054860

MFG: Cirrus Model: SR22 S/N: 0518 Reg: N1360C WO: 2025-030	OZ A&P, LLC 170 Airport Road Adel, GA 31620	Cook County Airport ozy.aptech@gmail.com www.oz-ap.com	Date: 26 MAR 2025 Hobbs: 3488.4 TSMOH: 7.3
Eng MFG: Cont Motor Model: IO-550-N7B Eng S/N: 1048636			

Installed new CHT, P/N 14880-001. Engine was run, EGT and CHT performance were checked. CHT worked within limit. Work was performed IAW Cirrus SR22 SM and Continental Motor SM.

Oswaldo Rodriguez A&P 3054860

Customer

C

Ship

Compo

CAMSHA

CRANKS

CRANKC

CONNR

CONNF

CONN

CONN

CONN

CONN

L MF

R M

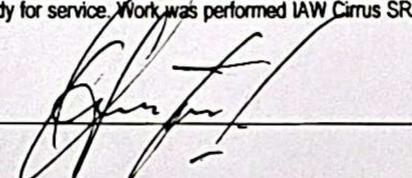
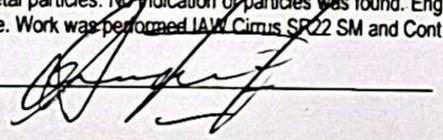
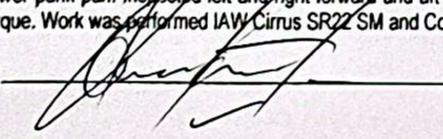
FUE


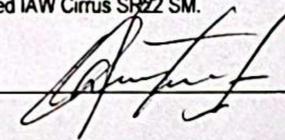
MA

ME

ST

S

Date	Total Time		Time Since Last Overhaul		<b>Engine Service and Maintenance Record</b>
	Hours	Min	Hours	Min	
Record maintenance actions including engine part removal and installation and compliance with inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins					
Carried for					
MFG: Cirrus Model: SR22 S/N: 0518 Reg: N1360C WO: 2025-032		 OZ A&P, LLC 170 Airport Road Adel, GA 31620		Cook County Airport ozy.aptech@gmail.com www.oz-ap.com	
		Eng MFG: Cont Motor Model: IO-550-N7B Eng S/N: 1048636		Date: 26 MAR 2025 Hobbs: 3498.1 TSMOH: 17	
Removed engine cowl, checked engine for leaks and general integrity of the engines components. Engine was cowed up and ran. Found no leaks. Engine is ready for service. Work was performed IAW Cirrus SR22 SM and Continental Motor SM.					
Oswaldo Rodriguez A&P 3054860 					
MFG: Cirrus Model: SR22 S/N: 0518 Reg: N1360C WO: 2025-070		 OZ A&P, LLC 170 Airport Road Adel, GA 31620		Cook County Airport ozy.aptech@gmail.com www.oz-ap.com	
		Eng MFG: Cont Motor Model: IO-550-N Eng S/N: <del>687578</del> 1048636		Date: 30 JUNE 2025 Hobbs: 3511.5 Total Time: 3487.7 TSMOH: 1515.2	
Drained oil and removed oil filter. Serviced engine with 7 qts of Phillips 20W50. Installed a new oil filter, P/N AA48108-2. Oil filter was cut and inspected for metal particles. No indication of particles was found. Engine was ran and checked for leaks. No leaks were found at this time. Work was performed IAW Cirrus SR22 SM and Cont Motor SM.					
Oswaldo Rodriguez A&P 3054860 					
MFG: Cirrus Model: SR22 S/N: 0518 Reg: N1360C WO: 2025-110		 OZ A&P, LLC 170 Airport Road Adel, GA 31620		Cook County Airport ozy.aptech@gmail.com www.oz-ap.com	
		Eng MFG: Cont Motor Model: IO-550-N Eng S/N: <del>687578</del> 1048636		Date: 11 NOV 2025 Hobbs: 3557.6 Total Time: 3533.8 TSMOH: 1561.3	
Drained oil and removed oil filter. Serviced engine with 7 qts of Phillips 20W50. Installed a new oil filter, P/N AA48108-2. Oil filter was cut and inspected for metal particles. No indication of particles was found. Engine was ran and checked for leaks. No leaks were found at this time. Engine mount torques were inspected and adjusted as needed within limits. Inspected bolts torque value on lower punk pan. Inspected left and right forward and aft engine foots. Inspected engine mount weldment for cracks and torque. Work was performed IAW Cirrus SR22 SM and Cont Motor SM.					
Oswaldo Rodriguez A&P 3054860 					

Date	Total Time		Time Since Last Overhaul		<b>Engine Service and Maintenance Record</b>
	Hours	Min	Hours	Min	
Record maintenance actions including engine part removal and installation and compliance with inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins					
Carried					
MFG: Cirrus Model: SR22 S/N: 0518 Reg: N1360C WO: 2026-002		 OZ A&P, LLC 170 Airport Road Adel, GA 31620		Cook County Airport ozy.aptech@gmail.com www.oz-ap.com	
		Eng MFG: Cont Motor Model: IO-550-N Eng S/N: 1048636		Date: 12 JAN 2026 Hobbs: 3598 Total Time: 3598 TSMOH: 116.9	
Complied with annual inspection IAW Cirrus SR22 SM and inspection checklist and Continental Motor engine SM. Drained oil and serviced engine with 8 quarts Phillips 20W50. Replaced oil filter w/ AA48108-2. Both mags synchronized within limits. Performed cylinder compression test. Cyl#1 - 72/80; Cyl#2 - 70/80; Cyl#3 - 68/80; Cyl#4 - 70/80; Cyl#5 - 74/80 and Cyl#6 - 74/80. Installed new induction air filter, P/N BA-24. Installed silicon duct on intake pipe. Retorqued all bolts on right and left exhaust tail pipe clamps within limit. Checked and lubricated all engine controls. Engine ran and checked for leaks. No leaks found at this time. ADs checked using AD Toolbox. A list of ADs was provided to the owner.					
I certify that this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition at this time.					
Clark Walker AP 260453692 IA 					
MFG: Cirrus Model: SR22 S/N: 0518 Reg: N1360C		 OZ A&P, LLC 170 Airport Road Adel, GA 31620		Cook County Airport ozy.aptech@gmail.com www.oz-ap.com	
				Date: 13 JAN 2026 Hobbs: 3598 WO: 2026-002	
Installed brake linings, P/N RA66-105, on right and left main landing gears. Installed new brake caliper o-rings, P/N MS28775-222, on the left landing gear. Drained fluid from brake system and serviced brake system with hydraulic fluid 5606 within limit. Work was performed IAW Cirrus SR22 SM.					
Oswaldo Rodriguez A&P 3054860 					
MFG: Cirrus Model: SR22 S/N: 0518 Reg: N1360C WO: 2026-010		 OZ A&P, LLC 170 Airport Road Adel, GA 31620		Cook County Airport ozy.aptech@gmail.com www.oz-ap.com	
		Eng MFG: Cont Motor Model: IO-550-N Eng S/N: 1048636		Date: 17 FEB 2026 Hobbs: 3611.0 Total Time: 3611.0 TSMOH: 129.9	
Drained oil and removed oil filter. Serviced engine with 7 qts of Phillips 20W50. Installed a new oil filter, P/N AA48103-2. Oil filter was cut and inspected for metal particles. No indication of particles was found. Engine was ran and checked for leaks. No leaks were found at this time. CHT probe #3 and #6 were inspected. Replaced and tightened terminals on CHT #3 and #6. Troubleshot backup manifold pressure. Removed grooved attachment bolt. Installed and secured new attachment bolt at prop governor. Work was performed IAW Cirrus SR22 SM and Cont Motor SM.					
Oswaldo Rodriguez A&P 3054860 