

HARTZELL

PROPELLER LOGBOOK

PROPELLER MODEL PHC-534F-1RF/F-7392-1

PROPELLER S/N FP4841B

LOGBOOK # 1

PROPELLER MAINTENANCE RECORD

Position _____

PITCH RANGE

Propeller Model PHC J34F-1RF/F7392-1

High/Feather _____

Propeller S/N FP 4841B

Start Lock _____

Blade Design _____

Low _____

Blade S/N's

Reverse _____

No. 1 K 41074

No. 2 K 41075

Aircraft Manufacturer Cirrus Design

No. 3 K 41070

Aircraft Model SR20

No. 4 _____

S/N 1698

No. 5 _____

Registration N653CS

No. 6 _____

Spinner Assembly Part No. _____

ite

T:

8-1-07 N-653GS Model PHC-J3YF-1RF S/N FP-4841B Flight Time 102.4
Annual inspection completed this date IAW SR-20 M.M. 05-20.
Lubed, dressed and painted. AD's through 2007-15. -----END-----

The maintenance operation(s) described above were inspected in accordance with current regulations and with respect to work performed, the aircraft and/or component was found airworthy and is approved for return to service. Details are on file under work order 4204

Randall Carter
Randall Carter
CRS MYNR748K

i,
ons.



MONTGOMERY
AVIATION, INC.


11329 East State Road 32
Zionsville, IN 46077
317 - 769 - 4487

Certified Repair Station No. MYNR748K

August 11, 2008 N653GS S/N 1698 Flight Time 157.0
Annual Inspection Completed This Date. Inspected IAW Cirrus Inspection Report
ATA 05-20. Lubed prop per m/m.

The maintenance operation(s) described above were inspected in accordance
with current regulations and with respect to work performed, the aircraft and/or
component was found airworthy and is approved for return to service.

Details are on file under work order 4741

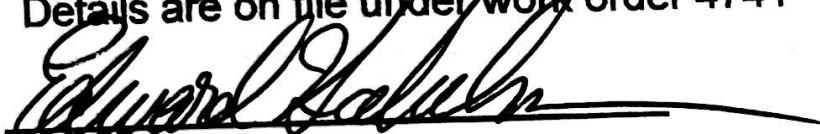

Edward Hobelman
MYNR748K



MONTGOMERY
AVIATION, INC.

11329 East State Road 32
Zionsville, IN 46077
317 - 769 - 4487

Certified Repair Station No. MYNR748K

P

TS/

July 14, 2009 N653GS S/N 1698 FLT Time and P/TT 179.5

Completed annual inspection this date. Lubed hub, profiled blades. AD's good thru 2009-12. Run-up and leak check good.-----END-----

The maintenance operation(s) described above were inspected in accordance with current regulations and with respect to work performed, the aircraft and/or component was found airworthy and is approved for return to service. Details are on file under work order **5258**.



Paul W. Enlow
Repair Station MYNR748K

ns.




MONTGOMERY
AVIATION, INC.

11329 East State Road 32
Zionsville, IN 46077
317 - 769 - 4487

Certified Repair Station No. MYNR748K

August 2, 2010 N653GS S/N FP4841B Flight Time 219.1
Annual Inspection Completed This Date. Inspected IAW Cirrus Inspection Report
ATA 05-20. Lubed prop per M/M.
ADs searched thru BW 2010-15.
See AD list for full details.
The maintenance operation(s) described above were inspected in accordance
with current regulations and with respect to work performed, the aircraft and/or
component was found airworthy and is approved for return to service.
Details are on file under work order 5800

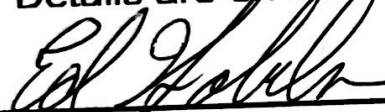

Ed Hobelman
MYNR748K



MONTGOMERY
AVIATION, INC.

11329 East State Road 32
Zionsville, IN 46077
317 - 769 - 4487

Certified Repair Station No. MYNR748K

late

**September 8, 2011 N653GS M/N SR20 S/N 1698 FLT and Prop/TT 239.6 Hobbs
298.0**

**Annual inspection completed this date I/A/W Cirrus SR20 Ch.5 Scheduled
Maintenance Report. Lubed hub and profiled blades. AD's good thru 2011-16. Run-up
and operational check good.-----END-----**

The maintenance operation(s) described above were inspected in accordance with current regulations and with respect to work performed, the aircraft and/or component was found airworthy and is approved for return to service. Details are on file under work order **6389**.

Paul W. Enlow

Paul W. Enlow
Repair Station MYNR748K

MA MONTGOMERY
AVIATION, INC.
11329 East State Road 32
Zionsville, IN 46077
317-769-4487

Certified Repair Station No. MYNR748K

S,
tions.


October 16, 2012 N653GS S/N FP4841B Flight Time 251.6 TTP 251.6
100hr/Annual Inspection Completed This Date. Inspected IAW Cirrus Inspection Report
ATA 05-20. Lubed and inspected OK.

ADs checked thru BW 2012-20

See AD list for full details.

The maintenance operation(s) described above were inspected in accordance with
current regulations and with respect to work performed, the aircraft and/or
component was found airworthy and is approved for return to service.

Details are on file under work order

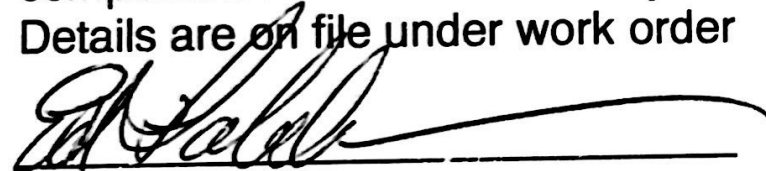

Ed Hobelman

MYNR748K



MONTGOMERY
AVIATION, INC.

11329 East State Road 32
Zionsville, IN 46077
317-769-4487

Certified Repair Station No. MYNR748K

Propeller
N TSO


A/C
Hrs

Description of all operations pertaining to Airworthiness Directives,
Service Documents, Overhaul, Major or Minor Repair, and Inspections.

**November 8, 2013 N653GS M/N SR20 S/N 1698 Hobbs 355.0/ FLT and Prop/TT
283.8**

**Performed annual inspection IAW Cirrus AMM 05-20 inspection check list. Lubed hub
and blades inspected ok. AD's good thru 2013-22. Run up and operational check
good.-----END-----**

The maintenance operation(s) described above were inspected in accordance with current
regulations and with respect to work performed, the aircraft and/or component was found
airworthy and is approved for return to service. Details are on file under work order **7556**.


Michael Peter
Repair Station MYNR748K



**MONTGOMERY
AVIATION, INC.**


11329 East State Road 32
Zionsville, IN 46077
317-769-4487

Certified Repair Station No. MYNR748K

**December 5, 2014 N653GS M/N PHC-J3YF-1RF S/N FP4841B FLT Time and Prop
TSN 318.3 Hobbs Time 398.6**

**Annual inspection completed I/A/W Cirrus SR20 AMM Ch. 5 Pages 4-22. Profiled
blades, lubed hub. Run-up and operational checks good. No leaks found. Reviewed
AD's thru 2014-12-2-----END-----**

The maintenance operation(s) described above were inspected in accordance with current regulations and with respect to work performed, the aircraft and/or component was found airworthy and is approved for return to service. Details are on file under work order **8057**.

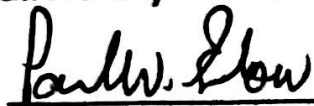

Paul W. Enlow
Repair Station MYNR748K


 **MONTGOMERY**
Aviation, Inc.
11329 East State Road 32
Zionsville, IN 46077
317-769-4487

Certified Repair Station No. MYNR748K

Date: 03/02/2017 N653GS M/N: PHC-J3YF-1RF/F7392-1 S/N: FP4841B
Hobbs Time: 443.5 Flt Time and Propeller Total Time: 352.5

Performed Annual/100 hour inspection IRW Cirrus SR20 CH5-20 scheduled inspection report. Profiled blades and lubed hub. Final run-up ops and leak check ok. AD's reviewed thru 03/02/2017. -----END-----

The maintenance operation(s) described above were inspected in accordance with current FAA regulations and with respect to work performed, the aircraft and/or component was found airworthy and is approved for return to service. Details are on file at this agency under work order **8923**.

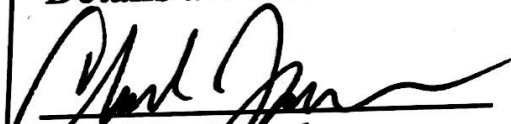
Chad Jachowski.
1MYR828C



11329 East State Road 32
Zionsville, IN 46077
317-769-4487

Certified Repair Station No. 1MYR828C

--	--	--	--

Propeller
TSN TSO

A/C
Hrs


Description of all operations pertaining to Airworthiness Directives,
Service Documents, Overhaul, Major or Minor Repair, and Inspections.

April 13, 2018 N653GS M/N: PHC-J3YF-1RF/F7392-1 S/N: FP4841B
Hobbs Time: 466.7 Flight Time and Total Propeller Time: 369.1

Complied with annual inspection I.A.W. Far 43 Appendix D referencing SR20 AMM Ch. 05-20 scheduled inspection report. Lubricated prop hub and profiled leading edges of blades as required. Dynamically balanced propeller as required using DYNAVIBE prop balancer. 7 Grams of balance weight added at station 320 at 4.25 inches. Post run-up, ops and leak checks ok. AD's reviewed through 04/13/2018.

The maintenance operation(s) described above were inspected in accordance with current FAA regulations and with respect to work performed, the aircraft and/or component was found airworthy and is approved for return to service.

Details are on file at this agency under work order **18-9431**.


John J. Edwards
1MYR828C

 **MONTGOMERY**
Aviation, LLC.

11329 East State Road 32
Zionsville, IN 46077
317-769-4487

Certified Repair Station No. 1MYR828C

Date: 4/26/2019; Aircraft: N653GS; Type: SR20; S/N: 1698

Tach: 387.3 Hobbs: 491.3 PTT: 387.3

Prop

Completed Annual on prop. Prop found to be airworthy at this time. AD checked through 4-15-2019.

The aircraft, engine, propeller, or appliance identified above was repaired and/or inspected in accordance with current regulations of the Federal Aviation Administration and was determined airworthy and approved for return to service. Pertinent details of the repair are on file at this repair station under W/O # 19-44331, dated 26 APR 2019.

Signed



Tom Wood Aviation, Inc./Indianapolis Metropolitan Airport
9913 Willow View Rd, Fishers, IN 46038
FAA Certified Repair Station CRS #1TWR915M

Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
----------------------	------------	---

May 6, 2020
Propeller Total Time: 416.1

N653GS

M/N: Hartzell PHC-J3YF-1RF
Flight Time: 416.1

S/N: FP4841B
Hobbs: 531.6

Performed an annual inspection IAW FAR 43 Appendix D referencing Cirrus SR20 AMM inspection checklists as a guide. Inspected hub and dressed blades as required. Adjusted prop governor as required. Final run-up ops check ok. AD's reviewed thru 05/06/2020.

The maintenance operation(s) described above were inspected in accordance with current FAA regulations and with respect to work performed, the aircraft and/or component was found airworthy and is approved for return to service.
Details are on file at this agency under work order 20-10679.



John J. Edwards
CRS# 1MYR828C



11329 East State Road 32, Zionsville, IN 46077 | 317-769-4487 | CERTIFIED REPAIR STATION NO. 1MYR828C

June 15, 2021
Propeller Total Time: 428.1


N653GS

M/N: Hartzell PHC-J3YF-1RF
Flight Time: 428.1

S/N: FP4841B
Hobbs: 550.0

Performed an annual inspection IAW FAR 43 Appendix D referencing Cirrus SR20 AMM inspection checklists as a guide. Inspected hub and dressed blades as required. Adjusted prop governor as required. Final run-up ops check ok. AD's reviewed thru 06/15/2021.

The maintenance operation(s) described above were inspected in accordance with current FAA regulations and with respect to work performed, the aircraft and/or component was found airworthy and is approved for return to service.
Details are on file at this agency under work order 21-11502.


John J. Edwards
CRS# 1MYR828C

