

HARTZELL

PROPELLER LOGBOOK

PROPELLER MODEL PHC-J3YF-1N/N7605B

PROPELLER S/N FP5016B

LOGBOOK # 1

PROPELLER MAINTENANCE RECORD

Position _____

PITCH RANGE

Propeller Model PHC-J3YF-1N/N7605B

High/Feather _____

Propeller S/N FP5016B

Start Lock _____

Blade Design _____

Low _____

Blade S/N's

Reverse _____

No. 1 A0023

No. 2 A0016

Aircraft Manufacturer CIRRUS DESIGN

No. 3 A0020

Aircraft Model SR-22

No. 4 _____


S/N 2090

No. 5 _____

Registration N905SE

No. 6 _____

Spinner Assembly Part No. _____

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		
16 AUG 06	0.0	0.0	0.0	<p>I have Dynamically Balanced Propeller IAW Hartzell Propeller Owner's Manual 145 Rev. 3 Dated July 2006 Section 61-00-45 on <u>16 AUG 06</u> (DATE). The location of the Weight(s) are <u>70 , 190</u> degree And are <u>12.0 , 9.7</u> gram(s).</p> <p> (Sign/Stamp) Cirrus Design Corporation, PC 338CE</p>

LEAD
83

(Sign/Stamp)

PC 338CE

PROP MODEL
PHC-J3YF-1N
PROP S/N: FP5016B
REG NO: 905SE
WORK ORDER
7968-12-2006



Cirrus Design Factory Service Center

Repair Station No YD5R855Y
4515 Taylor Circle
Duluth, MN 55811
Phone 218- 788-3101

DATE: 12/8/2006
A/C TSN: 488
PROP TT: 488
HOBBS: 64.4

Prop Entries

(6) Researched propeller ADs through bi-weekly issue 2006-24, all ADs are in compliance at this time

I have reviewed the file on this aircraft and the accompanying discrepancy forms. The aircraft, airframe, aircraft engine, propeller, or appliance identified was repaired/inspected in accordance with current requirements of the Federal Aviation Administration and is approved for return to service. Pertinent details of repair are on file at this Certified Repair Station CRS YD5R855Y

DATE: 12/8/2006

SIGNED:

Joseph Sullivan
Certified Repair Station No YD5R855Y

Work Order: 7968-12-2006

Printed by EBis 3 (datcomedia.com)

PROP MODEL:
PHC-J3YF-1N
PROP S/N: FP5016B
REG. NO: N905SE
WORK ORDER: 071231

Clear Star Aviation LLC

Repair Station No. 5CSR009B
4765 Frank Luke Drive
Addison, Texas 75001
Phone: 972-267-2376

DATE: 1/11/2008
A/C TSN: 103
PROP TT: 103
HOBBS: 131.9

Prop Entries

Serviced prop

This propeller was inspected referencing an annual inspection using the Cirrus SR22 maintenance manual checklist and was determined to be in airworthy condition. Pertinent details are on file at this repair station under Work Order No. 071231.

DATE: 1/11/2008

SIGNED:

Work Order: 071231

Printed by EBis 3 (datcomedia.com)



AAR AIRCRAFT SERVICES® OKLAHOMA

Removed alcohol boots and ultrasonically inspected blade serial numbers A0023, A0016, A0020 I/A/W Service Bulletin 61-306 rev.2 as terminating action for bulletin; No Defects Noted. Installed new anti-ice boots to facilitate inspection and statically balanced propeller I/A/W Hartzell M.M. 183 rev.1 and 202A V1 rev34, V7 rev32, V11 rev.30. This propeller was repaired and inspected in accordance with current regulations of the Federal Aviation Agency. Pertinent details of the repair are on file under AAR work order 1005435.

PTSN: 175.9 PTSO: N/A

Prop Model: PHC-J3YF-1N Serial Number: FP5016B Blade Model: N7605B

Blade SN: #1 - A0023 #2 - A0016 #3 - A0020

"Approved for Return to Service" 10/09/2009

**AAR
A-151**

For AAR Aircraft Services-Oklahoma CRS JR2R936K



Will Rogers World Airport

6611 South Meridian · Oklahoma City, Oklahoma 73159

Date	Propeller TSN TSO		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	CAM CERTIFIED AIRCRAFT MAINTENANCE 12925 Wildcat Way, Burleson, TX, 76028 PROP: Hartzell		MODEL: PHC-J3YF-1N	S/N: FP5016B HOBBS: 445.4 DESCRIPTION OF WORK PERFORMED: I Certify this aircraft Propeller has been inspected IAW a 100 Inspection and has been determined to be in airworthy condition. <u>January 13, 2014</u> DATE
	CAM CERTIFIED AIRCRAFT MAINTENANCE 12925 Wildcat Way, Burleson, TX, 76028 PROP: Hartzell		MODEL: PHC-J3YF-1N	S/N: FP5016B HOBBS: 470.1 Flight Hobbs: 365.4 DESCRIPTION OF WORK PERFORMED: Greased the Prop Hub. I Certify this aircraft Propeller has been inspected IAW a 100 Inspection and has been determined to be in airworthy condition. <u>January 15, 2015</u> DATE

Clifford A. Mellican
 SIGNATURE A&P 3456353

[Signature] 3677972
 SIGNATURE A&P

CAM CERTIFIED AIRCRAFT MAINTENANCE 12925 Wildcat Way, Burleson, TX, 76028

PROP: Hartzell

MODEL: PHC-J3YF-1N

S/N: FP5016B

HOBBS: 514.1

Flight Hobbs 400.0

DESCRIPTION OF WORK PERFORMED:

Serviced Prop per Hartzell Service Manual. I Certify this aircraft Propeller has been inspected IAW a 100 Inspection and has been determined to be in airworthy condition.

February 1, 2016

DATE

[Signature] 3677972
SIGNATURE **A&P**

CAM CERTIFIED AIRCRAFT MAINTENANCE 12925 Wildcat Way, Burleson, TX, 76028

PROP: Hartzell

MODEL: PHC-J3YF-1N

S/N: FP5016B

HOBBS: 560.0

DESCRIPTION OF WORK PERFORMED:

Performed 100 hour inspection in accordance with FAR 43, appendix D. I certify this aircraft Propeller has been inspected IAW a 100 Inspection and has been determined to be in airworthy condition.

FH: 434.4


March 9, 2017

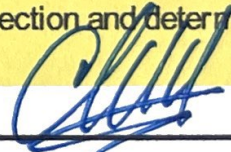
DATE

SIGNATURE

[Signature] 3316147
A&P

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		

CAM CERTIFIED AIRCRAFT MAINTENANCE 12925 Wildcat Way, Burleson, TX, 76028			
PROP:	Hartzell	MODEL: PHC-J3YF-1N	S/N: FP5016B
		FH: 450.1	HOBBS: 580.1
DESCRIPTION OF WORK PERFORMED:			
Performed 100 hr inspection. Serviced propeller with Aeroshell 6, IAW service tag.			
"I have inspected this propeller in accordance with a 100 hr inspection and determined it to be in an airworthy condition in accordance with FAR Part 43 App D."			
April 5, 2018		 3646133	
DATE		SIGNATURE	A&P

CAM CERTIFIED AIRCRAFT MAINTENANCE 12925 Wildcat Way, Burleson, TX, 76028			
PROP:	Hartzell	MODEL: PHC-J3YF-1N	S/N: FP5016B
		FH: 468.5	HOBBS: 604.7
DESCRIPTION OF WORK PERFORMED:			
Performed 100 hr inspection. Serviced propeller with Aeroshell 6, IAW service tag.			
"I certify this propeller has been inspected in accordance with a 100hr inspection and determined it to be in an airworthy condition."			
June 4, 2019		 351642	
DATE		SIGNATURE	A&P

CAM CERTIFIED AIRCRAFT MAINTENANCE 12925 Wildcat Way, Burleson, TX, 76028

PROP: Hartzell

MODEL: PHC-J3YF-1N

S/N: FP5016B

FH: 480.6

HOBBS: 625.6

DESCRIPTION OF WORK PERFORMED:

Performed 100 hr inspection. Serviced propeller with Aeroshell 6, IAW service tag.

"I have inspected this propeller in accordance with a 100 hr inspection and determined it to be in an airworthy condition in accordance with FAR Part 43 App D."

June 8, 2020

DATE

SIGNATURE

[Signature] 3564144

A&P

CAM CERTIFIED AIRCRAFT MAINTENANCE 12925 Wildcat Way, Burleson, TX, 76028

PROP: Hartzell

MODEL: PHC-J3YF-1N

S/N: FP5016B

FH: 483.4

HOBBS: 631.6

DESCRIPTION OF WORK PERFORMED:

Performed 100 hour inspection IAW FAR 43 appendix D.

"I have inspected this Propeller in accordance with a 100 hr inspection and determined it to be in an airworthy condition in accordance with FAR Part 43 App D."

June 22, 2021

DATE

SIGNATURE

[Signature] 3516142

A&P

