



# **TIFFIN AIRE INC.**

**3861 Co. Rd. 140  
Findlay, Ohio 45840**

**1-800-553-7767  
Fax 419-299-3244**

**Propeller Log Book**

---

THIS SERVICE RECORD shall accompany the propeller equipment at all times. When equipment is installed as part of an Aircraft or engine, this record shall be maintained concurrently with and become a part of the Aircraft and Engine Service Records.

---

# SERVICEABLE

PROPELLER  
UNIT

MCCAULEY  
MAKE

1C172/TM7458  
MODEL

E16820  
SERIAL NUMBER

The component identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service.

Pertinent details of the repair are on file at this repair station under:

OWNER WENTWORTH AIRCRAFT

WORK ORDER NO. 13356

DATE 08/04/97

SIGNED FOR

Tiffin Aire Inc.  
3861 County Road 140  
Findlay, Ohio 45840  
419-299-3562  
800-553-7767  
FAX 419-299-3244

F.A.A. Repair Station Number IC5R930M

Owner Name WENTWORTH AIRCRAFT, INC.

Address 3015 CEDAR AVENUE SOUTH  
MINNEAPOLIS, MN 55407

Propeller Make McCurdy

Propeller Model IC172/TM 7458

Blade Model —

Hub Serial No. E 16820

Blade Serial No. 1 —

2 —

3 —

4 —

#### PITCH RANGE

High — Low —

Feather — Reverse —

Maximum Hours or Service Life between overhaul required by Mfg. — Hrs. or —

years interval between overhauls. At Engine Overhaul.

# MAINTENANCE & SERVICE HISTORY

Date 08/04/97

Tach/Hobbs Time UNKNOWN

Propeller Total Time UNKNOWN

Propeller Time Since Overhaul -0-

COMPLETELY RECONDITIONED PROPELLER IN ACCORDANCE WITH  
MCCAULEY SERVICE MANUAL #730720. REPITCHED PROPELLER  
FROM 53" to 58" SPECS. RECONDITIONED SPACER.


COMPLETED WITH SERVICE LETTERS 83-7, 83-8, 83-8-1.

COMPLIED WITH SERVICE BULLETINS 137K, 195.

Work Performed By Tiffin Aire Inc.

Repair Station #IC5R930M. Work Order/Invoice # 13356

Signature

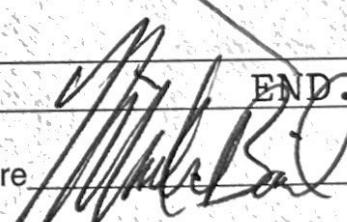END.

Signatures  
and Station  
Numbers

TACH 0-

TOTAL TIME

AIRFRAME

6647.6

@ INSTALL

N185SR

# MAINTENANCE & SERVICE HISTORY

## MAINTENANCE & SERVICE HISTORY



1817 Hwy 10W  
Detroit Lakes MN 56501

N185SR TT 76.7 TSPOH 76.7 April 26, 2024

Complied with a 100 hour inspection.  
AD search complied with thru this date.

I certify that this propeller has been inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition.

Sign Erik Carlson Date 4-26-2024  
Erik Carlson A&P 2826620

Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers

12760 EAST  
N185SR N  
15 October 2025  
100 Hour Inspection  
of FAR 43 Appendix  
forward spinner b  
through Biweekly  
ACCORDANCE  
AIRWORTHY


# ARAPAHOE AERO

12760 EAST CONTROL TOWER ROAD ENGLEWOOD, COLORADO 80112 (303) 799-8386

N **N185SR McCauley 1C172/TM7458 S/N: E16820 Total Time: Unknown** Y

**15 October 2025 Tach Time: 89.2 Since Reconditioning: 89.2 Calendar Time: 28 Years 2 Mo.**

**100 Hour Inspection for Annual** completed this date using a check list that contains the scope and detail of FAR 43 Appendix D as a guide. Checked attach bolts, hub, blades, bulkhead and spinner. Shimmed forward spinner bulkhead for proper preload. Dressed blade leadings edges as needed. AD's checked through Biweekly 2025-20. **I CERTIFY THAT THIS PROPELLER HAS BEEN INSPECTED IN ACCORDANCE WITH A 100 HOUR INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION**



Kevin Mosher A&P3443784

w/o 46222

Date

es  
on  
s

# MAINTENANCE & SERVICE HISTORY

# MAINTENANCE & SERVICE HISTORY

